



CONDITION REPORT



Report No:
2017298899
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	ISUZU	Registration Number	FP50ZJGP
Model	KB250 HO FLEETSIDE SAFETY DSL PU [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	ADMNRRHR7G4793421	Last COR	
Engine Number		License Expiry Date	31/08/2025
Doors	2	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2016	Fuel	DIESEL
Km Reading	239,896 KM	Transmission	MANUAL
Cab / Body Type	SINGLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:
2017298899
DATE
15/09/2026

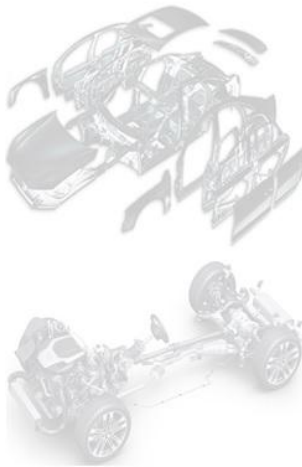

Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Discoloured	Repair
Tailgate Dented	Repair
Rear bumper Dented	Repair
Windscreen Chipped	Repair
Steering box Leak	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Gearbox Oil Sweat	Repair
Differential Oil Sweat	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.2	4.4	-	
Rear	2.8	2.8	-	
Emergency / Parking	1.8	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	111T	Kumho	Road venture	V	4123	4 mm
Front Right	245/70R16	111T	Kumho	Road venture	V	4123	4 mm
Rear Left	245/70R16	111S	Velocity	Raptor	V	3717	4 mm
Rear Right	245/70R16	111S	Velocity	Raptor	V	1618	4 mm
Spare	245/70R16	107S	Firestone	Destination	V	4119	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:

2017298899

DATE

15/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	NOT PRESENT	P0661	INTAKE MANIFOLD TUNING VALVE CONTROL CIRCUIT LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:

2017298899

DATE


15/09/2026

Shock and brake report			
Vehicle	Isuzu	Engine	2.5L
Year	2016	Transmission	Manual
Registration	1177	Engine	2.5L
Test results		Results	
Shock absorber	OK	Shock absorber	OK
Brake	OK	Brake	OK
Steering	OK	Steering	OK
Chassis	OK	Chassis	OK
Wheels	OK	Wheels	OK
Tires	OK	Tires	OK
Engine	OK	Engine	OK
Transmission	OK	Transmission	OK
Brake	OK	Brake	OK
Steering	OK	Steering	OK
Chassis	OK	Chassis	OK
Wheels	OK	Wheels	OK
Tires	OK	Tires	OK

Shock and brake report

Diagnostic report			
Vehicle	Isuzu	Engine	2.5L
Year	2016	Transmission	Manual
Registration	1177	Engine	2.5L
Test results		Results	
Shock absorber	OK	Shock absorber	OK
Brake	OK	Brake	OK
Steering	OK	Steering	OK
Chassis	OK	Chassis	OK
Wheels	OK	Wheels	OK
Tires	OK	Tires	OK
Engine	OK	Engine	OK
Transmission	OK	Transmission	OK
Brake	OK	Brake	OK
Steering	OK	Steering	OK
Chassis	OK	Chassis	OK
Wheels	OK	Wheels	OK
Tires	OK	Tires	OK

Diagnostic report

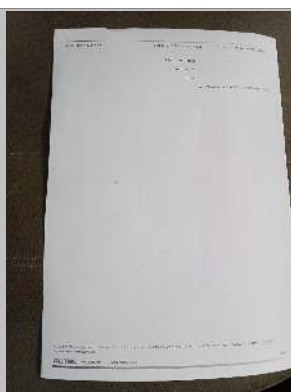

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:

2017298899

DATE

15/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:


2017298899

DATE


15/09/2026




90 DEGREE LEFT

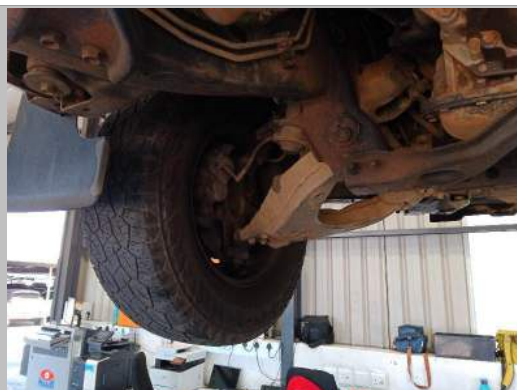

LF TYRE TREAD

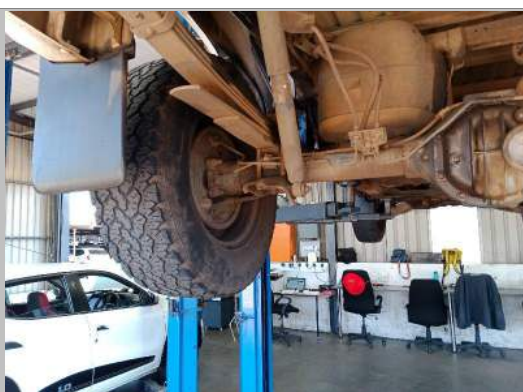

LR TYRE TREAD

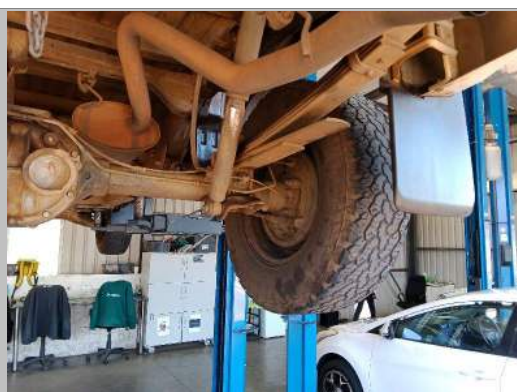

RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:

2017298899

DATE

15/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:
2017298899
DATE
15/09/2026



Oil cap and dipstick



Seat Front Right



Water level



Bonnet



Windscreen



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:
2017298899
DATE
15/09/2026



Rear Fender Right



B • Pillar Right



Front Fender Right



Front Bumper



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:

2017298899

DATE

15/09/2026



Rear Fender Left



Tailgate



Rear bumper



Rear bumper



Differential



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421



CONDITION REPORT



Report No:
2017298899
DATE
15/09/2026



Steering box



Bolt(s) / Nut(s) Front Wheel Right



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRRHR7G4793421