



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	MR98VSGP
Model	NP300 HARDBODY 2.5TDI HI-RIDER D-CAB DSL PU [2013-2022]	Register Number	
VIN	ADNCPGD22ZR098925	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	171,995 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:

2017296439

DATE

09/09/2026

Damage

Repair Way

Tail Light Left Cracked
 Tail Light Right Damaged
 Front Bumper Paintwork • Scratched
 Bonnet Paintwork • Chipmarks
 Rear Fender Left Dented
 Rear Fender Right Dented
 Door Front Right Paintwork • Scratched
 ABS light on

Replace
 Replace
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.51	3.61	-	
Rear	3.43	3.41	-	
Emergency / Parking	2.49	2.86	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	111/109T	Goodyear	Wrangler	V	2321	5 mm
Front Right	245/70R16	111/109T	Goodyear	Wrangler	V	2520	5 mm
Rear Left	245/70R16	111/109T	Goodyear	Wrangler	V	0722	4 mm
Rear Right	245/70R16	111/109T	Goodyear	Wrangler	V	4921	5 mm
Spare	245/70R16	111/109T	Goodyear	Wrangler	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C111	PUMP MOTOR	CURRENT

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



MANUAL GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026



LR TYRE TREAD



RR TYRE TREAD



ENGINE 1



ENGINE 2



CHASSIS



OIL CAP AND DIPSTICK

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026



COOLANT BOTTLE




SPARE WHEEL




LICENSE DISC



VIN PLATE OR STICKER

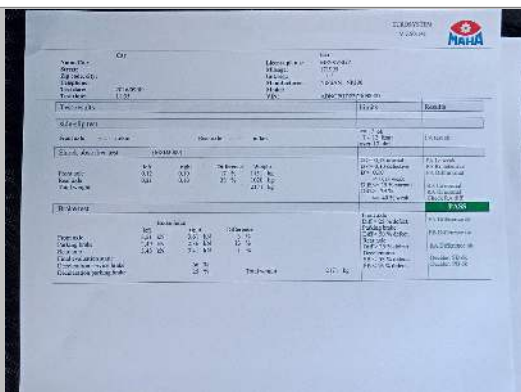

SHOCK AND BRAKE TEST REPORT

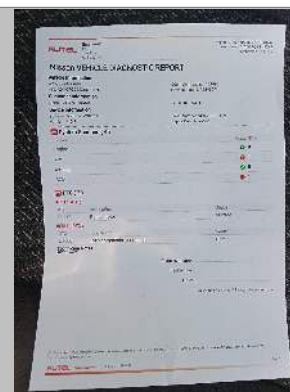

DIAGNOSTIC REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026



Water level



Tail Light Right



Tail Light Left



Rear Fender Right



Door Front Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925



CONDITION REPORT



Report No:
2017296439
DATE
09/09/2026



Bonnet



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNCPGD22ZR098925