



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	LJ17RHGP
Model	RANGER 2.0 XL HR DSL SUPER CAB PU OPT PLAN AT [2023-2026]	Register Number	
		Date Of First Licensing	
VIN	AFAGXXMJ2GPT82030	Last COR	
Engine Number		License Expiry Date	
Doors	2	Power / Displacement	
Color	GREY	Paint Finish	M - METALLIC
Year Model	2023	Fuel	DIESEL
Km Reading	92,499 KM	Transmission	AUTOMATIC
Cab / Body Type	SUPER CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026

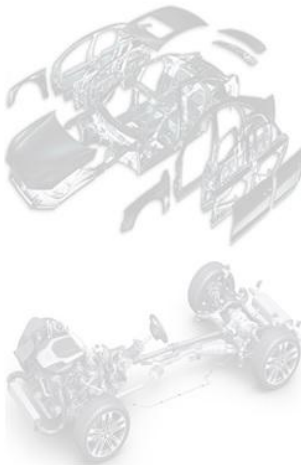

Damage	Repair Way
Front Fender Left Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.0	4.9	-	
Rear	3.2	2.5	-	
Emergency / Parking	2.4	2.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/70R17	111T	Goodyear	Wrangler	V	4724	4 mm
Front Right	255/70R16	111T	Goodyear	Wrangler	V	4724	4 mm
Rear Left	255/70R17	111T	Goodyear	Wrangler	V	3823	2 mm
Rear Right	255/70R17	111T	Goodyear	Wrangler	V	3823	2 mm
Spare	255/70R17	112T	Continental	Contact	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	U3003:68-2C	BATTERY VOLTAGE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR, MINOR DENTS AND SCRATCHES NOTED ON VEHICLE BODY, EXTERIOR, INTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026

Vehicle Information			
Make/Model	Car	Year	2017
Engine/Type	1.8 TFSI	Power	125 kW
Registration	2017/09/16	Vehicle No.	2017/09/16
Inspection	16/09/2026	Inspector	DEKRA
Shock and Brake Report			
Component	Left	Right	Result
Shock absorbers	OK	OK	Pass
Brake pads	OK	OK	Pass
Brake discs	OK	OK	Pass
Brake lines	OK	OK	Pass
Brake master cylinder	OK	OK	Pass
Brake booster	OK	OK	Pass
Brake pedal	OK	OK	Pass
Brake fluid level	OK	OK	Pass
Brake fluid condition	OK	OK	Pass
Brake system overall	OK	OK	Pass

Shock and brake report

Vehicle Diagnostic Report	
Vehicle ID	2017/09/16
Engine/Type	1.8 TFSI
Power	125 kW
Registration	2017/09/16
Inspection	16/09/2026
Inspector	DEKRA
Diagnostic Results	
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Lighting	OK
Electrical	OK
Exhaust	OK
Overall	OK

Diagnostic report

Vehicle Diagnostic Report	
Vehicle ID	2017/09/16
Engine/Type	1.8 TFSI
Power	125 kW
Registration	2017/09/16
Inspection	16/09/2026
Inspector	DEKRA
Diagnostic Results	
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Lighting	OK
Electrical	OK
Exhaust	OK
Overall	OK

Diagnostic report



Spare wheel



Expenditure bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:

2017299332

DATE

16/09/2026



Automatic



FRONT RIGHT CORNER




REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

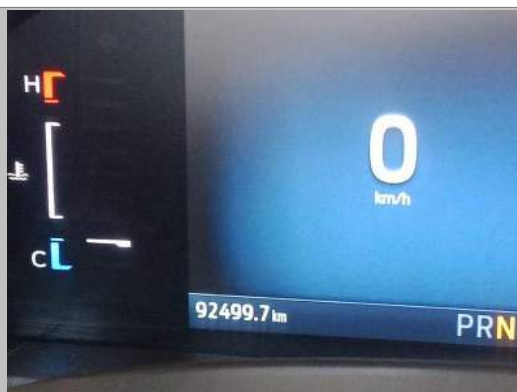

ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026



90 DEGREE FRONT




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

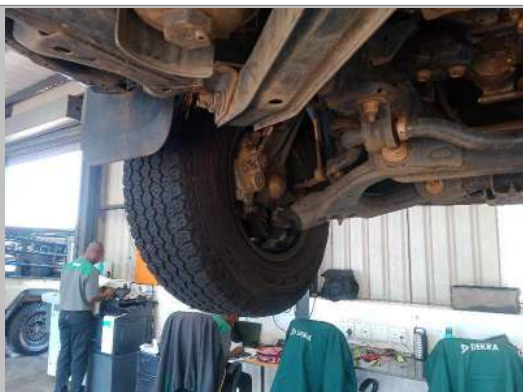

LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:


2017299332

DATE

16/09/2026



RR TYRE TREAD

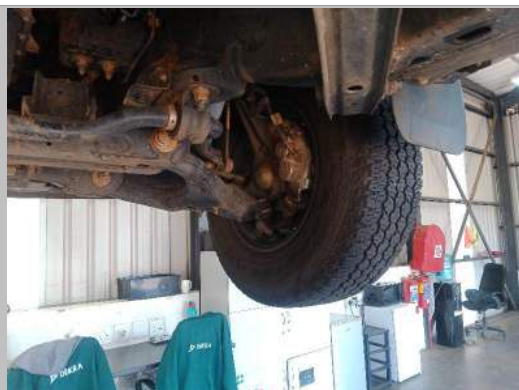

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026

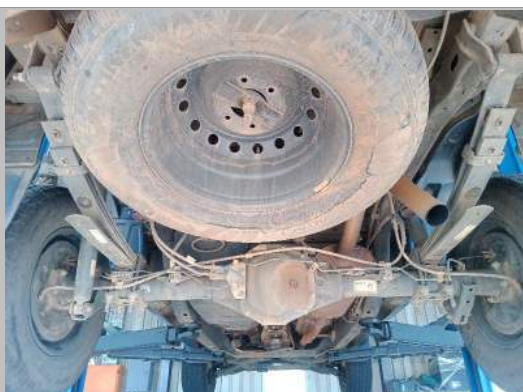

CHASSIS



Windscreen



Water level



Tailgate



Rear Fender Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030



CONDITION REPORT



Report No:
2017299332
DATE
16/09/2026



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GPT82030