



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	NC66XZGP
Model	RANGER 3.2 TD XLT 4X4 D-CAB DSL PU AT [2011-2016]	Register Number	
		Date Of First Licensing	
VIN	AFAPXXMJ2PCC43892	Last COR	
Engine Number		License Expiry Date	30/06/2027
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2012	Fuel	DIESEL
Km Reading	357,387 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:

2017296305

DATE

09/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Hoses Damaged	Replace
Under bonnet insulation cover Damaged	Replace
Central Air Vent Damaged	Replace
Engine Management Lights Set	Repair
Windscreen Wiper Damaged	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Fog Light Front Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Door Panel Front Left Damaged	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Damaged	Replace
C • Pillar Right Damaged	Replace
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Repair
Gear Selections Malfunction	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	117S	BFGoodrich	Radial	V	1721	0 mm
Front Right	265/65R17	117S	BFGoodrich	Radial	V	2521	0 mm
Rear Left	265/65R17	117S	BFGoodrich	Radial	V	0620	0 mm
Rear Right	265/65R17	117S	BFGoodrich	Radial	V	0720	0 mm
Spare	265/65R17	112S	Bridgestone	Radial	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM	P0335:31-6C	CRANKSHAFT POSITION SENSOR A CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 16 DTC'S AT TIME OF TESTING SEE DTC REPORT. Engine Compartment: signs of water leak on bottom of engine cannot pinpoint.

Electrical Components and Instruments: vehicle struggles to start.

Interior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Vehicle body in poor condition.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT




Report No:


2017296305

DATE _____


09/09/2026

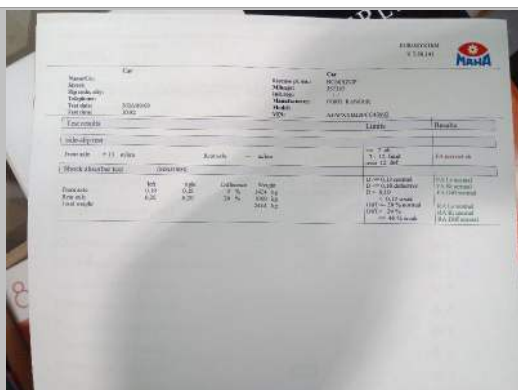

Brake test.

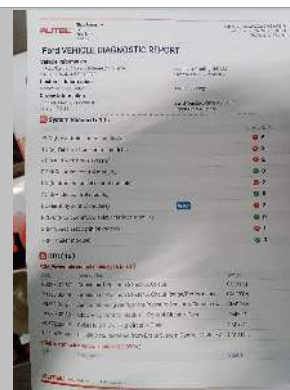

Diagnostic.

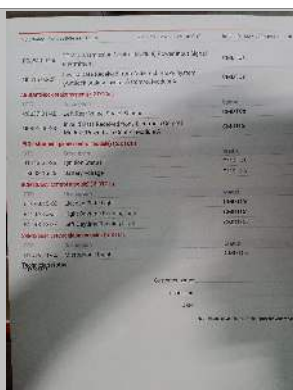

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:

2017296305

DATE

09/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Hoses

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



Water level



Under bonnet insulation cover




Front Bumper



Front Bumper



Bonnet

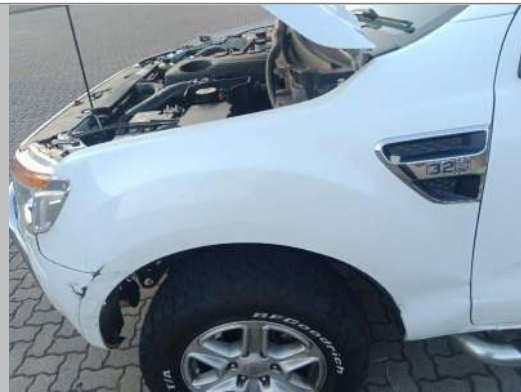

Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



Rear Fender Left




C • Pillar Left



Front Fender Right



Rear Fender Right

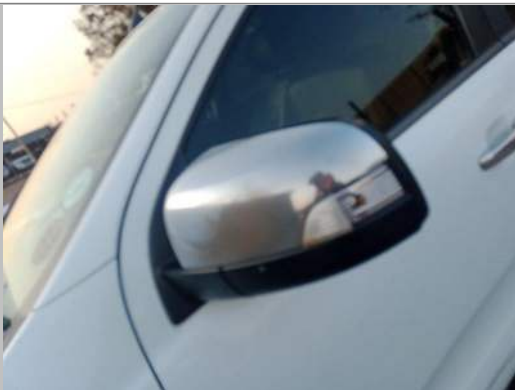

Side Mirror Left



Tailgate

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026




Rear bumper



Rear bumper



Door Front Left

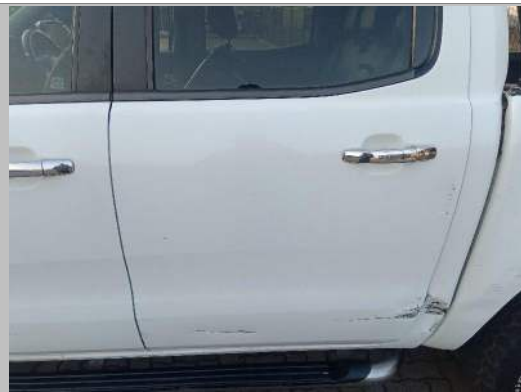

Door Rear Left



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026




C • Pillar Right



Door Front Right



Side Mirror Right

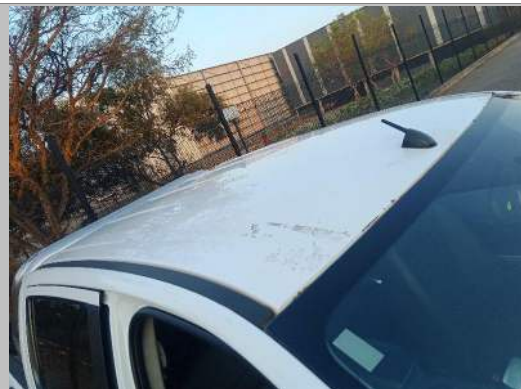

Roof



Seat Front Right



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



Door Panel Front Left



Tail Light Left



Tail Light Right



Fog Light Front Right



Windscreen Wiper



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



Central Air Vent



Central Air Vent



Gear Selections



Tyre Rear Left



Tyre Rear Right



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892



CONDITION REPORT



Report No:
2017296305
DATE
09/09/2026



Tyre Front Left



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PCC43892