



CONDITION REPORT



Report No:
2017298884
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LZ82ZHGP
Model	FORTUNER 2.4 GD-6 RB DSL AT [2016-2017]	Register Number	
VIN	AHTCB8GS802201973	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2026
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT UNI
Km Reading	193,484 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:

2017298884


DATE

15/09/2026

Damage

Repair Way

Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Spare Tyre Worn	Replace

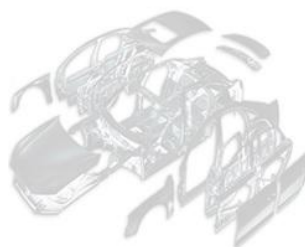

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.52	4.86	-	
Rear	3.65	2.37	-	
Emergency / Parking	3.72	3.92	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112S	Bridgestone	Radial	V	1725	3 mm
Front Right	265/65R17	112S	Bridgestone	Radial	V	1725	3 mm
Rear Left	265/65R17	112S	Bridgestone	Radial	V	3723	3 mm
Rear Right	265/65R17	112S	Bridgestone	Radial	V	3723	3 mm
Spare	265/65R17	112S	Bridgestone	Radial	V	3121	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:
2017298884
DATE
15/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P0340	CAMSHAFT POSITION SENSOR CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 4 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:

2017298884

DATE _____

15/09/2026

[illegible]

Brake test


Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

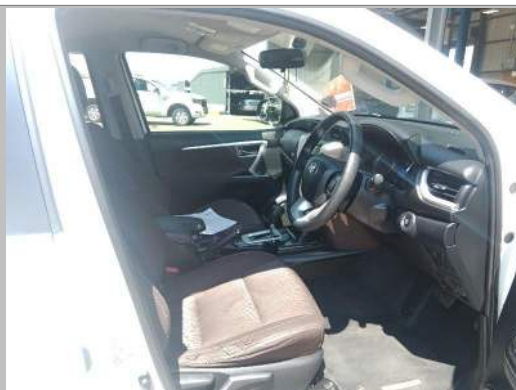

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:

2017298884

DATE

15/09/2026



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:
2017298884
DATE
15/09/2026

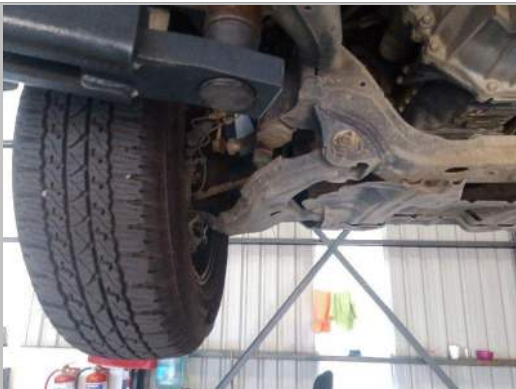


LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

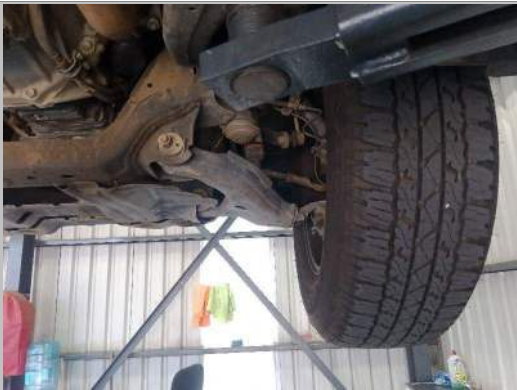

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:
2017298884
DATE
15/09/2026



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973



CONDITION REPORT



Report No:
2017298884
DATE
15/09/2026



Front Bumper



Bonnet



Rear bumper



Front Fender Right



Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973




CONDITION REPORT



Report No:
2017298884
DATE
15/09/2026



Windscreen

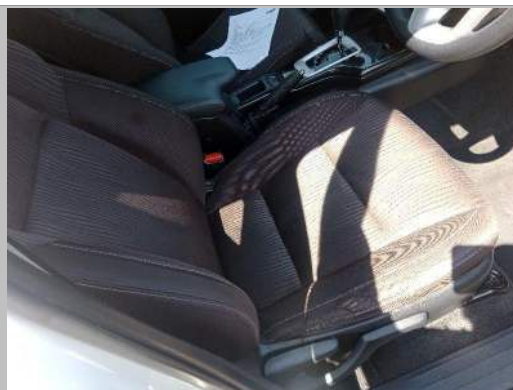

Seat Front Right



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTCB8GS802201973