



CONDITION REPORT



Report No:

2017297655

DATE

11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	HBW290L
Model	HILUX LEGEND45 3.0 D-4D RAIDER 4X4 X-CAB DSL PU [2014-2016]	Register Number	
		Date Of First Licensing	
VIN	AHTHZ29G102205659	Last COR	
Engine Number		License Expiry Date	30/09/2026
Doors	2	Power / Displacement	
Color	SILVER	Paint Finish	M - METALLIC
Year Model	2015	Fuel	DIESEL
Km Reading	251,448 KM	Transmission	MANUAL
Cab / Body Type	SUPER CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:

2017297655


DATE

11/09/2026

Damage

Repair Way

Interior Lights Damaged	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Dented	Repair
Bonnet slam plate (Shock tower/ Inner tray) Welded	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Tailgate Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Tie Rod End left Damaged	Replace
ABS light on	Repair
Both front fog lights malfunction	Repair
L/F tire deferred name brand	Repair
Battery loose	Repair

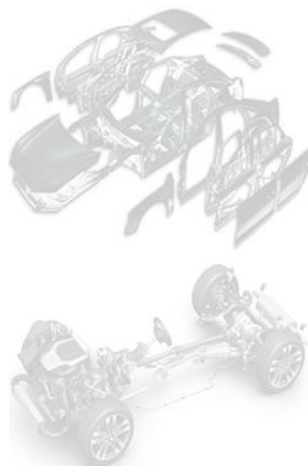

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112T	Goodyear	Wrangler	V	1723	2 mm
Front Right	265/65R17	112T	Goodyear	Wrangler	V	2222	1 mm
Rear Left	265/65R17	112S	Bridgestone	Dueler	V	0922	3 mm
Rear Right	265/65R17	112H	Goodyear	Wrangler	V	0616	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:
2017297655
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CURRENT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:


2017297655

DATE _____

11/09/2026

[illegible]

Shock report

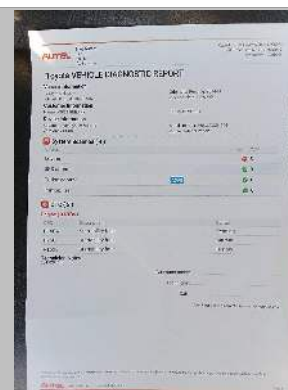

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:
2017297655
DATE
11/09/2026



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:

2017297655

DATE

11/09/2026



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

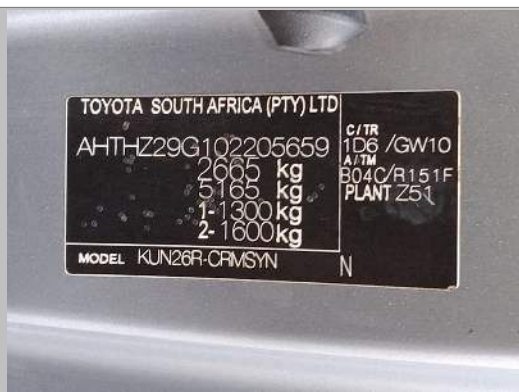

VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:
2017297655
DATE
11/09/2026



ENGINE 1



ENGINE 2



CHASSIS



No spare wheel



Oil cap and dipstick



Coolant bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:
2017297655
DATE
11/09/2026



Interior Lights



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet



Windscreen



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:
2017297655
DATE
11/09/2026



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Door Front Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659



CONDITION REPORT



Report No:
2017297655
DATE
11/09/2026



Tailgate



Tie Rod End left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTHZ29G102205659