



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/01/2024		M57 Pretoria Road - 1619
Inspection Date	04/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LG96ZXGP
Model	QUANTUM	Register Number	
VIN	AHTSS22P007150256	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	21,761 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Hooter Defective	Repair
Tail Light Left Cracked	Repair
Tail Light Right Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Windscreen Cracked	Replace
Caliper 1. Axle left Leak	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Steering box Leak	Repair
Steering Rack Boot Left Defective	Repair
Tyre Front Right Smooth	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Silencer Welded	Repair
Airbag and traction control light	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007150256



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.6	4.5	-	
Rear	1.6	1.7	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/75R14	109/107S	Yokohama	Radial	V	0122	3 mm
Front Right	205/75R14	109/107S	Yokohama	Radial	V	0222	0 mm
Rear Left	205/75R14	109/107S	Yokohama	Radial	V	3122	0 mm
Rear Right	205/75R14	109/107S	Yokohama	Radial	V	3122	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels

Axle and Suspension: No shock test done due to shock machine not working

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016219259


2 / 9

DATE

04/01/2024

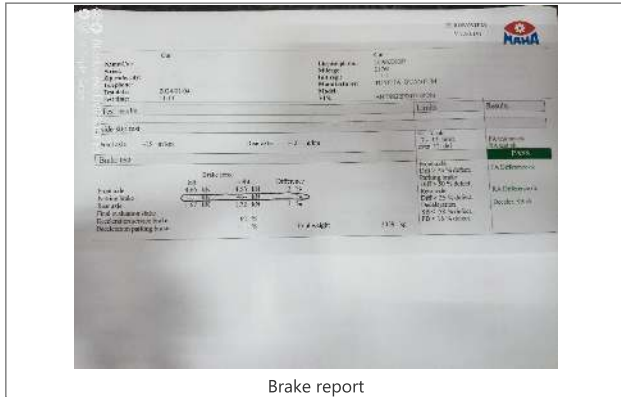

Brake report

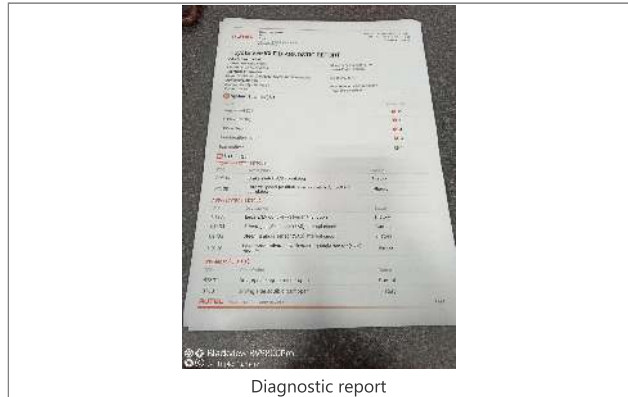

Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

VIN: AHTSS22P007150256

DATE

04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE: 04/01/2024
VIN: AHTSS2200019024
479



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

VIN: AHTSS22P007150256

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

VIN: AHTSS22P007150256


6 / 9



LF TYRE TREAD



LR TYRE TREAD

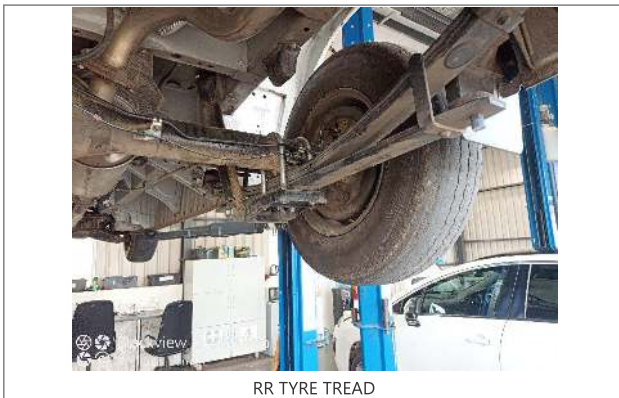

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

VIN: AHTSS22P007150256

7 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024



ENGINE 1



ENGINE 2

VIN: AHTG33907150256
8 / 9



CHASSIS



No spare wheel



Coolant bottle



Manual

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

VIN: AHTSS22P007150256

9 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024



Oil cap and dipstick

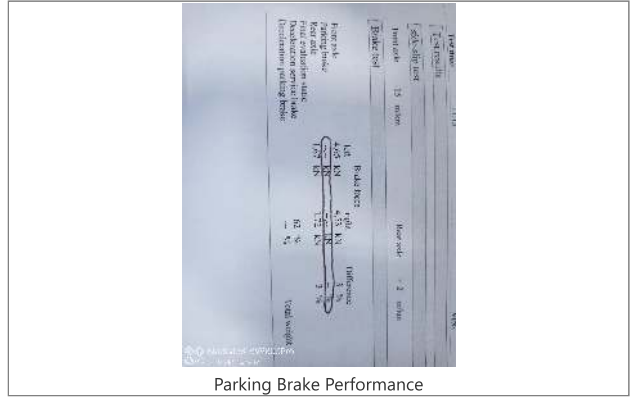

Parking Brake Performance



Water level



Windscreen



Boot Lid / Hatch door



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016217559


DATE
04/01/2024



Tail Light Right

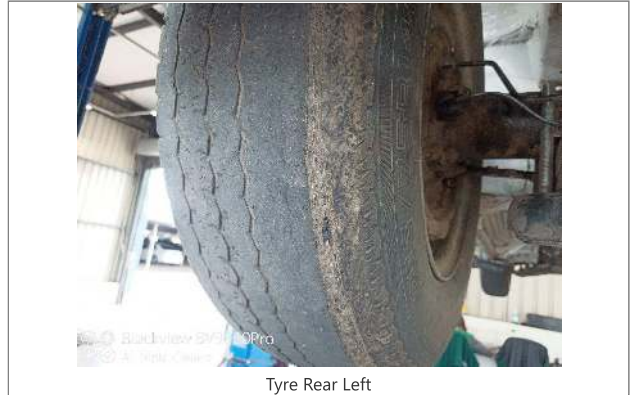

Tyre Rear Left

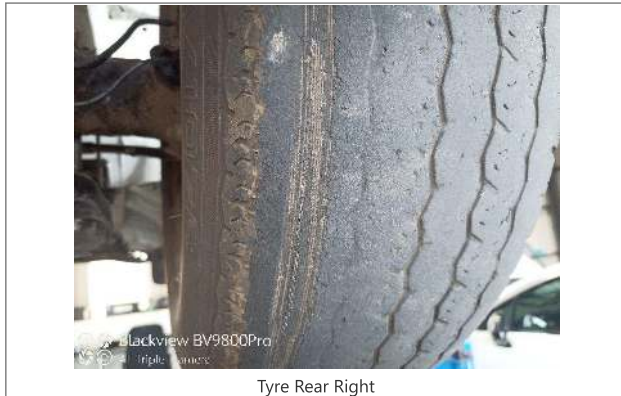

Tyre Rear Right



Silencer



Tyre Front Right



Steering box

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024



Steering Rack Boot Left

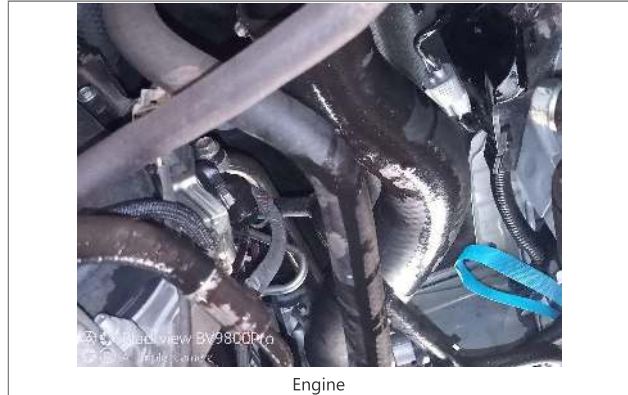

Engine



Caliper 1. Axle left



Hooter

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217559

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za