



## CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



### Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/11/2025		M57 Pretoria Road - 1619
Inspection Date	24/11/2025		Kempton Park -

### Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	FH70DBGP
Model	X-TRAIL 2.0 XE [2014-2018]	Register Number	
VIN	JN1TAAT32Z0002442	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	SILVER	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT UNI
Km Reading	197,879 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

### Vehicle Options & Accessories

#### Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025

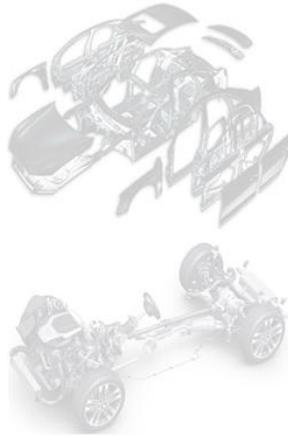

Damage	Repair Way
Engine Oil Sweat	Repair
Fan Belt Excessive Wear & Tear	Replace
Under bonnet insulation cover Damaged	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Right Damaged	Repair
Door Panel Front Left Defective	Repair
Door Panel Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Roof Dented	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Left Cracked	Replace
Ball Joint(s) Front Axle Right Cracked	Replace
Tyre Rear Right Worn	Replace
Rim Rear Left Scratched	Repair
Rim Spare Wheel Dented	Repair
Belly plates Damaged	Repair
Jack Missing	Replace
Triangle Missing	Replace
Warning light illuminated on dashboard	Repair

**Brakes**

**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
<b>Front</b>	3.82	3.64	-	
<b>Rear</b>	2.1	2.15	-	
<b>Emergency / Parking</b>	1.64	1.93	-	

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



## CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/65 R17	102H	Goodyear	Assurance	V	2718	1 mm
Front Right	225/65 R17	102H	Goodyear	Assurance	V	2718	1 mm
Rear Left	225/65 R17	102H	Goodyear	Assurance	V	2718	1 mm
Rear Right	225/65 R17	102H	Goodyear	Assurance	V	2718	0 mm
Spare	225/65 R17	102H	Yokohama	Geolander	V	0916	5 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0301	CYCLE 1 MISFIRE	
2	ENGINE	P0075	INTAKE VALVE TIM VALVE CIRCUIT-B1	

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Dents and scratches on some body panels. Stone chips and spray work on some body panels. Poor residual traces of repair on some body panels.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442





CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT3Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No: 2017080996  
DATE 24/11/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025




Door Panel Front Right



Seat Front Right



Door Panel Front Left

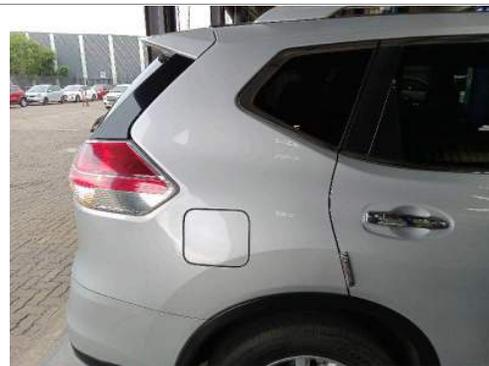

Rear Fender Right



Rear Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



Door Front Right



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



Roof



Rim Spare Wheel



Rear Fender Left



Door Rear Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



Front Fender Left



Front Fender Left



Bonnet



Bonnet



Headlight Left



Headlight Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



Under bonnet insulation cover



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



Rim Rear Left



Ball Joint(s) Front Axle Left



Ball Joint(s) Front Axle Right



Tie Rod End left



Tie Rod End right



Fan Belt

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442



CONDITION REPORT



Report No:  
2017080996  
DATE  
24/11/2025



Engine



Tyre Rear Right



Belly plates



Water level



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JN1TAAT32Z0002442