



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/09/2026		M57 Pretoria Road - 1619
Inspection Date	04/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	KTM713NW
Model	STARLET 1.4 XS 5-DR AT [2020-2023]	Register Number	
VIN	JTDGWC52S00666771	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	M - METALLIC
Km Reading	101,793 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026

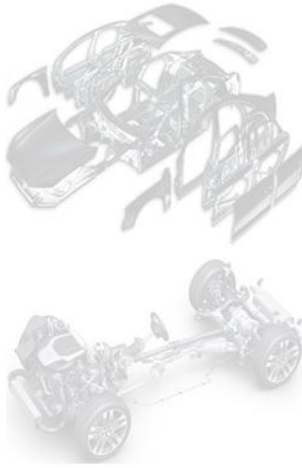

Damage	Repair Way
Engine Oil Sweat	Repair
Tail Light Left Damaged	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Door Sealing Rubber Rear Left Excessive Wear & Tear	Replace
Parcel Tray Missing	Replace
Carpet Front Excessive Wear & Tear	Repair
Carpet Rear Torn / Cut	Repair
Side Mirror Left Damaged	Replace
Front Bumper Residual Traces of Repair	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Right Dented	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Main Beam Left Damaged	Replace
Body exterior	Signs of spray work done on body panels
Body exterior	Residual traces of poor repair on body panels
Body exterior	Minor dents scratches stone chips on body panels
Hail damaged on some body panels	Repair
Sparewheel well residual traces of poor repair wor	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.8	3.1	-	
Rear	1.4	1.1	-	
Emergency / Parking	1.1	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55R16	87H	Velocity	Rota	V	2724	2 mm
Front Right	195/55R16	87V	Powertrac	Adamas	V	3525	4 mm
Rear Left	195/55R16	87V	Powertrac	Adamas	V	3520	3 mm
Rear Right	195/55R16	87H	Velocity	Rota	V	2724	3 mm
Spare	T135/70R15	99M	Jk tyre	Temporary	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1057	POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026



LICENSE DISC



VIN PLATE OR STICKER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026



90 DEGREE REAR



90 DEGREE RIGHT



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026



Sparewheel




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

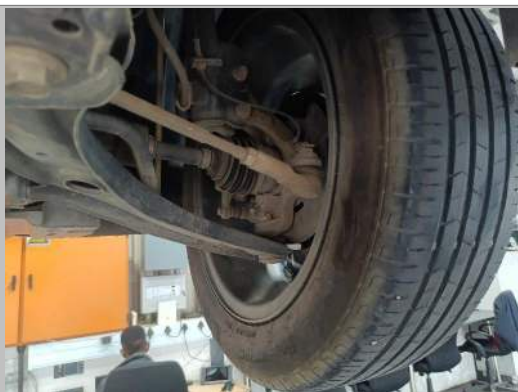

RF TYRE TREAD



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:
2017294366
DATE
04/09/2026



Coolant reservoir



Oil cap and dipstick




REAR



ENGINE 2



CHASSIS

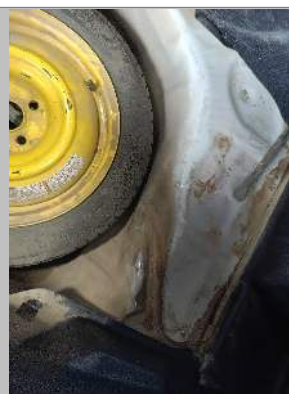

Sparewheel well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT




Report No:


2017294366

DATE


04/09/2026

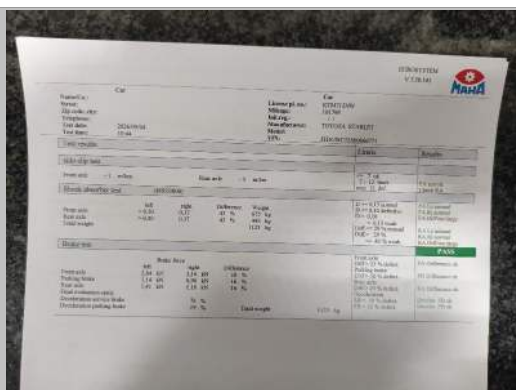

Shock and brake report

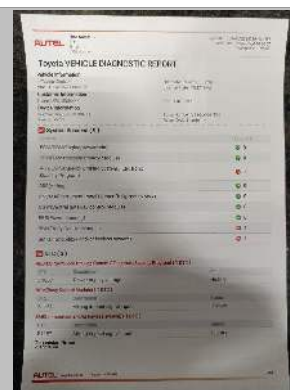

Diagnostics report

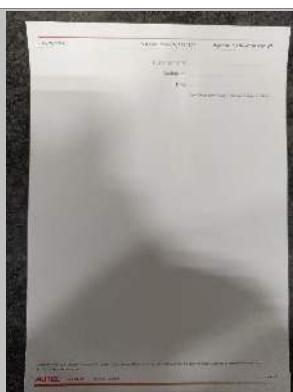

Diagnostics report



Sparewheel well



Sparewheel well



Sparewheel well signs of weldi

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT




Report No:
2017294366
DATE
04/09/2026



Side Mirror Left




Seat Front Left

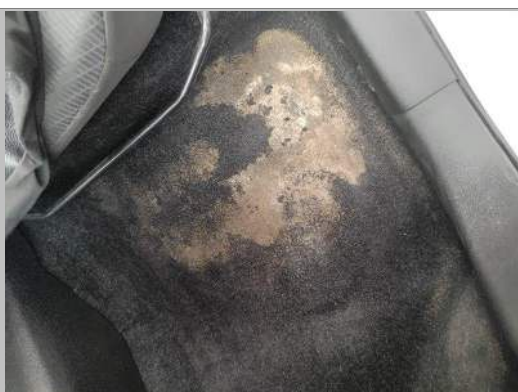

Carpet Front



Carpet Rear

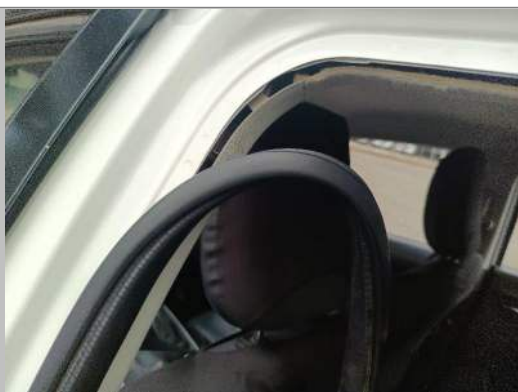

Door Sealing Rubber Rear Left



Door Sealing Rubber Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:

2017294366

DATE

04/09/2026



Seat Front Right



Front Fender Right



Roof



Door Front Right



Boot Lid / Hatch door



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT




Report No:

2017294366

DATE

04/09/2026

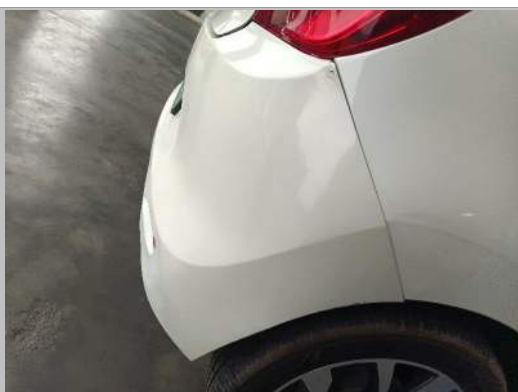


Rear bumper



Rear bumper



Rear bumper

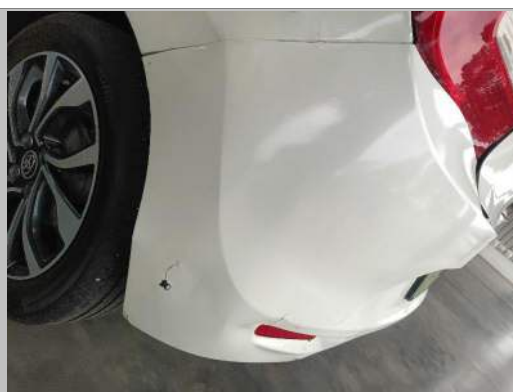

Rear bumper



Rear bumper



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:

2017294366

DATE

04/09/2026



Tail Light Left



Boot Lid / Hatch door



Boot Lid / Hatch door



Boot Lid / Hatch door



Parcel Tray



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT




Report No:

2017294366

DATE

04/09/2026

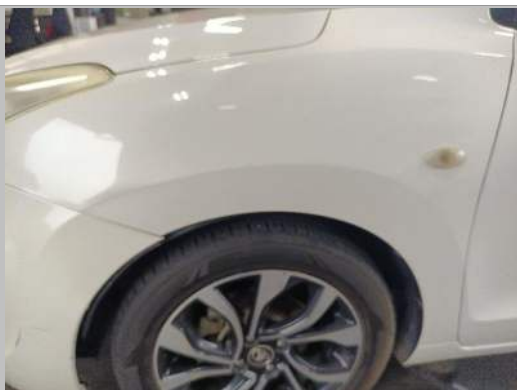

Front Fender Left



Windscreen



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771



CONDITION REPORT



Report No:

2017294366

DATE

04/09/2026



Rear Fender Left / Inner Tray



Rear Fender Left / Inner Tray



Engine



Main Beam Left



Main Beam Left



Rear Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771

**CONDITION REPORT**

Report No:
2017294366
DATE
04/09/2026



Rear Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDGWC52S00666771