



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/04/2026		M57 Pretoria Road - 1619
Inspection Date	01/04/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	KXN801NW
Model	H-100 BAKKIE 2.6 DECK DSL PU [2015-2020]	Register Number	
VIN	KMFZBX7BLGU284159	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT UNI
Km Reading	113,012 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026

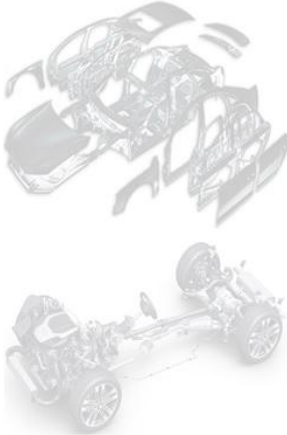	Damage	Repair Way
	Engine Oil Leak	Repair
	Heater control Damaged	Replace
	Tail Light Right Damaged	Repair
	Door Handle Front Right Damaged	Replace
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	A • Pillar Right Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Load Body Damaged	Repair
	Gearbox Oil Leak	Repair
	Engine Performance Insufficient	Repair
	Engine Noise Excessive	Repair
	Engine Smoke Excessive	Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.89	4.45	-	
Rear	2.08	2.1	-	
Emergency / Parking	0.22	3.05	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/70R15	102S	Goodyear	Efficient	V	4120	2 mm
Front Right	195/70R15	102S	Dunlop	Sp	V	2622	2 mm
Rear Left	195/70R15	102R	Double King	Radial	V	3223	3 mm
Rear Right	195/70R15	102S	Goodyear	Efficient	V	4120	3 mm

* Tyre Legend: V=Virgin, R=Rechap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159

**CONDITION REPORT**

Report No:
2017207207
DATE
01/04/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Electrical Components and Instruments: vehicle struggles to start.
Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
SIGNS OF WATER LEAK CANNOT
T PINPOINT. GEARBOX INCORRECT FITTED. STARTER IS INCORRECTLY. GEARBOX IS SPICED AWAY FROM ENGINE.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026

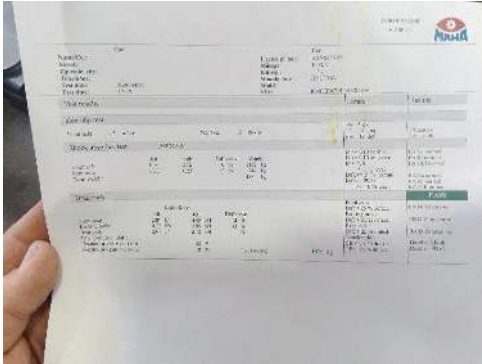

Brake test



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026



ODOMETER



MANUAL



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026



ENGINE 1



ADDITIONAL 3



ADDITIONAL 4



ADDITIONAL 10



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026



Door Front Left



Load Body



Load Body



Tail Light Right



Bonnet



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159



CONDITION REPORT



Report No:
2017207207
DATE
01/04/2026



Door Front Right



Heater control



Door Handle Front Right



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLGU284159