



CONDITION REPORT



Report No:
2017299105
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	LB31BCGP
Model	H-100 BAKKIE 2.6 EURO II DECK AC DSL PU [2020-ON]	Register Number	
		Date Of First Licensing	
VIN	KMFZBX7BLPU019090	Last COR	
Engine Number		License Expiry Date	31/07/2025
Doors	2	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2023	Fuel	DIESEL
Km Reading	200,317 KM	Transmission	MANUAL
Cab / Body Type	SINGLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:
2017299105
DATE
15/09/2026

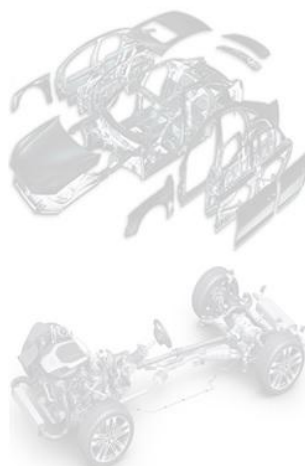

Damage	Repair Way
Engine Oil Leak	Repair
Windscreen Wiper Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Tailgate Damaged	Replace
Rear bumper Damaged	Repair
Load Body Damaged	Repair
Windscreen Damaged	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Right Worn	Replace
Main frame Welded	Replace
Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.37	3.19	-	
Rear	1.95	1.73	-	
Emergency / Parking	1.42	0.44	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/70R15	104S	Continental	Worldcontac	V	4623	1 mm
Front Right	195/70R15	102R	Durun	Radial	V	2423	0 mm
Rear Left	205/70R15	104S	Bridgestone	Radial	V	4521	1 mm
Rear Right	205/70R15	104S	Bridgestone	Radial	V	2925	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090

**CONDITION REPORT**

Report No:
2017299105
DATE
15/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:
2017299105
DATE
15/09/2026

[illegible]

Brake test.



Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:
2017299105
DATE
15/09/2026



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:

2017299105

DATE

15/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT




Report No:
2017299105
DATE
15/09/2026



ENGINE 1



Undercarriage front.

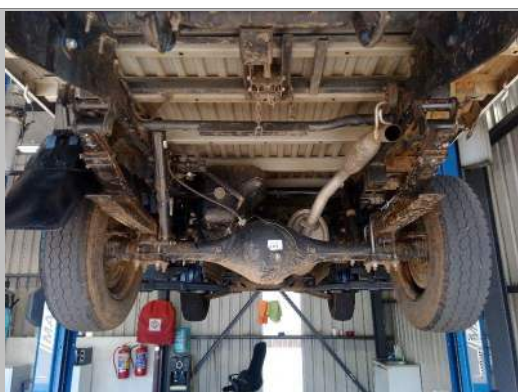

Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:

2017299105

DATE

15/09/2026



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Load Body



Load Body

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:
2017299105
DATE
15/09/2026



Tailgate



Rear bumper



Door Front Right



Windscreen



Seat Front Right



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090



CONDITION REPORT



Report No:

2017299105

DATE

15/09/2026



Windscreen Wiper



Tyre Front Right




Engine



Engine



Main frame

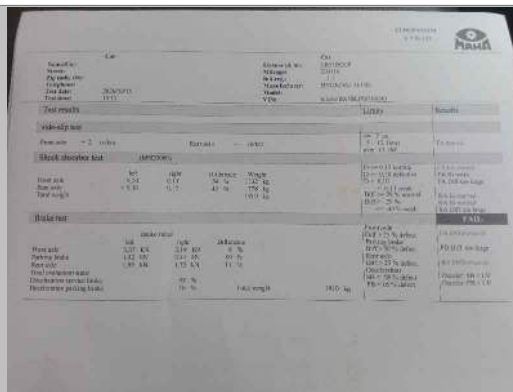

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLPU019090