



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MAHINDRA	Registration Number	FYB806L
Model	XUV 300 1.2 W4 SE [2022-2024]	Register Number	
VIN	MA1NN2RM1N2H56475	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	M - METALLIC
Km Reading	94,140 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:

2017296847

DATE

10/09/2026

Damage

Repair Way

Radio/CD/USB Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Body exterior	Vehicle got minor scratches, stone chips and dent
No license disc	Replace
L/F tire deferred name brand and size	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	3.7	-	
Rear	2.2	1.7	-	
Emergency / Parking	1.4	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	109/107T	Kumho	Protran	V	2617	3 mm
Front Right	205/65R16	95H	Bridgestone	Dueler	V	3022	3 mm
Rear Left	205/65R16	95H	Bridgestone	Dueler	V	3022	3 mm
Rear Right	205/65R16	95H	Bridgestone	Dueler	V	3022	2 mm
Spare	205/65R16	107/105T	Hilo	Brawn xc1	V	0122	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CURRENT	P2AF200	ACCESSORY CUT OFF RELAY OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026

Shock and brake report form with fields for vehicle details, suspension, and brake components. The form includes a table for suspension components and a table for brake components.

Shock and brake report

Diagnostic report form with fields for vehicle details, engine, transmission, and other components. The form includes a table for engine components and a table for transmission components.

Diagnostic report

Diagnostic report form with fields for vehicle details, engine, transmission, and other components. The form includes a table for engine components and a table for transmission components.

Diagnostic report



Spare wheel



Expenditure bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MA1NN2RM1N2H56475




CONDITION REPORT




Report No:
2017296847
DATE
10/09/2026

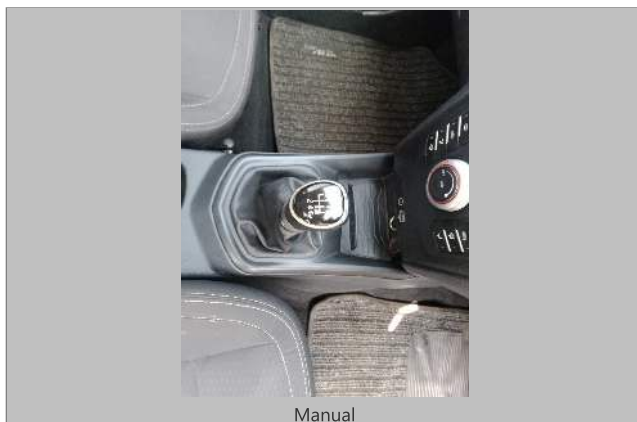

Manual

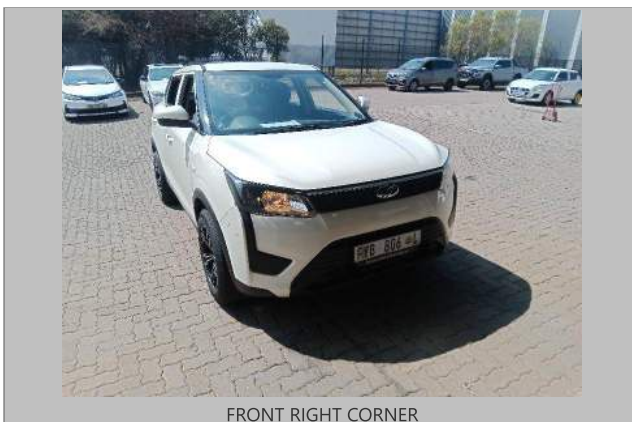

FRONT RIGHT CORNER

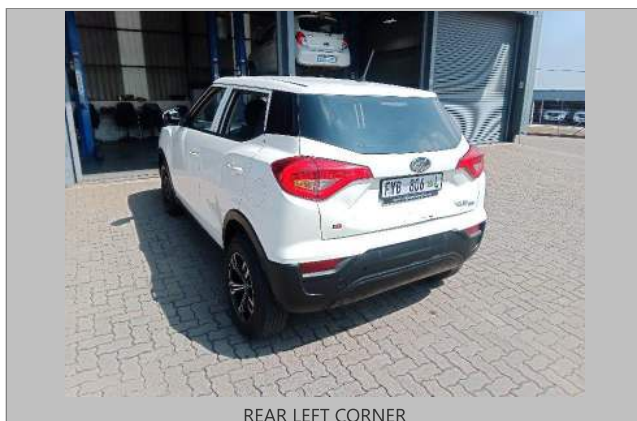

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026



CHASSIS



Water level



Boot Lid / Hatch door



Rear bumper



Rear bumper



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT




Report No:
2017296847
DATE
10/09/2026

Station no:	Station pt. no.:	Car
Street:	Station pt. no.:	TYRONE
Zip code, city:	Station pt. no.:	9414
Telephone:	Station pt. no.:	MA1NN2RM1N2H56475
Test date:	Station pt. no.:	MA1NN2RM1N2H56475
Test time:	Station pt. no.:	MA1NN2RM1N2H56475
Test results:	Station pt. no.:	MA1NN2RM1N2H56475
side-slip test	Station pt. no.:	MA1NN2RM1N2H56475
Front axle	Station pt. no.:	MA1NN2RM1N2H56475
Shock absorber test:	Station pt. no.:	MA1NN2RM1N2H56475
Front axle	Station pt. no.:	MA1NN2RM1N2H56475
Rear axle	Station pt. no.:	MA1NN2RM1N2H56475
Total weight	Station pt. no.:	MA1NN2RM1N2H56475
Brake test	Station pt. no.:	MA1NN2RM1N2H56475
Front axle	Station pt. no.:	MA1NN2RM1N2H56475
Parking brake	Station pt. no.:	MA1NN2RM1N2H56475
Rear axle	Station pt. no.:	MA1NN2RM1N2H56475
Final evaluation state	Station pt. no.:	MA1NN2RM1N2H56475
Deceleration service brake	Station pt. no.:	MA1NN2RM1N2H56475
Deceleration parking brake	Station pt. no.:	MA1NN2RM1N2H56475
Total weight	Station pt. no.:	MA1NN2RM1N2H56475


Parking Brake Performance




Radio/CD/USB

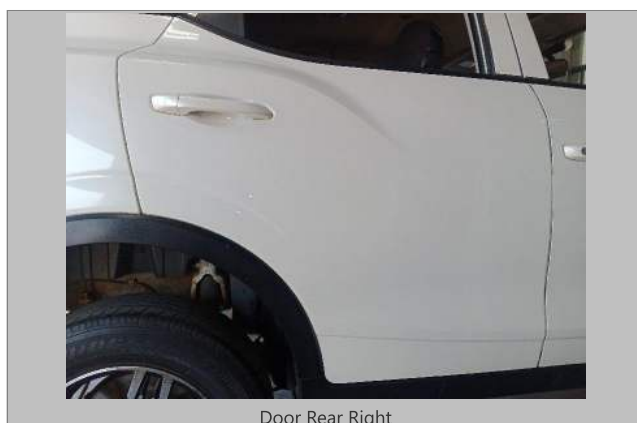


Door Rear Right

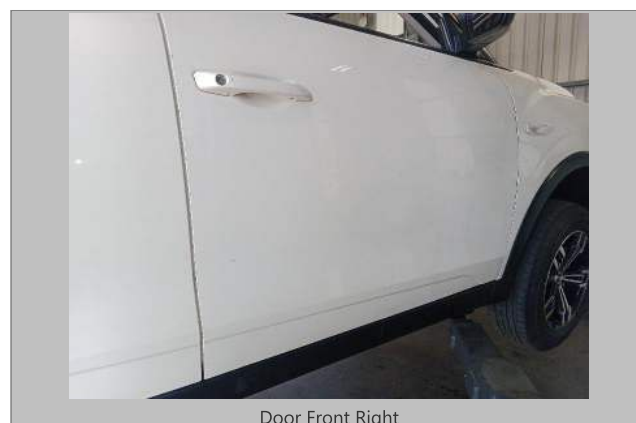

Door Front Right

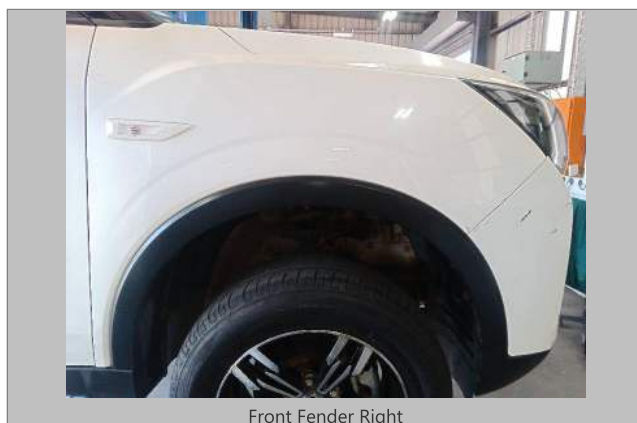

Front Fender Right

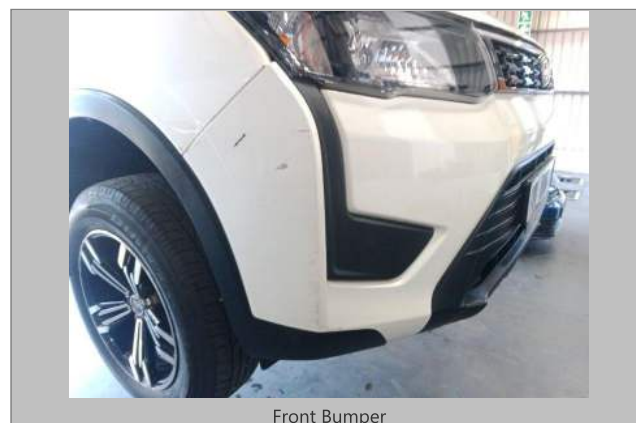

Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026



Front Bumper



Front Fender Left



Door Front Left



Side Mirror Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MA1NN2RM1N2H56475



CONDITION REPORT



Report No:
2017296847
DATE
10/09/2026

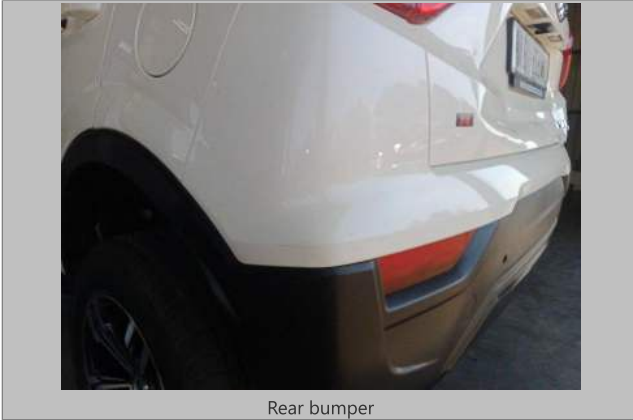

Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1NN2RM1N2H56475