



CONDITION REPORT



Report No:
2017296180
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	FR64DXGP
Model	ECOSPORT 1.0 ECOBOOST TITANIUM [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	MAJAXXMRKAGY70087	Last COR	
Engine Number		License Expiry Date	31/01/2027
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2017	Fuel	PETROL
Km Reading	132,421 KM	Transmission	MANUAL
Cab / Body Type	SUV		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:

2017296180


DATE

09/09/2026

Damage

Repair Way

Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Left Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Fuel Flap Damaged	Repair
Windscreen Chipped	Repair
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Shock Absorber Front Right Worn	Replace

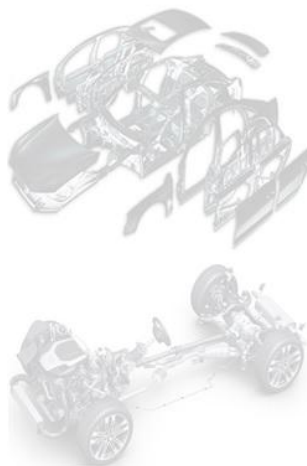

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.49	2.46	-	
Rear	2.28	2.26	-	
Emergency / Parking	1.64	1.75	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	96H	Goodyear	Efficient	V	4620	2 mm
Front Right	205/60R16	96H	Goodyear	Efficient	V	0421	1 mm
Rear Left	205/60R16	92H	Goodyear	Efficient	V	2916	3 mm
Rear Right	205/60R16	92W	Goodyear	Efficient	V	2823	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:
2017296180
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM	P0562:1C-28	SYSTEM VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 10 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:

2017296180

DATE _____

09/09/2026

[illegible]

Brake test.

[illegible]

Diagnostic.

Device	Time	Log-on ID	IP	Room ID
0100	2006/06/08	Control Module Input Power A Circuit / Open		CM0TC0
APM(Accessory protocol interface module) (2 DTG)				
0100	2006/06/08	Microphone Input		CM0TC0
0200	2006/06/08	Battery voltage		CM0TC0
BCM(Body control module) (1 DTG)				
0100	2006/06/08	Battery voltage		CM0TC0
FCIM(Fire control/display interface module) (3 DTG)				
0100	2006/06/08	Control Module Input Power A Circuit / Open		CM0TC0
VMC(Heating ventilation air conditioning) (1 DTG)				
0100	2006/06/08	Control Module Input Power A Circuit / Open		CM0TC0

Technician Notes
057226100

Customer Name: _____

Technician: _____

Date: _____

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:

2017296180

DATE

09/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:

2017296180

DATE

09/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:
2017296180
DATE
09/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:
2017296180
DATE
09/09/2026



Front Bumper



Front Bumper



Bonnet



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087



CONDITION REPORT



Report No:
2017296180
DATE
09/09/2026



Door Rear Right



Windscreen



Shock Absorber Front Right



Brake disc 1. Axle right



Brake disc 1. Axle left



Fuel Flap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJAXXMRKAGY70087