



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	JL33KYGP
Model	GRAND I10 1.0 MOTION 5-DR [2017-2021]	Register Number	
VIN	MALA851ALLM059589	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT UNI
Km Reading	150,366 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026

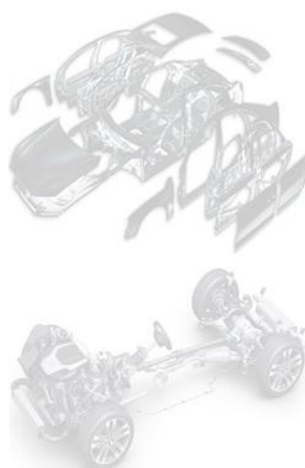

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Expansion Bottle Damaged	Replace
Fan Belt Torn / Cut	Replace
Air conditioner pipes Damaged	Replace
Air cleaner Damaged	Replace
Bonnet hinges Damaged	Replace
Radio/CD/USB Defective	Repair
Windscreen Wiper Damaged	Replace
Air Conditioner Insufficient	Replace
Fog Light Front Left Damaged	Replace
Fog Light Front Right Defective	Repair
Fog Light Rear Right Damaged	Replace
Number Plate Light Left Missing	Replace
Headlight Left Damaged	Replace
Headlight Right Scratched	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Hood Lining Damaged	Repair
Door Handle Rear Left Damaged	Repair
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Parcel Tray Damaged	Repair
Dash Padding Damaged	Repair
Carpet Rear Damaged	Repair
Boot Carpet Damaged	Repair
Boot Panel Left Damaged	Repair
Boot Panel Right Damaged	Repair
Mirror Adjusters Damaged	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Replace
Bonnet Damaged	Replace
A • Pillar Right Residual Traces of Repair	Repair
B • Pillar Right Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Damaged	Repair
Brake fluid level Insufficient	Replace
Stabilizer Mounting Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:

2017297675

DATE

11/09/2026

Damage

Repair Way

Spare Tyre Damaged	Replace
Main Beam Left Damaged	Repair
Main Beam Right Damaged	Repair
Chassis Damaged	Repair
Sub Frame Damaged	Replace
Engine to silencer pipe Damaged	Repair
Belly plates Damaged	Repair
Fuel Tank Damaged	Replace
Radiator Cradle Damaged	Replace
Triangle Missing	Replace
ABS warning light illuminated on dashboard	Repair
Engine oil sump dented	Repair
Fan Cowley damaged	Replace
Rear left and right tyres regrooved	Replace
Front left and right tyre sizes different	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.12	2.22	-	
Rear	1.71	1.73	-	
Emergency / Parking	1.08	0.89	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Sailfish	Nereus	V	1025	3 mm
Front Right	165/65R14	79H	Nexen	CP661	V	3021	0 mm
Rear Left	185/65R14	86H	Continental	ComtiEco	V	1117	0 mm
Rear Right	185/65R14	86H	Continental	ContiEco	V	4616	0 mm
Spare	175/65R14	82T	Bridgestone	B250	V	2812	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:

2017297675

DATE

11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P0562	SYSTEM VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL. Electrical Components and Instruments: Radio malfunction.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Signs of impact damage to the front of the vehicle. Vehicle safety integrity compromised.

Undercarriage: The vehicle's undercarriage was dirty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:

2017297675

DATE _____

11/09/2026

[illegible]


Brake and shock absorber report




Front chassis



Rear chassis

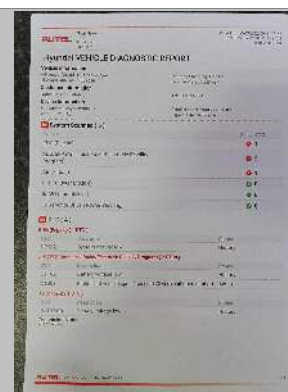

Diagnostic report page 1

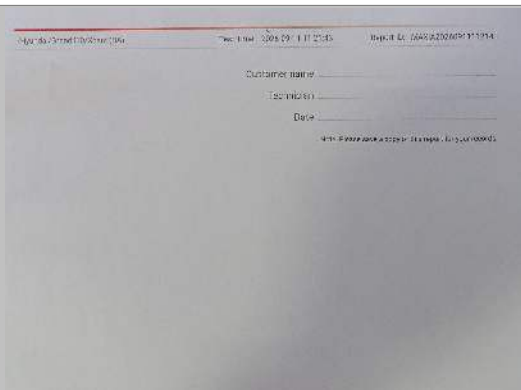

Diagnostic report page 2



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Engine oil sump



Fan Cowley



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



VIN PLATE OR STICKER



ENGINE 1



Bonnet



Headlight Left



Front Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT




Report No:
2017297675
DATE
11/09/2026



Sill Panel Left



Door Rear Left

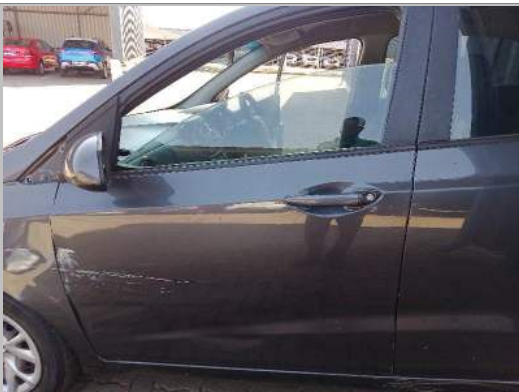

Door Front Left



Seat Front Left



Seat Front Right



Door Sealing Rubber Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Door Sealing Rubber Rear Left



Seat Rear



Carpet Rear



Boot Lid / Hatch door



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:

2017297675

DATE

11/09/2026



Rear bumper



Windscreen Wiper



Rear Fender Right



Door Rear Right



Door Sealing Rubber Rear Right



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT




Report No:
2017297675
DATE
11/09/2026



Carpet Rear



Steering Wheel Trim

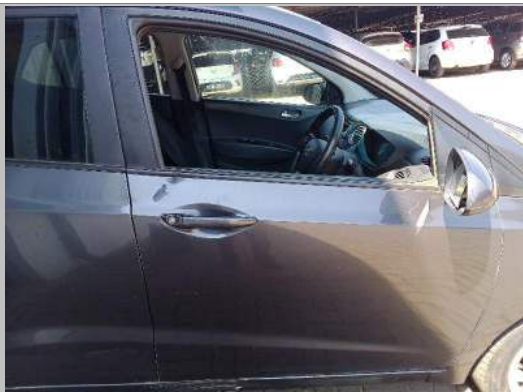

Door Front Right



Front Fender Right



Side Mirror Right



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



B • Pillar Right



A • Pillar Right



Headlight Right



Hood Lining



Hood Lining



Mirror Adjusters

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Dash Padding



Roof



Air Conditioner



Main Beam Right



Main Beam Right



Air cleaner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Bonnet hinges



Parcel Tray



Boot Carpet



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Boot Panel Left



Boot Panel Right



Sill Panel Right



Fog Light Front Right



Fog Light Front Left



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Front Bumper



Front Bumper



Main Beam Left



Number Plate Light Left



Fog Light Rear Right



Sub Frame

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Sub Frame



Tyre Front Right



Stabilizer Mounting Front Left



Engine



Engine Wiring



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Main Beam Left



Air conditioner pipes



Radiator Cradle



Main Beam Right



Fan Belt



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Chassis



Engine to silencer pipe



Fuel Tank



Chassis



Tyre Rear Right



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589



CONDITION REPORT



Report No:
2017297675
DATE
11/09/2026



Belly plates



Radiator Cradle



Expansion Bottle



Water level



Brake fluid level



Radio/CD/USB

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589

**CONDITION REPORT**

Report No:
2017297675
DATE
11/09/2026



Door Handle Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851ALLM059589