



CONDITION REPORT



Report No:
2017057124
DATE
30/10/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/10/2025		M57 Pretoria Road - 1619
Inspection Date	30/10/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	DNS372L
Model	GRAND I10 1.25 MOTION 5-DR [2014-2017]	Register Number	
VIN	MALA851CLGM468407	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2022
Color	RED	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	119,931 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:

2017057124

DATE

30/10/2025

Damage

Repair Way

Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Damaged	Repair
Rear Fender Left / Inner Tray Deformed	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Sill Panel Left Paintwork • Scratched	Repair
Alignment Left / Right Difference out of legal range	Repair
Tyre Front Left Smooth	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Radiator Cradle Damaged	Repair
Boot does not open	Repair.
Wiper valance grill damage.	Replace.
Front tyre size differs	Replace
Rear tyre size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.1	-	
Rear	1.4	1.4	-	
Emergency / Parking	1.2	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/60R14	75H	Royal black	Royal passen	V	4217	0 mm
Front Right	155/65R14	75T	Cachland	CH-265	V	3220	2 mm
Rear Left	165/65R14	79H	Hankook	Kinergy	V	0617	3 mm
Rear Right	165/70R14	81T	MRF	ZVTS	V	0521	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:
2017057124
DATE
30/10/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALA851CLGM468407




CONDITION REPORT




Report No:
2017057124
DATE
30/10/2025

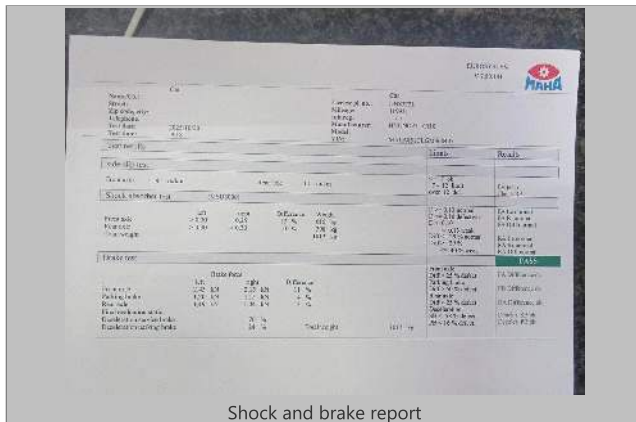

Shock and brake report

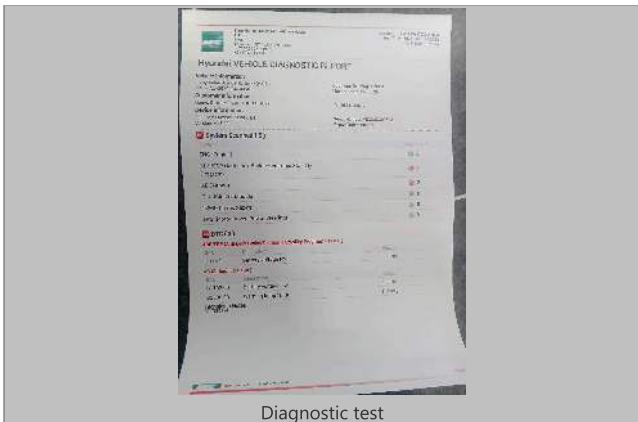

Diagnostic test

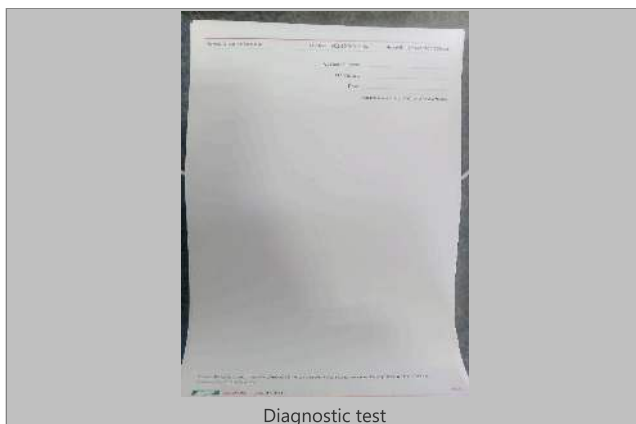

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:

2017057124

DATE


30/10/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

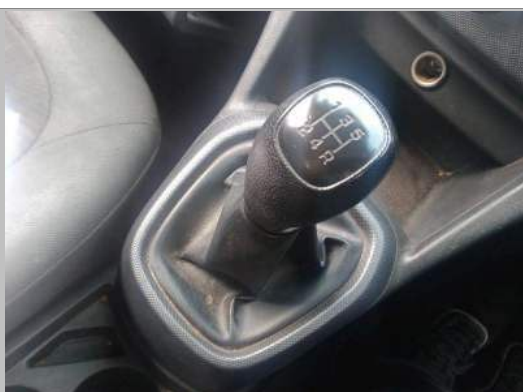

Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:

2017057124

DATE


30/10/2025



90 DEGREE LEFT



LF TYRE TREAD

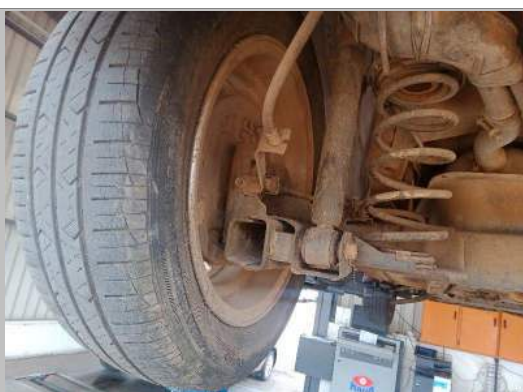

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:
2017057124
DATE
30/10/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Coolant reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:
2017057124
DATE
30/10/2025



Wiper valance grill damage



Oil cap and dipstick



Side Mirror Right



Side Mirror Right



Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT




Report No:
2017057124
DATE
30/10/2025



Door Rear Right



Boot Lid / Hatch door

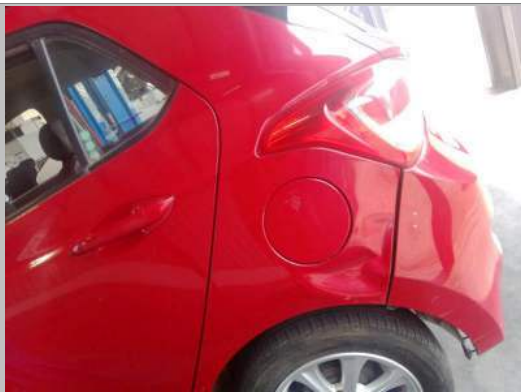

Rear Fender Left



Door Rear Left



Door Front Left



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT




Report No:
2017057124
DATE
30/10/2025



Front Fender Left




Bonnet

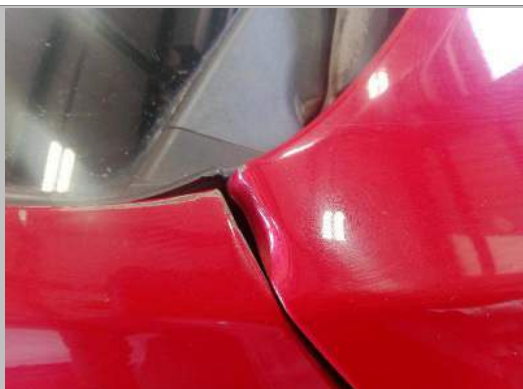

Bonnet



Front Bumper

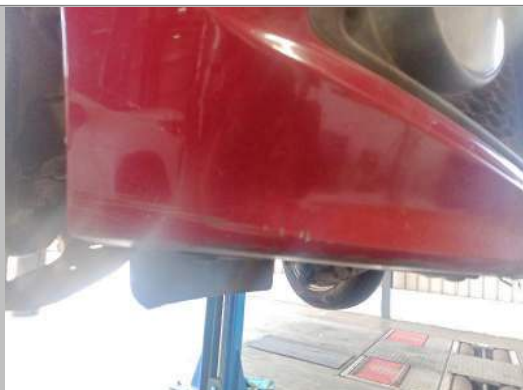

Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT




Report No:
2017057124
DATE
30/10/2025




Front Bumper



Front Bumper

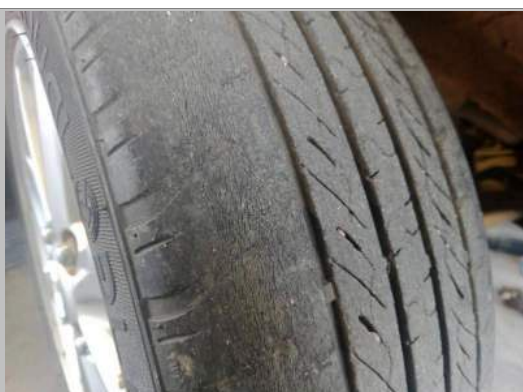

Tyre Front Left

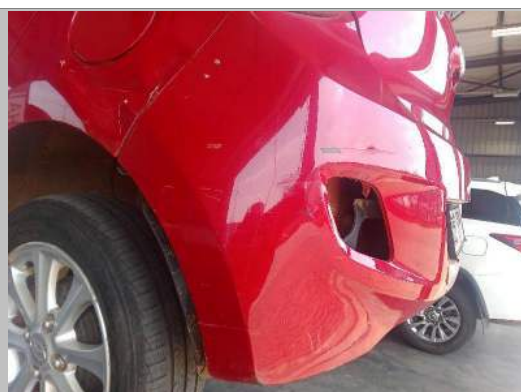

Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407




CONDITION REPORT



Report No:
2017057124
DATE
30/10/2025



Rear bumper

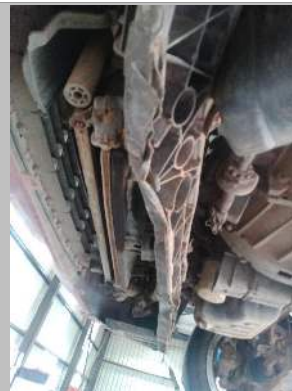

Radiator Cradle



Radiator Cradle



Radiator Cradle



Radiator Cradle



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407



CONDITION REPORT



Report No:
2017057124
DATE
30/10/2025



Sill Panel Left



Tyre Rear Left



Rear Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM468407