



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	DL43KXGP
Model	GRAND I10 1.25 FLUID 5-DR AT [2014-2017]	Register Number	
VIN	MALA851CMFM140549	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2027
Color	BLACK	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT METALLIC
Km Reading	133,418 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:

2017295873

DATE

08/09/2026

Damage

Repair Way

Front Bumper Damaged
 Bonnet Damaged
 Front Fender Left Damaged
 Front Fender Right Damaged
 Rear Fender Right Damaged
 Door Front Left Damaged
 Door Front Right Damaged
 Door Rear Left Damaged
 Door Rear Right Damaged
 Boot Lid / Hatch door Damaged
 Rear bumper Damaged
 Windscreen Damaged
 Tyre Front Right Worn
 Spare Tyre Defective
 Airbag warning light illuminated

Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Replace
 Replace
 Replace
 Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.42	1.96	-	
Rear	1.66	1.65	-	
Emergency / Parking	1.23	1.27	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/65R14	79H	Westlake	Radial	V	2123	3 mm
Front Right	165/65R14	79H	Nexen	Radial	V	1614	0 mm
Rear Left	165/65R14	79H	Westlake	Radial	V	2123	3 mm
Rear Right	165/65R14	79H	Westlake	Radial	V	2123	3 mm
Spare	165/65R14	79H	Westlake	Radial	V	2123	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP	C1102	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 6 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Tyres and Rims: sparewheel deflated. Undercarriage: undercarriage dirty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:


Report No.
2017295873

DATE _____

08/09/2026

[illegible]

Brake test.

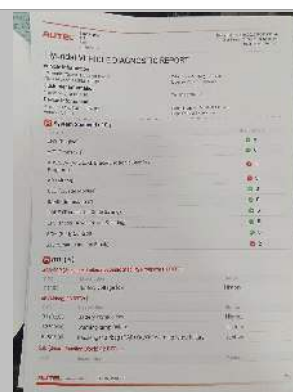

Diagnostic.

7/19/2016/Scanned 155/Kennel (RA)

Test Time: 2026-03-08 12:26:54

Report ID: 86433A382090A0173954

82519.00	Right cornering lamp circuit short to ground	History
82521.00	Right rear turn signal lamp circuit open	History

Technician Notes
291729577

Customer Name: _____

Technician: _____

Date: _____

Please, Upload some a snap of Bill report for your records

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

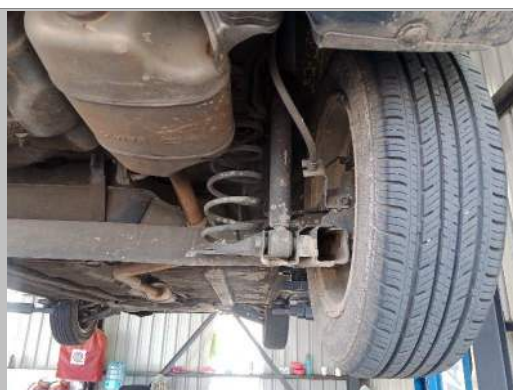

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026




VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.

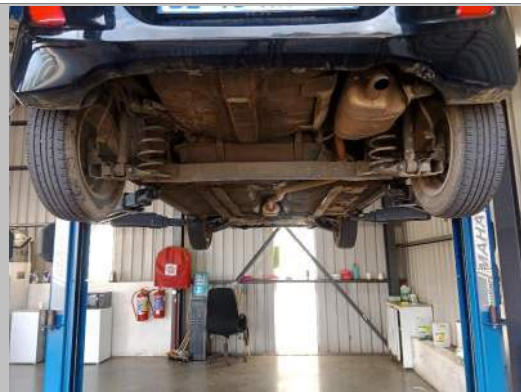

Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026




Front Bumper



Front Bumper



Bonnet

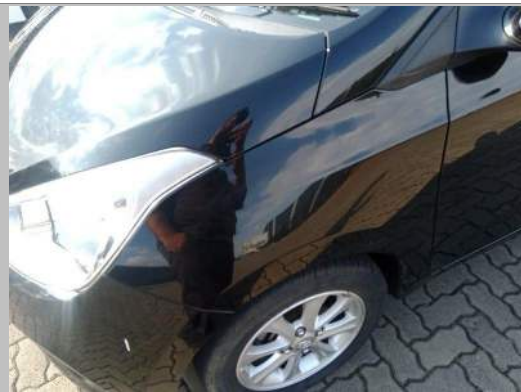

Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026



Rear bumper




Rear bumper



Boot Lid / Hatch door



Door Rear Right

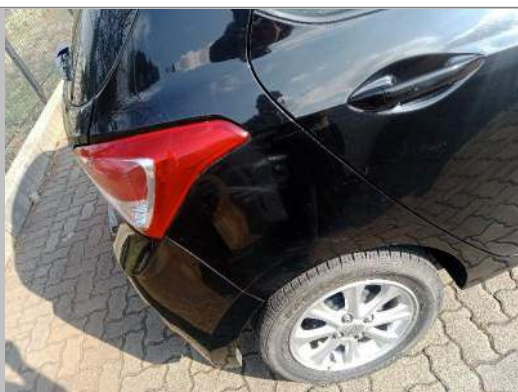

Rear Fender Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549



CONDITION REPORT



Report No:
2017295873
DATE
08/09/2026




Door Front Right



Windscreen



Spare Tyre

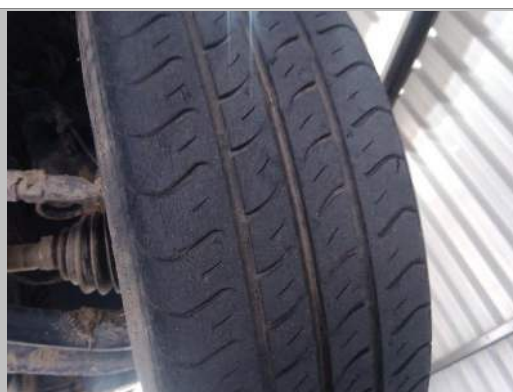

Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CMFM140549