



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	KV82LMGP
Model	GRAND I10 1.0 MOTION 5-DR [2020-2024]	Register Number	
VIN	MALB251ALPM348665	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2026
Color	SILVER	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	81,589 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:

2017299020

DATE

15/09/2026

Damage

Repair Way

Air cleaner Defective	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Alignment Left / Right Difference out of legal range	Repair
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Body exterior	Signs of spray work done on body panels



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.8	-	
Rear	1.7	1.6	-	
Emergency / Parking	0.9	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Goodyear	Assurance	V	3122	0 mm
Front Right	165/70R14	81R	Ceat	Temporary	V	0523	0 mm
Rear Left	165/70R14	81T	Goodyear	Assurance	V	2922	5 mm
Rear Right	165/70R14	81T	Goodyear	Assurance	V	3122	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostics report

1. 1990-1991 年
 2. 1991-1992 年
 3. 1992-1993 年
 4. 1993-1994 年
 5. 1994-1995 年
 6. 1995-1996 年
 7. 1996-1997 年
 8. 1997-1998 年
 9. 1998-1999 年
 10. 1999-2000 年
 11. 2000-2001 年
 12. 2001-2002 年
 13. 2002-2003 年
 14. 2003-2004 年
 15. 2004-2005 年
 16. 2005-2006 年
 17. 2006-2007 年
 18. 2007-2008 年
 19. 2008-2009 年
 20. 2009-2010 年
 21. 2010-2011 年
 22. 2011-2012 年
 23. 2012-2013 年
 24. 2013-2014 年
 25. 2014-2015 年
 26. 2015-2016 年
 27. 2016-2017 年
 28. 2017-2018 年
 29. 2018-2019 年
 30. 2019-2020 年
 31. 2020-2021 年
 32. 2021-2022 年
 33. 2022-2023 年
 34. 2023-2024 年
 35. 2024-2025 年
 36. 2025-2026 年
 37. 2026-2027 年
 38. 2027-2028 年
 39. 2028-2029 年
 40. 2029-2030 年
 41. 2030-2031 年
 42. 2031-2032 年
 43. 2032-2033 年
 44. 2033-2034 年
 45. 2034-2035 年
 46. 2035-2036 年
 47. 2036-2037 年
 48. 2037-2038 年
 49. 2038-2039 年
 50. 2039-2040 年
 51. 2040-2041 年
 52. 2041-2042 年
 53. 2042-2043 年
 54. 2043-2044 年
 55. 2044-2045 年
 56. 2045-2046 年
 57. 2046-2047 年
 58. 2047-2048 年
 59. 2048-2049 年
 60. 2049-2050 年
 61. 2050-2051 年
 62. 2051-2052 年
 63. 2052-2053 年
 64. 2053-2054 年
 65. 2054-2055 年
 66. 2055-2056 年
 67. 2056-2057 年
 68. 2057-2058 年
 69. 2058-2059 年
 70. 2059-2060 年
 71. 2060-2061 年
 72. 2061-2062 年
 73. 2062-2063 年
 74. 2063-2064 年
 75. 2064-2065 年
 76. 2065-2066 年
 77. 2066-2067 年
 78. 2067-2068 年
 79. 2068-2069 年
 80. 2069-2070 年
 81. 2070-2071 年
 82. 2071-2072 年
 83. 2072-2073 年
 84. 2073-2074 年
 85. 2074-2075 年
 86. 2075-2076 年
 87. 2076-2077 年
 88. 2077-2078 年
 89. 2078-2079 年
 90. 2079-2080 年
 91. 2080-2081 年
 92. 2081-2082 年
 93. 2082-2083 年
 94. 2083-2084 年
 95. 2084-2085 年
 96. 2085-2086 年
 97. 2086-2087 年
 98. 2087-2088 年
 99. 2088-2089 年
 100. 2089-2090 年
 101. 2090-2091 年
 102. 2091-2092 年
 103. 2092-2093 年
 104. 2093-2094 年
 105. 2094-2095 年
 106. 2095-2096 年
 107. 2096-2097 年
 108. 2097-2098 年
 109. 2098-2099 年
 110. 2099-2100 年
 111. 2100-2101 年
 112. 2101-2102 年
 113. 2102-2103 年
 114. 2103-2104 年
 115. 2104-2105 年
 116. 2105-2106 年
 117. 2106-2107 年
 118. 2107-2108 年
 119. 2108-2109 年
 120. 2109-2110 年
 121. 2110-2111 年
 122. 2111-2112 年
 123. 2112-2113 年
 124. 2113-2114 年
 125. 2114-2115 年
 126. 2115-2116 年
 127. 2116-2117 年
 128. 2117-2118 年
 129. 2118-2119 年
 130. 2119-2120 年
 131. 2120-2121 年
 132. 2121-2122 年
 133. 2122-2123 年
 134. 2123-2124 年
 135. 2124-2125 年
 136. 2125-2126 年
 137. 2126-2127 年
 138. 2127-2128 年
 139. 2128-2129 年
 140. 2129-2130 年
 141. 2130-2131 年
 142. 2131-2132 年
 143. 2132-2133 年
 144. 2133-2134 年
 145. 2134-2135 年
 146. 2135-2136 年
 147. 2136-2137 年
 148. 2137-2138 年
 149. 2138-2139 年
 150. 2139-2140 年
 151. 2140-2141 年
 152. 2141-2142 年
 153. 2142-2143 年
 154. 2143-2144 年
 155. 2144-2145 年
 156. 2145-2146 年
 157. 2146-2147 年
 158. 2147-2148 年
 159. 2148-2149 年
 160. 2149-2150 年
 161. 2150-2151 年
 162. 2151-2152 年
 163. 2152-2153 年
 164. 2153-2154 年
 165. 2154-2155 年
 166. 2155-2156 年
 167. 2156-2157 年
 168. 2157-2158 年
 169. 2158-2159 年
 170. 2159-2160 年
 171. 2160-2161 年
 172. 2161-2162 年
 173. 2162-2163 年
 174. 2163-2164 年
 175. 2164-2165 年
 176. 2165-2166 年
 177. 2166-2167 年
 178. 2167-2168 年
 179. 2168-2169 年
 180. 2169-2170 年
 181. 2170-2171 年
 182. 2171-2172 年
 183. 2172-2173 年
 184. 2173-2174 年
 185. 2174-2175 年
 186. 2175-2176 年
 187. 2176-2177 年
 188. 2177-2178 年
 189. 2178-2179 年
 190. 2179-2180 年
 191. 2180-2181 年
 192. 2181-2182 年
 193. 2182-2183 年
 194. 2183-2184 年
 195. 2184-2185 年
 196. 2185-2186 年
 197. 2186-2187 年
 198. 2187-2188 年
 199. 2188-2189 年
 200. 2189-2190 年

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER




Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

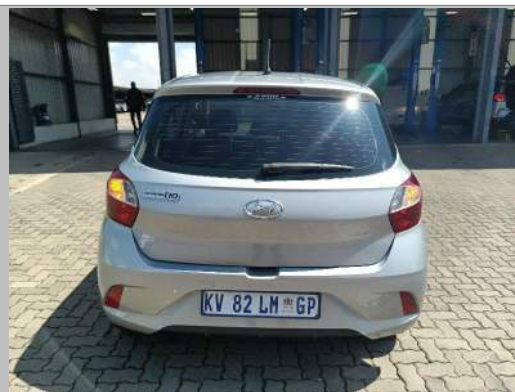

90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665




CONDITION REPORT




Report No:
2017299020
DATE
15/09/2026



90 DEGREE LEFT

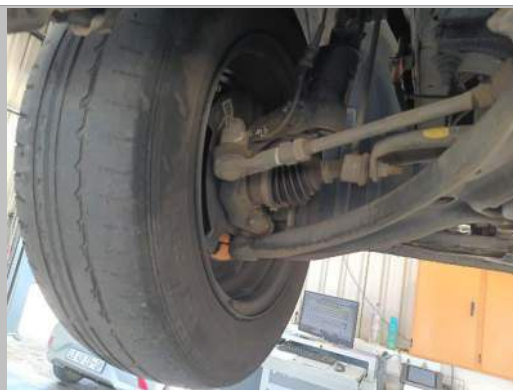

LF TYRE TREAD

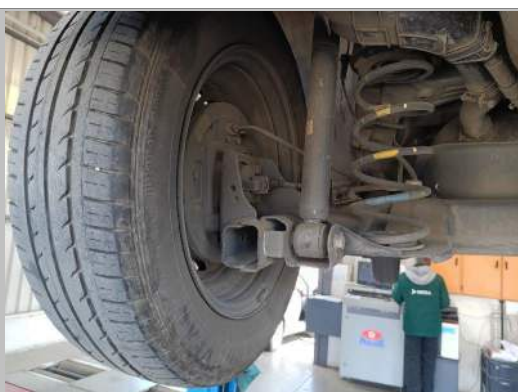

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:

2017299020

DATE

15/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026



Coolant reservoir



ADDITIONAL 10



Door Front Right



Door Rear Right



Rear Fender Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026



Door Front Left



Windscreen



Windscreen



Air cleaner



Tyre Front Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665



CONDITION REPORT



Report No:
2017299020
DATE
15/09/2026



Front Bumper



Tyre Front Left



Rear bumper



Bonnet



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM348665