



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	LF36LWGP
Model	GRAND I10 1.0 FLUID 5-DR [2020-2024]	Register Number	
VIN	MALB251ALPM414954	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	54,922 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026

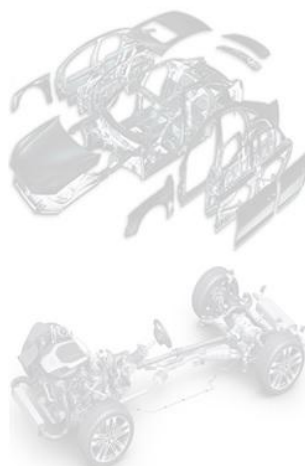

Damage	Repair Way
Engine Oil Leak	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Air Conditioner Insufficient	Replace
Fog Light Front Right Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Replace
Seat Belt Front Left Damaged	Replace
Seat Belt Rear Left Damaged	Replace
Sun Visor Left Damaged	Replace
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Parcel Tray Damaged	Repair
Dash Padding Damaged	Replace
Boot Carpet Damaged	Repair
Boot Panel Left Defective	Repair
Boot Panel Right Defective	Repair
Steering Wheel Trim Damaged	Repair
Front Bumper Damaged	Replace
Grill Damaged	Repair
Bonnet Residual Traces of Repair	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
B • Pillar Left Damaged	Repair
C • Pillar Left Damaged	Repair
Rear Fender Left Residual Traces of Repair	Repair
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Residual Traces of Repair	Repair
Door Front Right Dented	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Doorstopper Front Left Damaged	Replace
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Residual Traces of Repair	Repair
Roof Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Main Beam Right Damaged	Repair
Chassis Damaged	Repair
Belly plates Damaged	Replace
Gearbox Oil Sweat	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace
Clutch Operation Insufficient	Repair
Signs of vehicle Airbags deployed	Replace
Deceleration service and parking brakes defective	Repair
Front bumper stiffener damaged	Replace
Aircon condenser damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.97	1.5	-	
Rear	1.16	0.5	-	
Emergency / Parking	1.13	0.17	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Goodyear	Assurance	V	5222	0 mm
Front Right	165/70R14	81T	Goodyear	Assurance	V	5222	0 mm
Rear Left	165/70R14	81T	Goodyear	Assurance	V	5222	1 mm
Rear Right	165/70R14	81T	Goodyear	Assurance	V	5222	1 mm
Spare	165/70R14	81T	Goodyear	Assurance	V	5222	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Engine Compartment: Non-standard battery fitted to the vehicle. Rust inside the expansion bottle.
Interior: The vehicle interior is dirty, and the panels are scratched.
Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.
Undercarriage: The vehicle's undercarriage is dirty.
Road Test: Gear selection faulty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:

2017296692

DATE

09/09/2026

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026

[illegible]


Brake and shock absorber report




Front chassis



Rear chassis

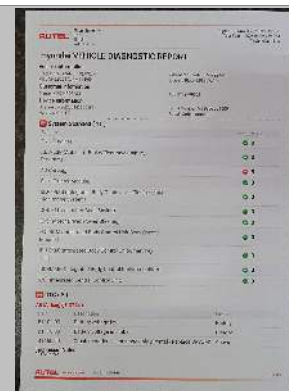

Diagnostic report page 1

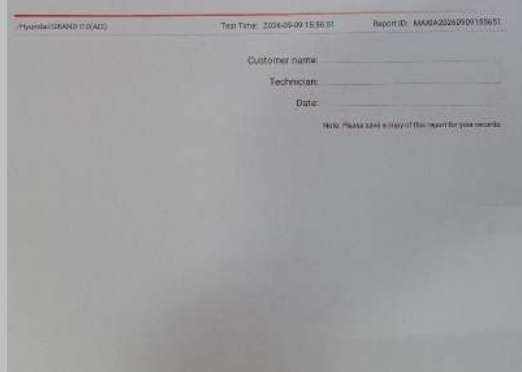

Diagnostic report page 2



Front bumper stiffener

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Aircon condenser



Spare Wheel and Accessories



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT




Report No:
2017296692
DATE
09/09/2026



90 DEGREE LEFT



LF TYRE TREAD

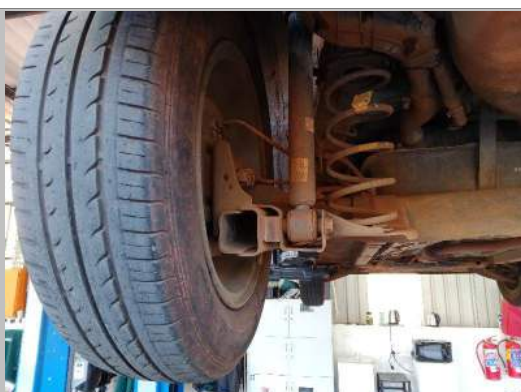

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT




Report No:

2017296692

DATE


09/09/2026

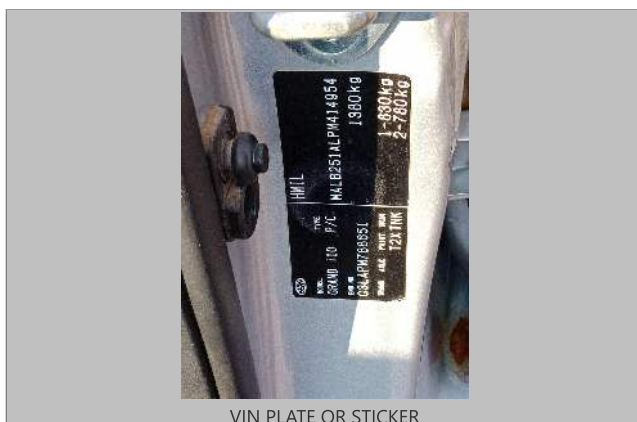

VIN PLATE OR STICKER



ENGINE 1

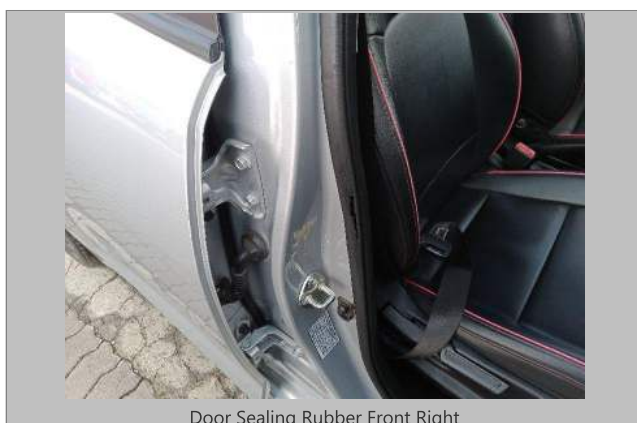

Door Sealing Rubber Front Right



Steering Wheel Trim



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:

2017296692

DATE

09/09/2026



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door



Roof



Roof



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Door Rear Right



Door Rear Right



Fog Light Front Right



Grill



Bonnet



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Door Front Left



Door Rear Left



Rear Fender Left



Door Front Left



Doorstopper Front Left



Seat Belt Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



B • Pillar Left



Door Rear Left



C • Pillar Left



Seat Belt Rear Left



Dash Padding



Sun Visor Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Center Console / Cubbyhole + Lid



Air Conditioner



Seat Front Right



Boot Carpet



Inner Boot Floor Pan and Spare Wheel Well



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT




Report No:
2017296692
DATE
09/09/2026



Boot Panel Left



Boot Panel Right

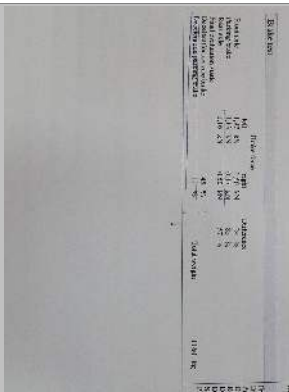

Parking Brake Performance



Headlight Right



Headlight Right



Main Beam Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Front Fender Right / Inner Tray



Front Bumper



Front Bumper



CV Joint(s) Boot(s) Front Left (inner/outer)



Sill Panel Left



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Tyre Front Right



Belly plates



Radiator Cradle



Radiator Cradle



Radiator Cradle



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Tyre Front Left



Engine



Chassis



Chassis



Gearbox



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954



CONDITION REPORT



Report No:
2017296692
DATE
09/09/2026



Bonnet slam plate (Shock tower/ Inner tray)



Water level



Hood Lining

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM414954