



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	JL77TZGP
Model	SWIFT 1.2i GL 5-DR AT [2018-2021]	Register Number	
VIN	MBHCZC63S00498646	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2027
Color	GREY	Power / Displacement	
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	122,804 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026

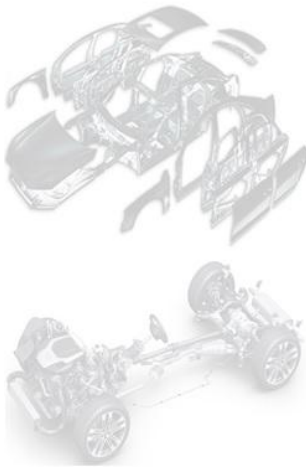

Damage	Repair Way
Headlight Right Cracked	
Front Bumper Paintwork • Scratched	
Front Fender Left Dented	
Front Fender Right Dented	
Rear Fender Left Dented	
Door Front Left Paintwork • Scratched	
Door Rear Left Dented	
Door Rear Right Paintwork • Scratched	
Rear bumper Paintwork • Scratched	
Sill Panel Left Dented	
Windscreen Cracked	
Rim Front Left Deformed	
Rim Rear Left Deformed	

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.6	-	
Rear	1.5	1.6	-	
Emergency / Parking	1.2	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R14	86H	Continental	Contact	V	4823	5 mm
Front Right	185/65R14	86H	Continental	Contact	V	2223	4 mm
Rear Left	185/65R14	96H	Velocity	Rota	V	4923	2 mm
Rear Right	185/65R14	86H	Dunlop	Sport	V	4323	3 mm
Spare	T135/70R15	99M	Jk tyre	Temporary	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1057	POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SIGNS OF SPRAY WORK DONE ON BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:

2017295703

DATE

08/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Coolant reservoir



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBHCZC63S00498646




CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026

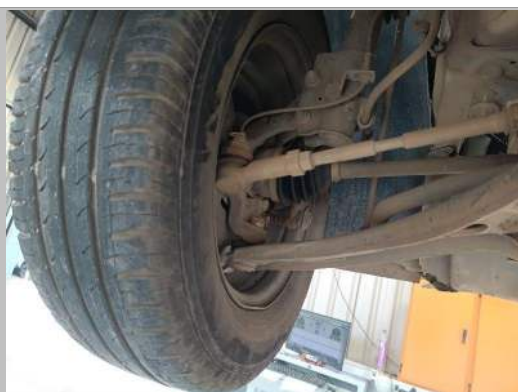

LF TYRE TREAD

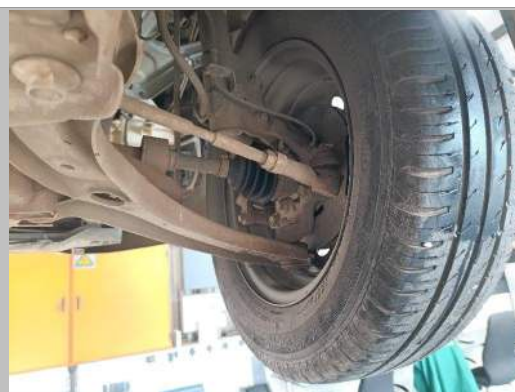

RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



Sparewheel

Car				Car			
Model/Car:	Seat	License pl. no.:	417720P	Model/Car:	Seat	License pl. no.:	417720P
Reg. date:	2016/09/06	Reg. date:	2016/09/06	Reg. date:	2016/09/06	Reg. date:	2016/09/06
Test date:	11/17	Test date:	11/17	Test date:	11/17	Test date:	11/17
Test results				Test results			
Side-slip test				Side-slip test			
Front axle:	-4 m/s	Front axle:	-4 m/s	Front axle:	-4 m/s	Front axle:	-4 m/s
Shock absorber test (NPN/PRD)				Shock absorber test (NPN/PRD)			
Left side:	0.00	Right side:	0.00	Left side:	0.00	Right side:	0.00
Front axle:	> 0.50	Front axle:	> 0.50	Front axle:	> 0.50	Front axle:	> 0.50
Front axle:	> 0.50	Front axle:	> 0.50	Front axle:	> 0.50	Front axle:	> 0.50
Total weight:	1.50 t	Total weight:	1.50 t	Total weight:	1.50 t	Total weight:	1.50 t
Brake test				Brake test			
Front axle:	2.74 s	Front axle:	2.74 s	Front axle:	2.74 s	Front axle:	2.74 s
Parking brake:	2.20 s	Parking brake:	2.20 s	Parking brake:	2.20 s	Parking brake:	2.20 s
Brake axle:	1.54 s	Brake axle:	1.54 s	Brake axle:	1.54 s	Brake axle:	1.54 s
Total evaluation score:	80 %	Total evaluation score:	80 %	Total evaluation score:	80 %	Total evaluation score:	80 %
Deceleration parking brake:	2.2 %	Deceleration parking brake:	2.2 %	Deceleration parking brake:	2.2 %	Deceleration parking brake:	2.2 %

Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBHCZC63S00498646




CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026

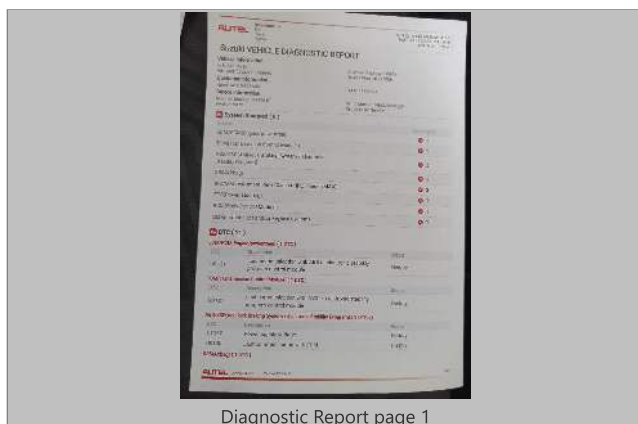


Diagnostic Report page 1

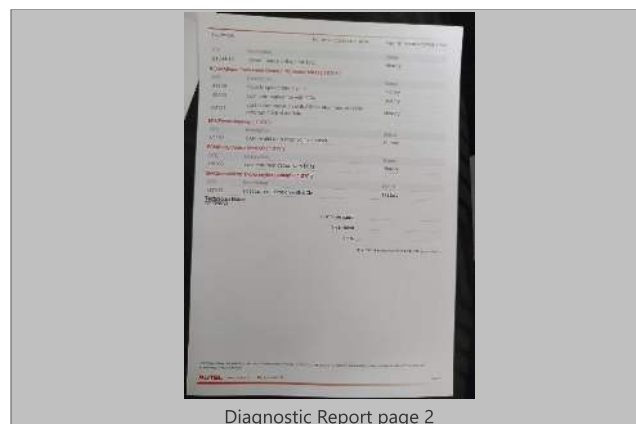

Diagnostic Report page 2




R/F fender liner missing

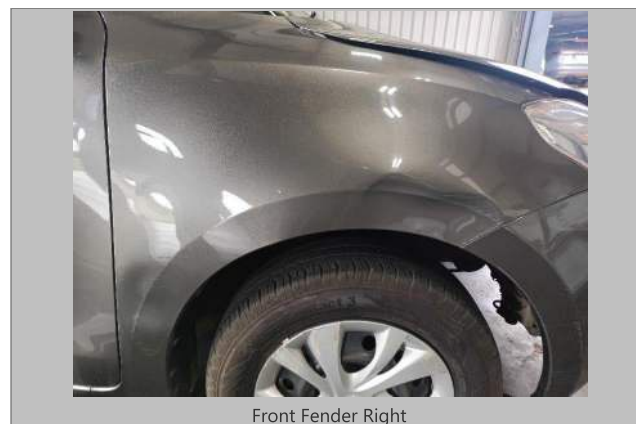

Front Fender Right



Door Rear Right

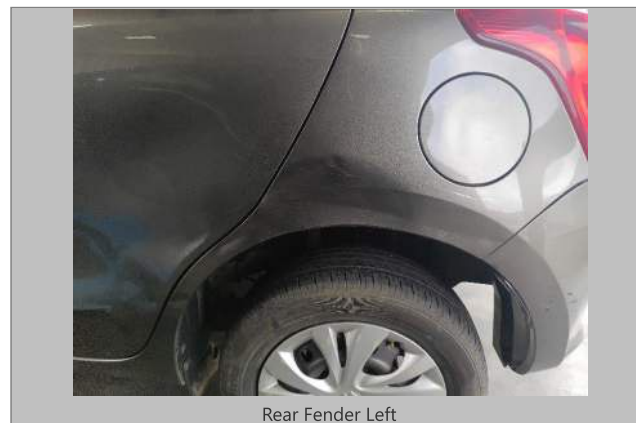

Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026



Door Rear Left



Door Front Left



Front Fender Left



Windscreen



Headlight Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026



Front Bumper



Front Bumper



Front Bumper



Sill Panel Left



Rear bumper



Rim Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646



CONDITION REPORT



Report No:
2017295703
DATE
08/09/2026



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00498646