



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	KV33WJGP
Model	ALMERA 1.5 ACENTA [2016-2023]	Register Number	
VIN	MDHBBAN17Z0737389	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	199,104 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026

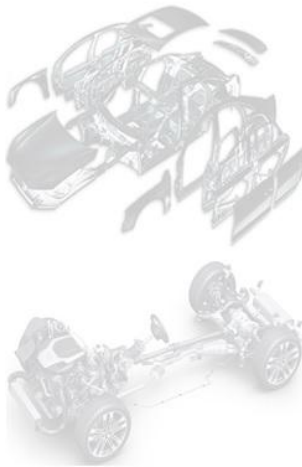

Damage	Repair Way
Front Bumper Residual Traces of Repair	Repair
Bonnet Dented	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Tyre Front Left Smooth	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Body exterior	Signs of spray work done on body panels
Body exterior	Residual traces of poor repair on body panels
Body exterior	Minor dents scratches stone chips on body panels
Starter noisy	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.7	-	
Rear	2.3	2.8	-	
Emergency / Parking	0.9	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Bridgestone	B250	V	2622	0 mm
Front Right	185/65R15	88H	Bridgestone	B250	V	2222	1 mm
Rear Left	185/65R15	88H	Bridgestone	B250	V	1122	0 mm
Rear Right	185/65R15	88H	Bridgestone	B250	V	1122	0 mm
Spare	185/65R15	88H	Bridgestone	B250	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ELECTRIC POWER STEERING (EPS)	C1606	ELECTRIC POWER STEERING (EPS) MOTOR	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:

2017297765

DATE _____

11/09/2026

[illegible]

Shock and brake report

Diagnostics report



Sparewheel



Coolant reservoir



Oil cap and dipstick



Manual transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



REAR



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026



CHASSIS



Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026



Boot Lid / Hatch door



Door Front Left



Bonnet



Control Arm Bush(es) Front Axle Right



Ball Joint(s) Front Axle Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389



CONDITION REPORT



Report No:
2017297765
DATE
11/09/2026



Front Bumper




Front Bumper



Tyre Front Left



Tyre Rear Left

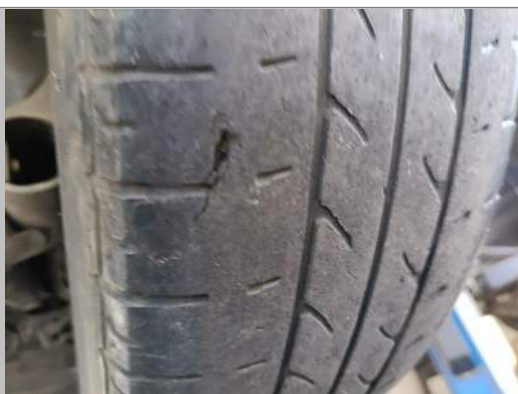

Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0737389