



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	KYZ442NW
Model	MAGNITE TURBO 1.0T ACENTA 5-DR CVT [2021-2025]	Register Number	
		Date Of First Licensing	
VIN	MDHFBADD0Z0020650	Last COR	
Engine Number		License Expiry Date	31/12/2026
Doors	5	Power / Displacement	
Color	RED	Paint Finish	TWO COAT METALLIC
Year Model	2023	Fuel	PETROL
Km Reading	30,668 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:

2017296576

DATE

09/09/2026



Damage

Repair Way

Engine Oil Leak	Repair
Engine Management Lights Set	Repair
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Rear Left Worn	Replace
Gearbox Oil Leak	Repair
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.72	2.73	-	
Rear	1.47	1.55	-	
Emergency / Parking	1.31	1.43	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89V	Ceat	Radial	V	4123	2 mm
Front Right	195/60R16	89V	Ceat	Radial	V	4223	2 mm
Rear Left	215/60R16	95V	Bridgestone	Radial	V	0219	0 mm
Rear Right	195/60R16	89V	Ceat	Radial	V	4223	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1073:1C	VACUUM SENSOR CIRCUIT 4.DEF	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 13 DTC'S AT TIME OF TESTING SEE DTC REPORT.Engine Compartment: Foreign substance on oil filler cap.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHFBADD0Z0020650




CONDITION REPORT




Report No:
2017296576
DATE
09/09/2026

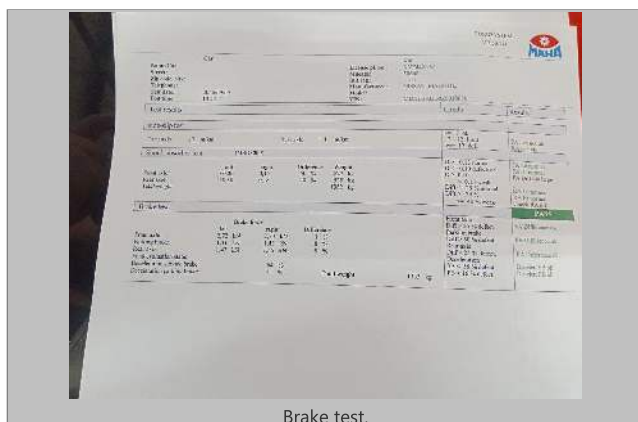

Brake test.

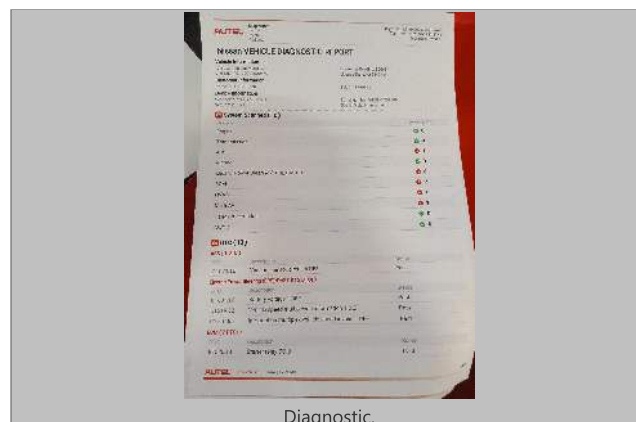


Diagnostic.

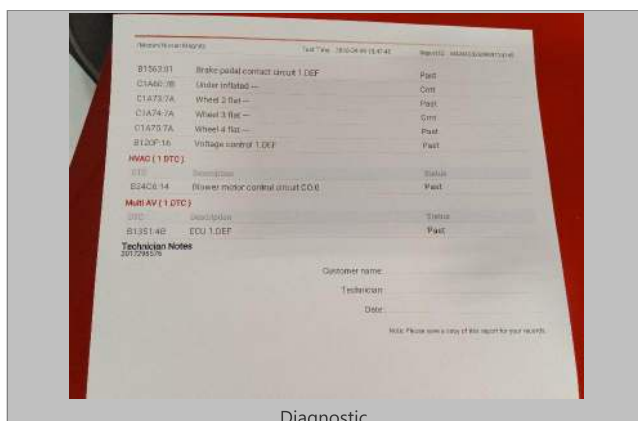

Diagnostic.



FRONT RIGHT CORNER

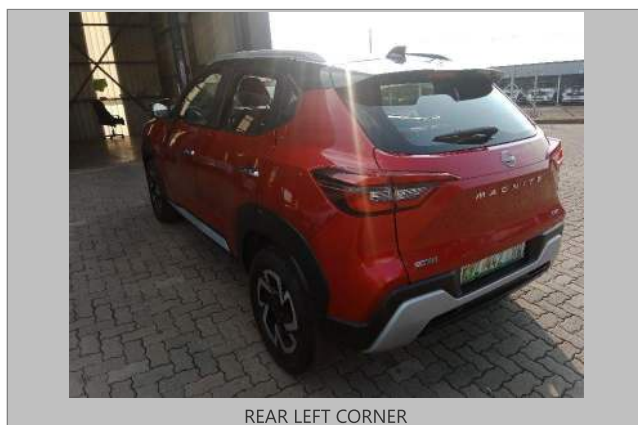

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:

2017296576

DATE

09/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026



Rear Fender Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650



CONDITION REPORT



Report No:
2017296576
DATE
09/09/2026



Rear Fender Right



Front Fender Right



Windscreen



Engine Management Lights



Tyre Rear Left



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650

**CONDITION REPORT**

Report No:
2017296576
DATE
09/09/2026



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0020650