



CONDITION REPORT



Report No:
2017296820
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	CN83LYZN
Model	KWID	Register Number	
VIN	MEEBBA00200642342	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2026
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	95,817 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:

2017296820

DATE

10/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Tail Light Right Cracked	Replace
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
A • Pillar Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Engine to silencer pipe Welded	Replace
Gearbox Oil Leak	Repair
Rear tyre size differs	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.1	2.3	-	
Rear	0.9	0.8	-	
Emergency / Parking	0.9	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R13	82T	Anchee	AC808	V	2424	4 mm
Front Right	175/70R13	82T	Anchee	AC808	V	2424	5 mm
Rear Left	155/80R13	79T	Ceat	Milaze	V	5118	6 mm
Rear Right	175/70R13	82T	Sailfish	Nereus	V	0824	4 mm
Spare	175/70R13	82T	Sailfish	Nereus	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:
2017296820
DATE
10/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC065711	MAIN RELAY CONTROL CIRCUIT SHORT CIRCUIT TO EARTH	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:

2017296820

DATE

10/09/2026

Vehicle Information			
Client Name	Client	Vehicle Make	Model
Vehicle Type	Vehicle	Vehicle Year	Vehicle Color
Vehicle ID	Vehicle	Vehicle Mileage	Vehicle Status
Vehicle Location	Vehicle	Vehicle VIN	Vehicle License
Test Results			
Test Name	Test Result	Test Status	Test Date
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026

Shock and brake report

Vehicle Information			
Client Name	Client	Vehicle Make	Model
Vehicle Type	Vehicle	Vehicle Year	Vehicle Color
Vehicle ID	Vehicle	Vehicle Mileage	Vehicle Status
Vehicle Location	Vehicle	Vehicle VIN	Vehicle License
Test Results			
Test Name	Test Result	Test Status	Test Date
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026

Diagnostics report

Vehicle Information			
Client Name	Client	Vehicle Make	Model
Vehicle Type	Vehicle	Vehicle Year	Vehicle Color
Vehicle ID	Vehicle	Vehicle Mileage	Vehicle Status
Vehicle Location	Vehicle	Vehicle VIN	Vehicle License
Test Results			
Test Name	Test Result	Test Status	Test Date
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026
Shock and Brake Test	Pass	Pass	10/09/2026

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:

2017296820

DATE

10/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:
2017296820
DATE
10/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:

2017296820

DATE

10/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:
2017296820
DATE
10/09/2026



Dipstick



Coolant reservoir



Oil cap



Center Console / Cubbyhole + Lid



Seat Front Right



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:
2017296820
DATE
10/09/2026



A • Pillar Right




Rear Fender Right



Door Rear Right



Tail Light Right

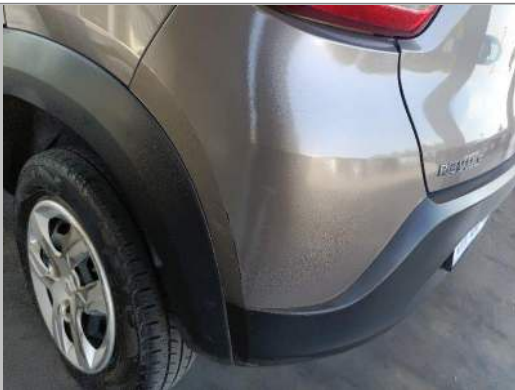

Rear Fender Left



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342



CONDITION REPORT



Report No:
2017296820
DATE
10/09/2026



Engine



Engine



Engine to silencer pipe



Engine to silencer pipe



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200642342