



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KY89VFGP
Model	KWID	Register Number	
VIN	MEEBBA00400824530	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2025
Color	GREEN	Power / Displacement	
Year Model		Paint Finish	PEARL EFFECT
Km Reading	85,903 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026

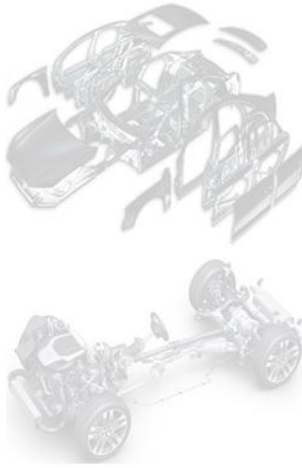

Damage	Repair Way
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Right Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Dented	Repair
Windscreen Cracked	Replace
Shock Absorber Front Right Sweat	Replace
Shock Absorber Rear Right Sweat	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Worn	Replace
Rim Rear Right Dented	Repair
Rim Spare Wheel Dented	Repair
Jack Missing	Replace
Oil sludge on oil cap	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.22	2.39	-	
Rear	1.35	1.45	-	
Emergency / Parking	0.89	0.87	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81T	Ceat	Fuelsmart	V	3122	1 mm
Front Right	165/70 R14	81R	Ceat	Temporary	V	3422	0 mm
Rear Left	165/70 R14	81T	Ceat	Fuelsmart	V	3222	2 mm
Rear Right	165/70 R14	81T	Ceat	Fuelsmart	V	3122	1 mm
Spare	165/70 R14	81T	Ceat	Fuelsmart	V	3122	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC0226F3	BRAKE/ACCELERATOR PEDAL POSITIONS FAULT ON GANGS 1 AND 2 OF THE PEDAL POTENTIOMETER.	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Dents and scratches on body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2

Report Name:	Test Time:	2006-9-28 15:06:35	Report ID:	MOCKA30285908139635
Customer name:				
Technician:				
Date:				

Note: Please save a copy of this report for your records.

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



Spare Wheel Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



Oil cap and dipstick



Seat Front Right



Front Fender Right



Door Front Right



Door Front Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026




Seat Rear



Windscreen



Front Fender Left

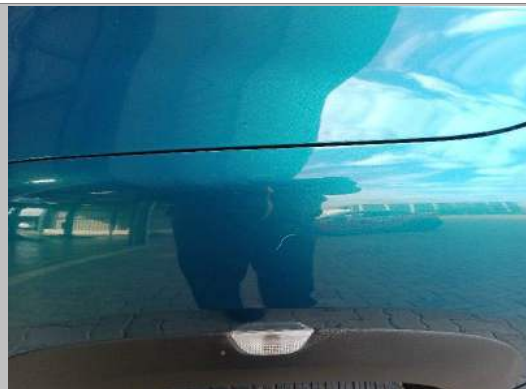

Front Fender Left



Seat Front Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



Rear bumper



Rear bumper



Rim Spare Wheel



Rim Spare Wheel



Bonnet



Shock Absorber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Sill Panel Right



Tyre Front Right



Rim Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530



CONDITION REPORT



Report No:
2017296078
DATE
08/09/2026



Shock Absorber Rear Right



Side Mirror Right



Water level



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400824530