



CONDITION REPORT



Report No:

2017298226

DATE

14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LY92XSGP
Model	KWID	Register Number	
VIN	MEEBBA00600790624	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	GREEN	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	207,255 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026

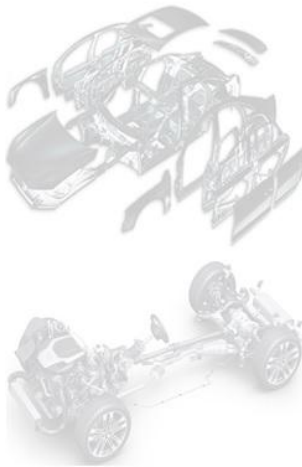

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Replace
Fan Belt Defective	Replace
Bonnet stay and shocks Damaged	Replace
Engine Management Lights Set	Repair
Indicator Light Front Left Damaged	Replace
Indicator Light Front Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Windscreen Damaged	Replace
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Main Beam Left Damaged	Replace
Engine mountings Damaged	Replace
Gearbox Mountings Damaged	Replace
Radiator Cradle Damaged	Repair
Rear and Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.77	1.8	-	
Rear	1.31	1.24	-	
Emergency / Parking	1	1.07	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:

2017298226

DATE

14/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82H	Timax	Radial	V	4425	0 mm
Front Right	165/70R14	81T	Apollo	Radial	V	3220	0 mm
Rear Left	165/70R14	81H	Windforce	Radial	V	3424	0 mm
Rear Right	175/65R14	82H	Firestone	Radial	V	1118	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ	DTC012029	THROTTLE POTENTIOMETER CIRCUIT TRACK 1	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 33 DTC'S AT TIME OF TESTING SEE DTC REPORT. Engine Compartment: Battery loose. aircon fan belt missing.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Vehicle body in poor condition. Repair work done to vehicle below standard. Signs of impact damage to front of vehicle. hatch door does not open.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT




Report No:


2017298226

DATE


14/09/2026

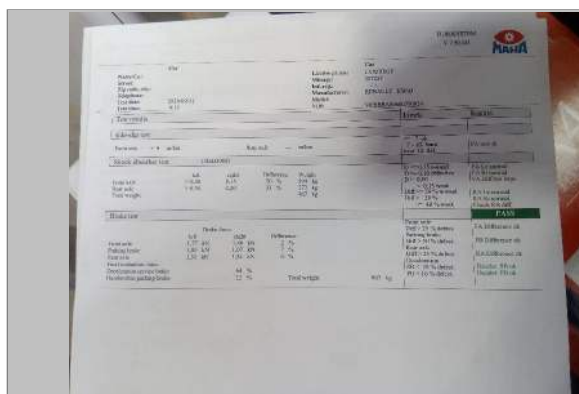


Brake test.

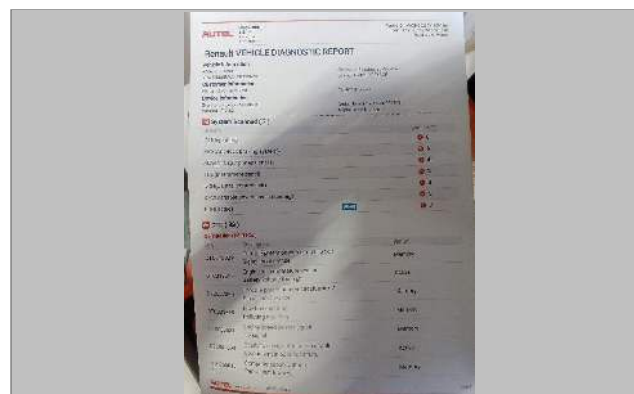

Diagnostic.

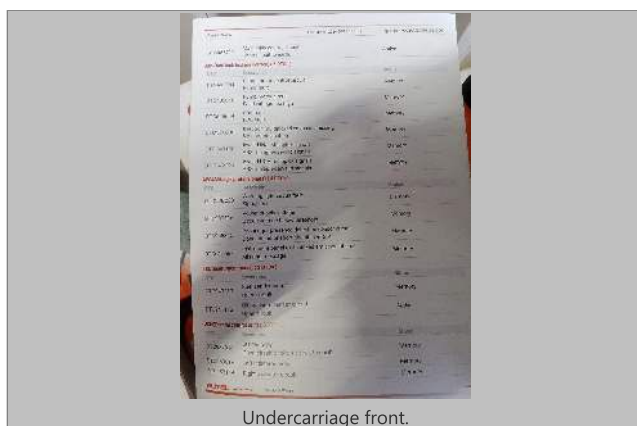

Undercarriage front.

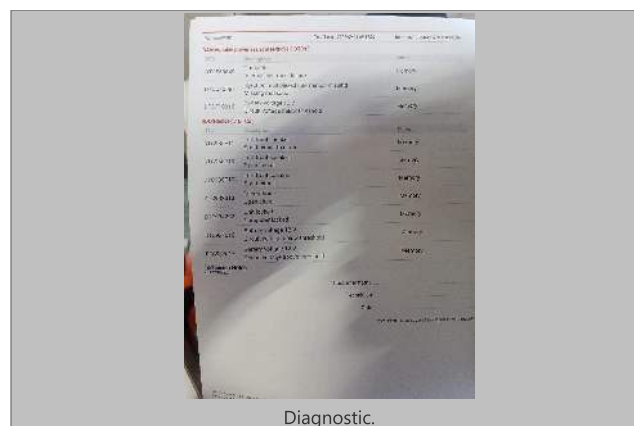

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



Oil cap and dipstick.



Water level



Engine Wiring



Engine Wiring



Headlight Left



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



Indicator Light Front Right



Indicator Light Front Left



Bonnet stay and shocks



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



Boot Lid / Hatch door



Door Front Right



Door Rear Right



Front Fender Right



Rear Fender Right



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026




Windscreen



Side Mirror Right



Side Mirror Left

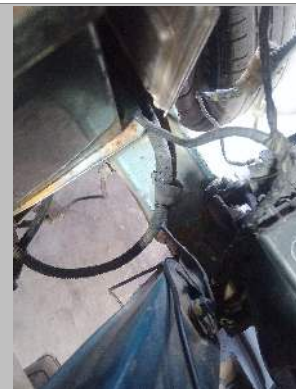

Main Beam Left



Engine mountings



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624




CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026




Tyre Rear Right

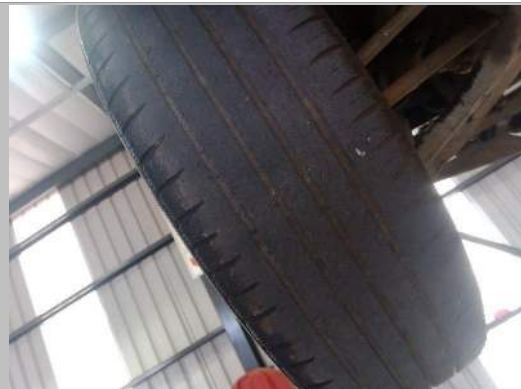

Tyre Front Left



Tyre Front Right

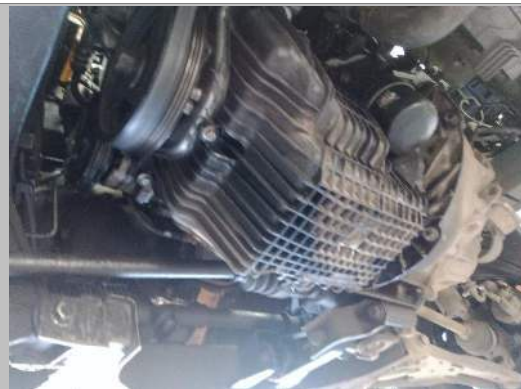

Engine



Gearbox Mountings



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624



CONDITION REPORT



Report No:
2017298226
DATE
14/09/2026



Radiator Cradle



Brake disc 1. Axle right



Brake disc 1. Axle left



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00600790624