



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	17/02/2025		M57 Pretoria Road - 1619
Inspection Date	17/02/2025		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	RENAULT	Registration Number	KSR006NW
Model	KWID	Register Number	
VIN	MEEBBA00700798490	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	GREEN	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	37,445 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Door Handle Front Left Damaged	Replace
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Front Fender Right Dented	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Body exterior	Vehicle got some scratches, stone chips and dents
Body exterior	Impact damage at left side of vehicle
R/F hub cap missing	Replace

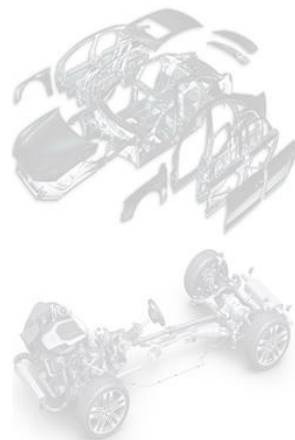

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700798490

1 / 8



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	1.9	2.1	-	
Rear	1.1	1.3	-	
Emergency / Parking	0.7	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Apollo	Amazer	V	4521	3 mm
Front Right	165/70R14	81T	Apollo	Amazer	V	4521	3 mm
Rear Left	165/70R14	81T	Ceat	Fuel smart	V	4921	4 mm
Rear Right	165/70R14	81T	Apollo	Amazer	V	4521	4 mm
Spare	165/70R14	81T	Goodyear	Efficient gr	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE	DTC934262	UNIT LOCKED COMPUTER LOCKED	

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PAR

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za




CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

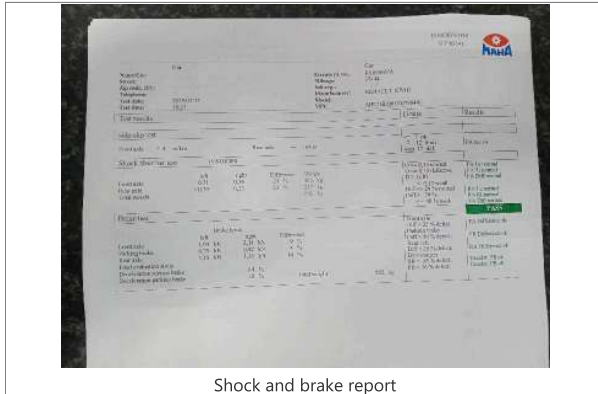


Shock and brake report

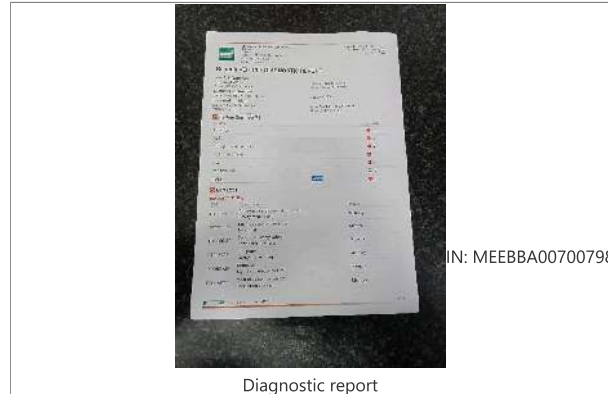


Diagnostic report


IN: MEEBBA00700798490
2 / 8

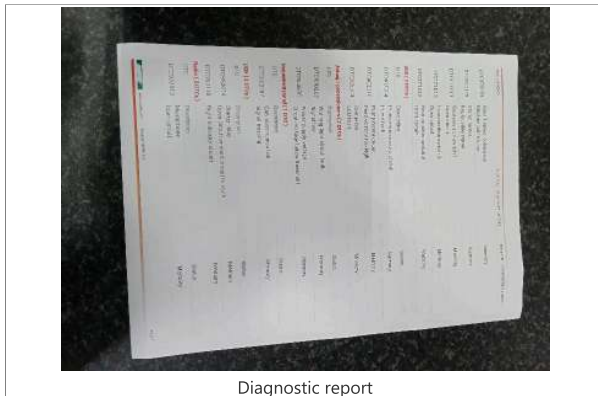

Diagnostic report

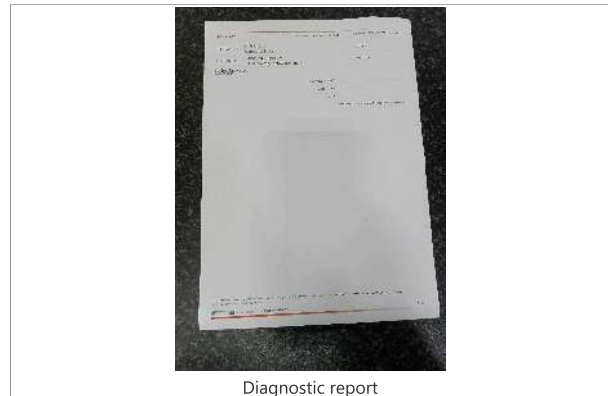

Diagnostic report

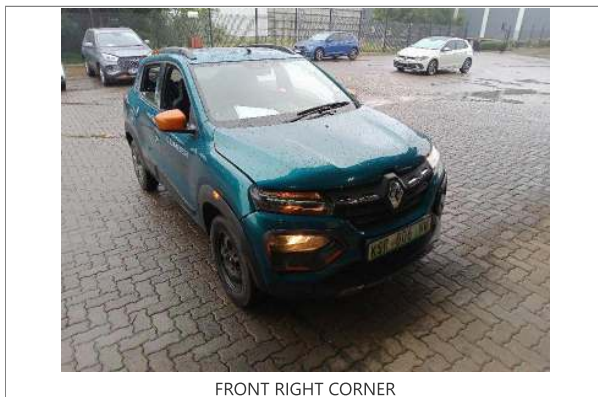

FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

VIN: MEEBBA00700798490

3 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025




INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

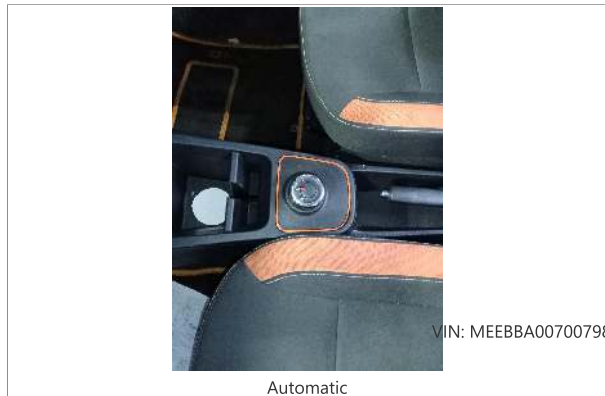

Automatic

VIN: MEEBBA00700798490
4 / 8



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

VIN: MEEBBA00700798490

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

VIN: MEEBBA00700798490

6 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00700798490



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

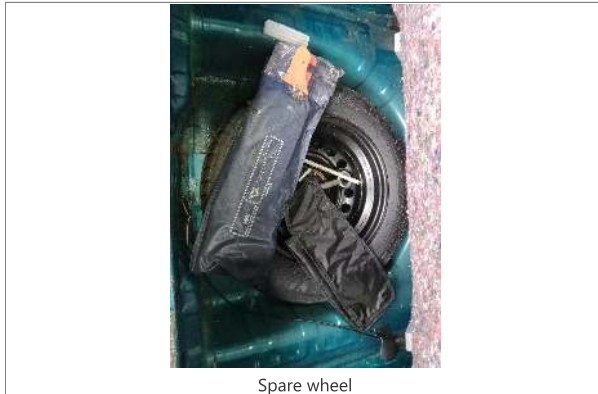

Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

VIN: MEEBBA00700798490

8 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025



Oil cap and dipstick



Coolant bottle



Water level



Door Rear Right



Front Fender Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016765700

DATE
17/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za