



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LF98CTGP
Model	KWID	Register Number	
VIN	MEEBBA00700841323	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	100,342 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:

2017298990

DATE

15/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Tail Light Left Chipped	Replace
Wiring connections Defective	Repair
Headlight Left Damaged	Repair
Door Handle Front Left Damaged	Replace
Door Handle Front Right Missing	Replace
Front Bumper Residual Traces of Repair	Repair
Grill Damaged	Replace
Bonnet Damaged	Repair
Front Fender Left Residual Traces of Repair	Repair
Door Front Left Dented	Repair
Boot Lid / Hatch door Dented	Repair
Fuel Flap Damaged	Repair
Load Body Cracked	Replace
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Left Damaged	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Tyre Rear Left Smooth	Replace
Rear and Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.2	-	
Rear	0.9	0.8	-	
Emergency / Parking	0.9	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Ceat	Fuelsmart	V	0000	0 mm
Front Right	175/65R14	82H	Rovelo	RHP	V	3324	1 mm
Rear Left	165/70R14	81T	Ceat	fuelsmart	V	0823	0 mm
Rear Right	165/80R14	85T	Apollo	Amazer	V	2519	3 mm
Spare	165/70R14	81T	Ceat	Temporary	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC021798	ENGINE OVERTHINKING OPERATION TEMPERATURE TOO HIGH	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT




Report No:


2017298990

DATE


15/09/2026

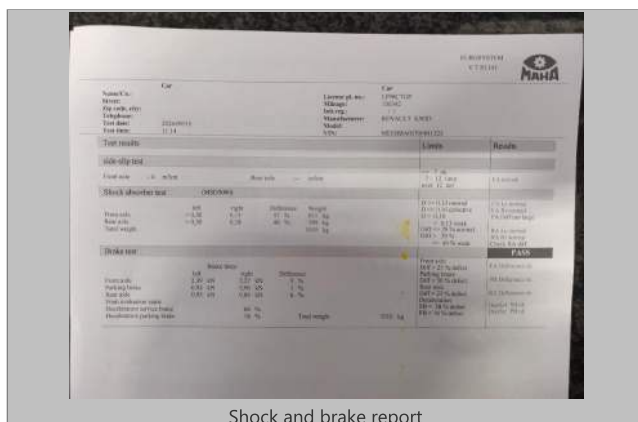


Shock and brake report

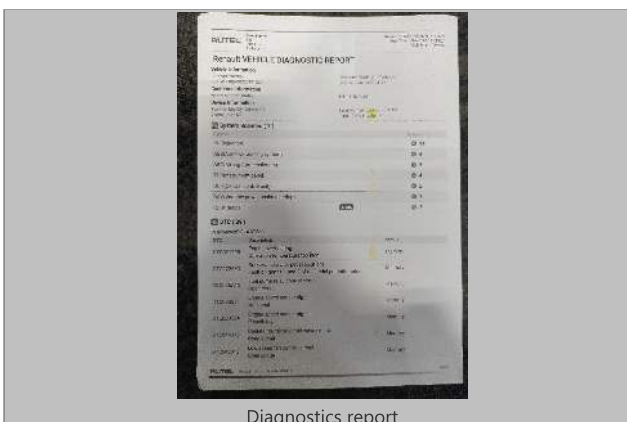


Diagnostics report

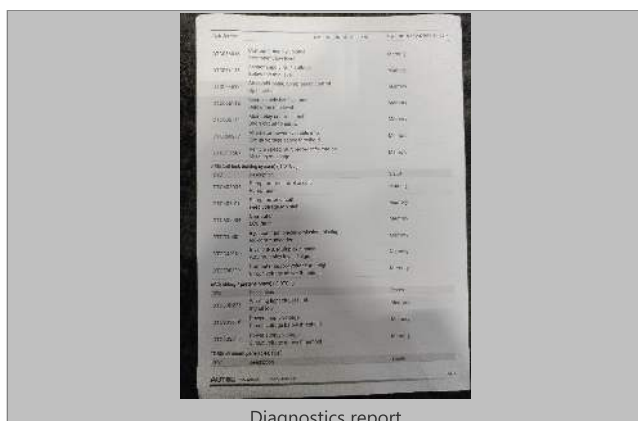

Diagnostics report

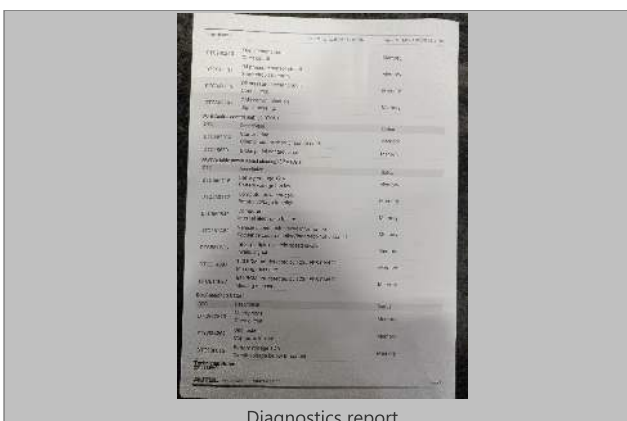

Diagnostics report

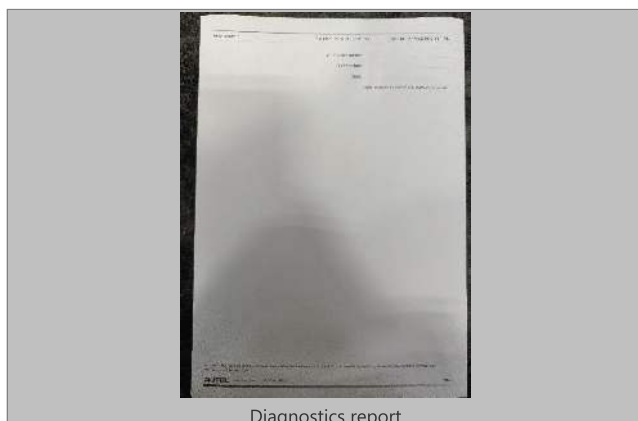

Diagnostics report



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:

2017298990

DATE

15/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:

2017298990

DATE

15/09/2026




90 DEGREE RIGHT




90 DEGREE REAR




90 DEGREE LEFT

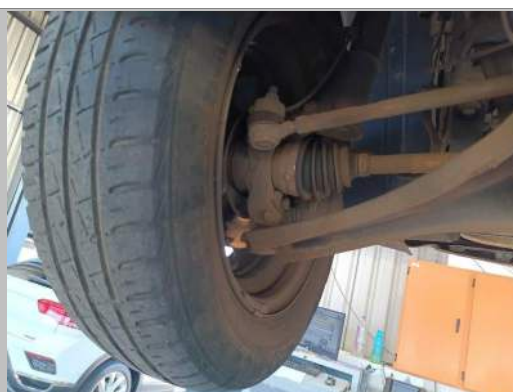

LF TYRE TREAD

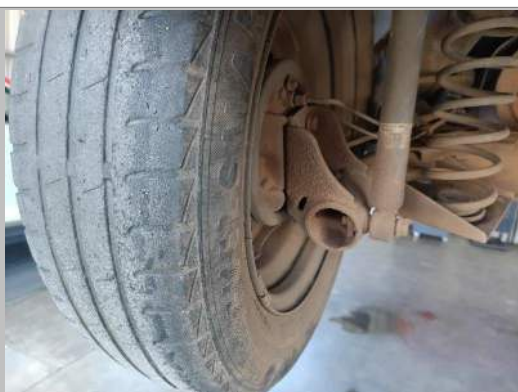

LR TYRE TREAD

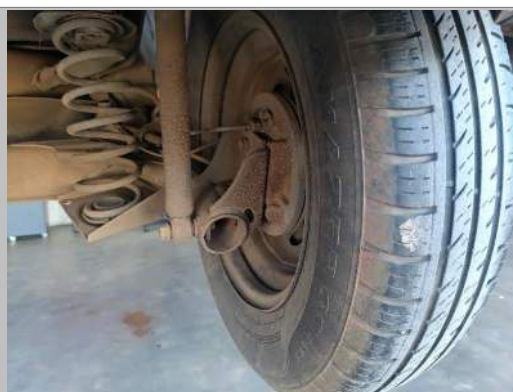

RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:

2017298990

DATE

15/09/2026




RF TYRE TREAD



Sparewheel



LICENSE DISC

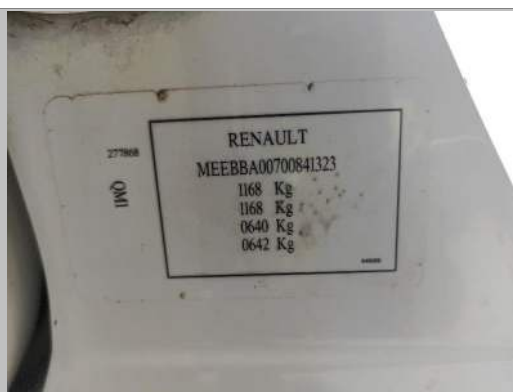

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026



REAR




CHASSIS



Oil cap



Coolant reservoir

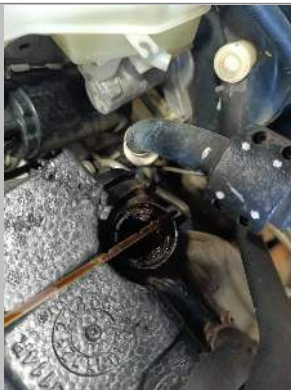

Dipstick



No open the boot

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323




CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026



Wiring connections

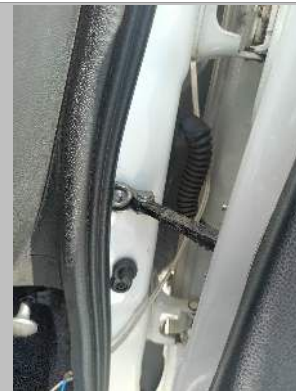

Wiring connections



Load Body



Load Body



Door Handle Front Right



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026



Front Fender Left



Bonnet



Engine Wiring



Engine Wiring



Engine Wiring



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026



Headlight Left



Grill



Grill



Tyre Front Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026



Front Bumper



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Door Front Left



Tyre Rear Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323



CONDITION REPORT



Report No:
2017298990
DATE
15/09/2026



Engine



Fuel Flap



Fuel Flap



Windscreen



Windscreen



Door Handle Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00700841323