



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LK11WJGP
Model	KWID	Register Number	
VIN	MEEBBA00800847048	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	62,123 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:

2017296557

DATE

09/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Parcel Tray Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Pitmarks	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Sill Panel Left Dented	Repair
Windscreen Chipped	Replace
Shock Absorber Rear Left Sweat	Replace
Shock Absorber Rear Right Sweat	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Left Damaged	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Dented	Repair
Chassis Scratched	Repair
Radiator Cradle Dented	Replace
Foreign substance on oil cap	Repair
Front bumper stiffener damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.98	2.28	-	
Rear	1.04	1.13	-	
Emergency / Parking	1.01	1.35	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81T	Ceat	Fuelsmart	V	1923	1 mm
Front Right	165/70 R14	81T	Ceat	Fuelsmart	V	0000	0 mm
Rear Left	165/70 R14	81T	Anchee	AC808	V	4425	4 mm
Rear Right	165/70 R14	81T	Anchee	AC808	V	0825	4 mm
Spare	165/70 R14	81R	Ceat	Temporary	V	1923/	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC0226F3	BRAKE/ACCELERATOR PEDAL POSITIONS FAULT ON GANGS 1	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:

Report No.
2017296557

DATE _____

09/09/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2

[illegible]

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:

2017296557

DATE

09/09/2026




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

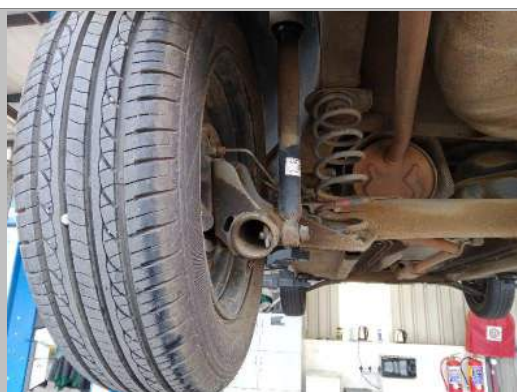

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026

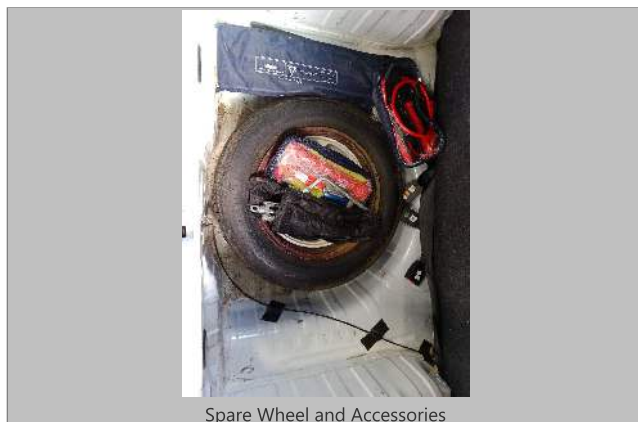


Spare Wheel and Accessories



LICENSE DISC




VIN PLATE OR STICKER

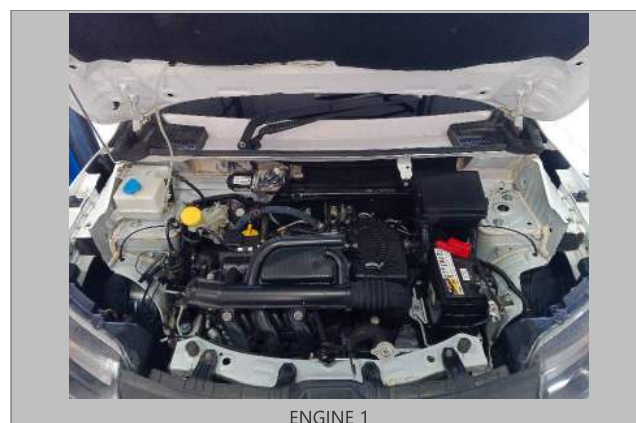

ENGINE 1



Front chassis

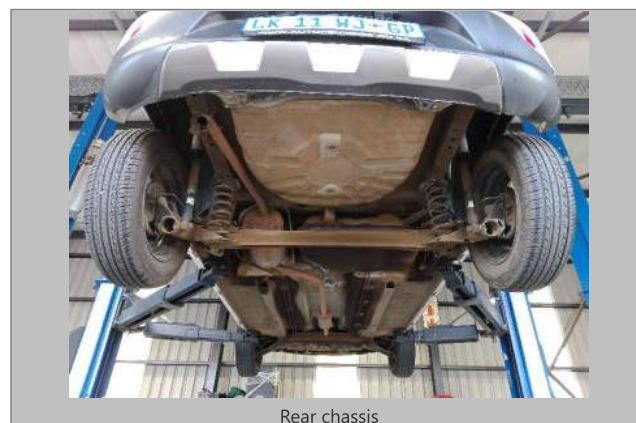

Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Oil cap and dipstick



Front bumper stiffener



Rear bumper



Boot Lid / Hatch door



Door Rear Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Door Sealing Rubber Front Left




Parcel Tray



Front Fender Right



Door Front Right

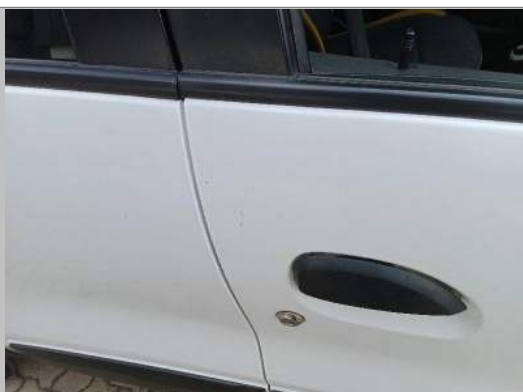

Door Front Right



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Door Sealing Rubber Rear Right



Bonnet



Windscreen



Water level



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Front Bumper



Tyre Front Left



Tyre Front Left



Sill Panel Left



Rim Front Left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Door Front Left



Tyre Rear Right



Tyre Front Right



Rim Front Left



Radiator Cradle



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Chassis



Mounting Rubber(s) Rear Axle Left



Mounting Rubber(s) Rear Axle Right



Shock Absorber Rear Left



Shock Absorber Rear Right



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048



CONDITION REPORT



Report No:
2017296557
DATE
09/09/2026



Door Sealing Rubber Front Right



Seat Front Right



Door Rear Right



Front Fender Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00800847048