



CONDITION REPORT



Report No:
2017288678
DATE
24/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/08/2026		M57 Pretoria Road - 1619
Inspection Date	24/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	KS65KFGP
Model	CRETA 1.5 PREMIUM [2022-2024]	Register Number	
VIN	MF3PB812LPJ017318	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2026
Color	RED	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	67,478 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL


Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MF3PB812LPJ017318

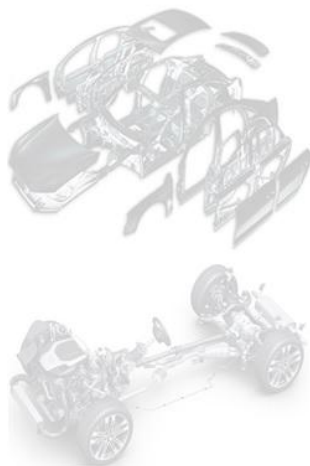

Damage

Parcel Tray Missing
Front Bumper Paintwork • Scratched
Front Fender Left Residual Traces of Repair
Door Front Left Paintwork • Scratched
Rear bumper Paintwork • Scratched
Engine

Repair Way

Replace
Repair
Repair
Repair
Repair
Bottom of engine is fully covered

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	3.0	-	
Rear	2.0	2.0	-	
Emergency / Parking	1.5	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Kumho	Solus	V	1122	3 mm
Front Right	215/60R17	96H	Kumho	Solus	V	0922	3 mm
Rear Left	215/60R17	96H	Kumho	Solus	V	0922	5 mm
Rear Right	215/60R17	96H	Kumho	Solus	V	0922	5 mm
Spare	215/60R17	96H	Kumho	Solus	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0070:00	AMBIENT AIR TEMPERATURE AAT SENSOR CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS. BODY EXTERIOR - RESIDUAL TRACES OF POOR REPAIR ON BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



INTERIOR (FRONT DRIVER DOOR)



Manual transmission.



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick



Coolant reservoir



LF TYRE TREAD



RF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD




Sparewheel

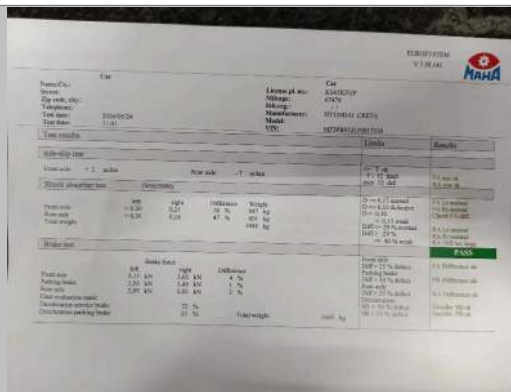


Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MF3PB812LPJ017318

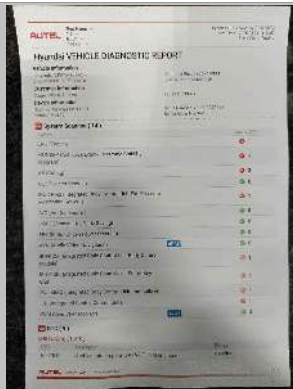

Diagnostic Report page 1

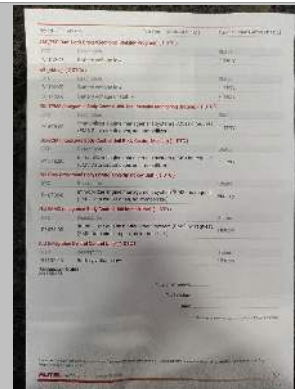

Diagnostic Report page 2



Parcel Tray




Front Fender Left



Front Bumper



Door Front Left

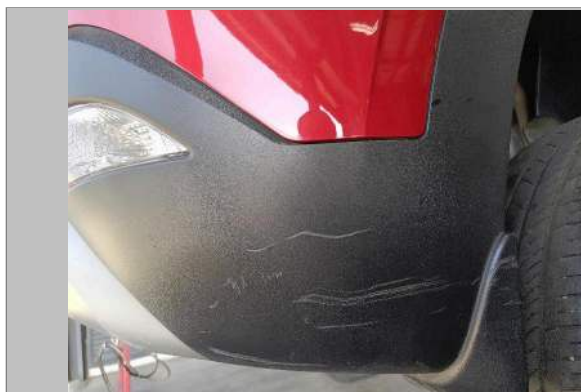

Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MF3PB812LPJ017318