



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	LC02TZGP
Model	SONET	Register Number	
VIN	MZBFB814LPN243671	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	RED	Power / Displacement	
Year Model		Paint Finish	PEARL EFFECT
Km Reading	53,652 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Damage	Repair Way
Radiator Defective	Repair
Air conditioner pipes Damaged	Replace
Air cleaner Defective	Replace
Center Console / Cubbyhole + Lid Defective	Repair
Windscreen Wiper Damaged	Replace
Air Conditioner Insufficient	Replace
Indicator Light Front Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Hood Lining Dirty	Repair
Door Panel Front Right Defective	Repair
Door Sealing Rubber Rear Left Damaged	Replace
Boot Carpet Damaged	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Replace
Bonnet Paintwork • Scratched	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Rocker Panel Left Damaged	Repair
Windscreen Chipped	Repair
Rim Spare Wheel Dented	Repair
Main Beam Left Damaged	Repair
Sub Frame Damaged	Replace
Gearbox Oil Sweat	Repair
Radiator Cradle Damaged	Replace
Jack Missing	Replace
Wheel Spanner Missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.65	2.55	-	
Rear	1.54	2.06	-	
Emergency / Parking	1.46	1.57	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Goodyear	Assurance	V	3822	3 mm
Front Right	195/65R15	91H	Goodyear	Assurance	V	2522	3 mm
Rear Left	195/65R15	91H	Goodyear	Assurance	V	3722	3 mm
Rear Right	195/65R15	91H	Goodyear	Assurance	V	2322	1 mm
Spare	195/65R15	91H	Goodyear	Assurance	V	2322	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Engine Compartment: Radiator and Aircon condenser misaligned. Foreign substance inside radiator and expansion bottle.
Interior: The vehicle interior is dirty, and the panels are scratched. Front right door panel loose.
Body • Exterior: Dents and scratches on body panels. Signs of impact damage to the front of the vehicle. Body panels misaligned.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026

Car				Car	
Name/Car:				Year:	10/2019
Model:				Mileage:	53622
Reg. no. city:				Insured:	Y/N
Registration:				Manufacturer:	MAZDA
Test date:	2024/09/19			Model:	MAZDA 3
Test time:	11:26			VIN:	MZBFB814LPN243671

Test results				Results
Under-ride test				
Front axle	→	mm	mm	→ 3.48
				1.12 mm
				1.12 mm
Shock absorber test				
	mm	mm	mm	
Front axle	→ 0.30	→ 0.30	→ 0.30	→ 0.30
Rear axle	→ 0.30	→ 0.30	→ 0.30	→ 0.30
Test weight	→ 0.30	→ 0.30	→ 0.30	→ 0.30
Brake test				
	mm	mm	mm	
Front axle	→ 0.30	→ 0.30	→ 0.30	→ 0.30
Rear axle	→ 0.30	→ 0.30	→ 0.30	→ 0.30
Test weight	→ 0.30	→ 0.30	→ 0.30	→ 0.30

Brake and shock absorber report



Front chassis



Rear chassis

KIA VEHICLE DIAGNOSTIC REPORT	
Vehicle ID:	MAZDA3
Year:	2019
Model:	MAZDA3
Engine:	2.0L
Transmission:	6-Speed
Drive Type:	FWD
Test Date:	2024/09/19
Test Time:	11:26
Test Location:	DEKRA
Test Technician:	DEKRA
Test Results:	PASS

Diagnostic report page 1

KIA VEHICLE DIAGNOSTIC REPORT	
Vehicle ID:	MAZDA3
Year:	2019
Model:	MAZDA3
Engine:	2.0L
Transmission:	6-Speed
Drive Type:	FWD
Test Date:	2024/09/19
Test Time:	11:26
Test Location:	DEKRA
Test Technician:	DEKRA
Test Results:	PASS

Diagnostic report page 2



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:

2017297100

DATE

10/09/2026



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT




Report No:
2017297100
DATE
10/09/2026



LR TYRE TREAD



RR TYRE TREAD

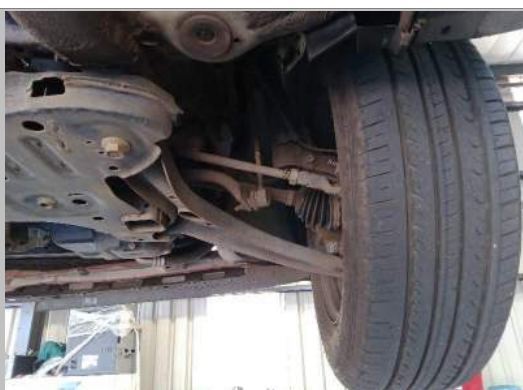

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBF814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Center Console / Cubbyhole + Lid



Steering Wheel Trim



Hood Lining



Air Conditioner



Seat Front Right



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Seat Rear



Door Sealing Rubber Rear Left



Seat Front Left



Windscreen Wiper



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Door Front Left



Door Rear Left



Door Rear Left



Rear Fender Left



Rear Fender Left



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Door Front Right



Door Rear Right



Door Rear Right



Rear Fender Right



Rear Fender Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door



Rim Spare Wheel



Boot Carpet



Boot Carpet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Indicator Light Front Right



Bonnet



Bonnet



Windscreen



Air cleaner



Front Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Front Bumper



Front Bumper



Front Bumper



Radiator Cradle



Radiator Cradle



Rocker Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Rocker Panel Left



Sub Frame



Sub Frame



Main Beam Left



Radiator Cradle



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671



CONDITION REPORT



Report No:
2017297100
DATE
10/09/2026



Radiator



Air conditioner pipes



Side Mirror Right



Water level



Water level



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LPN243671