



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	31/07/2026		M57 Pretoria Road - 1619
Inspection Date	31/07/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	JAGUAR	Registration Number	KLJ021NW
Model	F-PACE	Register Number	
VIN	SADCA2AN6KA608770	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2026
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	101,471 KM	Fuel	DIESEL
Cab / Body Type	SUV	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:

2017278310

DATE

31/07/2026



Damage

Repair Way

Engine Oil Leak	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/55R19	111V	Maxtrex	Radial	V	4921	0 mm
Front Right	255/55R19	111V	Maxtrex	Radial	V	0122	0 mm
Rear Left	255/55R19	111V	Maxtrex	Radial	V	0122	0 mm
Rear Right	255/55R19	111V	Maxtrex	Radial	V	0122	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	U0080-81	VEHICLE COMMUNICATION BUS F- INVALID SERIAL DATA RECEIVED	
2	IMC	B1087-87	LIN BUS A- MISSING MESSAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SADCA2AN6KA608770




CONDITION REPORT




Report No:
2017278310
DATE
31/07/2026

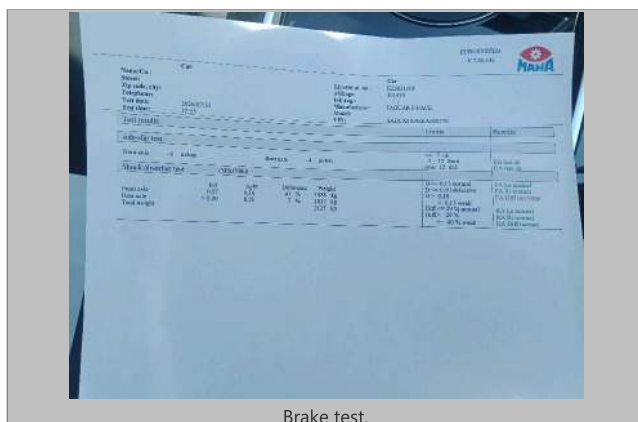


Brake test.

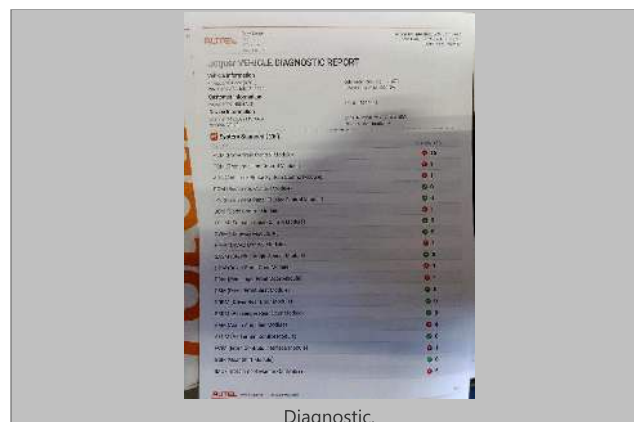


Diagnostic.

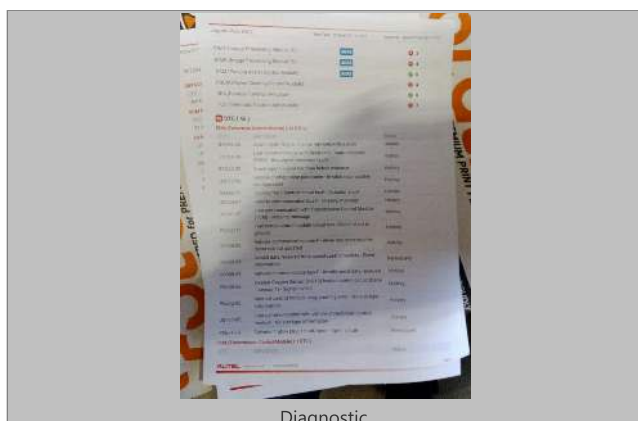

Diagnostic.

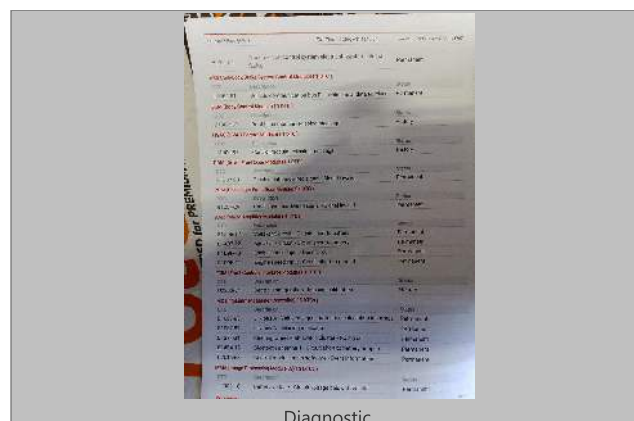

Diagnostic.

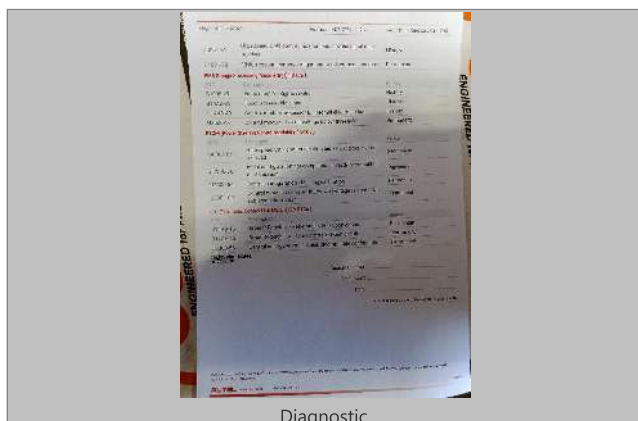

Diagnostic.



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026




90 DEGREE RIGHT



90 DEGREE REAR




90 DEGREE LEFT

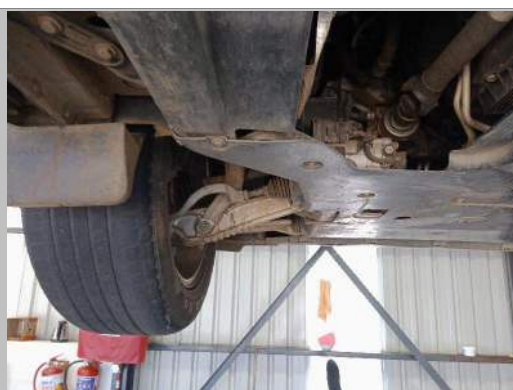

LF TYRE TREAD



LR TYRE TREAD

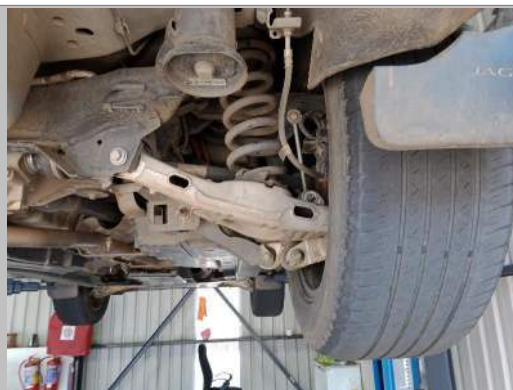

RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT




Report No:
2017278310
DATE
31/07/2026



RF TYRE TREAD



LICENSE DISC

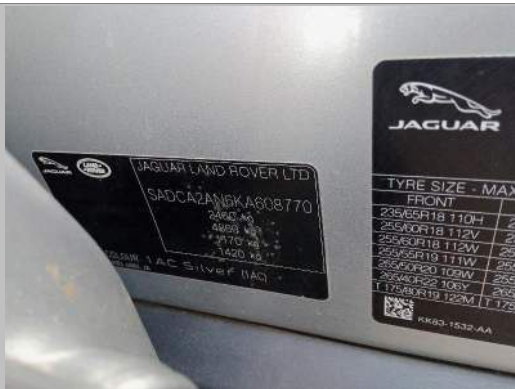


VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.

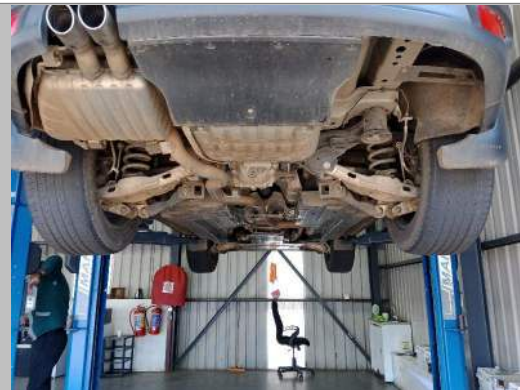

Undercarriage rear.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026



Oil cap and dipstick.



Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026



Door Front Left



Door Rear Left



Boot Lid / Hatch door



Rear bumper



Rear bumper



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770




CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026



Door Front Right

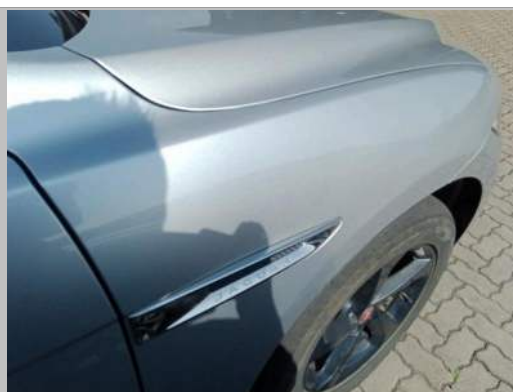

Front Fender Right




Rear Fender Left



Windscreen



Tyre Rear Left

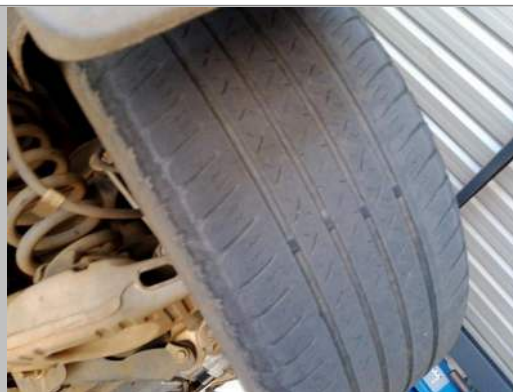

Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770



CONDITION REPORT



Report No:
2017278310
DATE
31/07/2026



Tyre Front Left



Tyre Front Right



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SADCA2AN6KA608770