



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/08/2026		M57 Pretoria Road - 1619
Inspection Date	06/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	AUDI	Registration Number	DT76MTGP
Model	A3 SPORTBACK 1.4T FSI S 5-DR S TRONIC [2013-2014]	Register Number	
		Date Of First Licensing	
VIN	WAUZZZ8V9EA201248	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	GREY	Paint Finish	M - METALLIC
Year Model	2015	Fuel	PETROL
Km Reading	163,094 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:

2017281269

DATE

06/08/2026

Damage

Repair Way

Hood Lining Damaged	Repair
Door Panel Front Right Missing	Repair
Door Hinges Front Right Defective	Repair
Boot Panel Left Damaged	Repair
Rear Upper Valance Residual Traces of Repair	Repair
Front Bumper Residual Traces of Repair	Repair
B • Pillar Right Welded	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear Fender Right / Inner Tray Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Right Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Rim Front Left Deformed	Repair
Gear Selections Insufficient	Repair
Warning lights illuminated	Repair
In automatic transmission engaged revs cut @ 3rpm	Repair
Som body panels a painted in red.	Repair
Possible code 3	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.2	4.0	-	
Rear	2.3	2.1	-	
Emergency / Parking	1.1	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91H	Hankook	Ventus	V	2722	4 mm
Front Right	205/55R16	91H	Hankook	Ventus	V	2722	3 mm
Rear Left	205/55R16	91V	Firestone	Touring	V	4721	3 mm
Rear Right	205/55R16	91V	Firestone	Touring	V	4621	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BRAKES	B13BCF1	MULTIPLE COLLISION BRAKE TRIGGERED	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Residual traces of poor repair on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:

2017281269

DATE

06/08/2026

Shock and brake report

Vehicle No: 2017281269
 Date: 06/08/2026
 Location: Pretoria
 Technician: [Name]
 Vehicle Type: [Type]
 Make/Model: [Make/Model]
 Year: [Year]

Item	Left	Right
Shock absorber	OK	OK
Coil spring	OK	OK
Stabilizer bar	OK	OK
Brake pads	OK	OK
Brake discs	OK	OK
Brake lines	OK	OK
Brake master cylinder	OK	OK
Brake booster	OK	OK
Brake pedal	OK	OK
Brake fluid level	OK	OK
Brake fluid condition	OK	OK
Brake system overall	OK	OK

Shock and brake report

Diagnostic test

Vehicle No: 2017281269
 Date: 06/08/2026
 Location: Pretoria
 Technician: [Name]
 Vehicle Type: [Type]
 Make/Model: [Make/Model]
 Year: [Year]

System	Test Result
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Electrical	OK
Lighting	OK
Audio/Video	OK
Interior	OK
Exterior	OK
Overall	OK

Diagnostic test

Diagnostic test

Vehicle No: 2017281269
 Date: 06/08/2026
 Location: Pretoria
 Technician: [Name]
 Vehicle Type: [Type]
 Make/Model: [Make/Model]
 Year: [Year]

System	Test Result
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Electrical	OK
Lighting	OK
Audio/Video	OK
Interior	OK
Exterior	OK
Overall	OK

Diagnostic test

Diagnostic test

Vehicle No: 2017281269
 Date: 06/08/2026
 Location: Pretoria
 Technician: [Name]
 Vehicle Type: [Type]
 Make/Model: [Make/Model]
 Year: [Year]

System	Test Result
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Electrical	OK
Lighting	OK
Audio/Video	OK
Interior	OK
Exterior	OK
Overall	OK

Diagnostic test

Diagnostic test

Vehicle No: 2017281269
 Date: 06/08/2026
 Location: Pretoria
 Technician: [Name]
 Vehicle Type: [Type]
 Make/Model: [Make/Model]
 Year: [Year]

System	Test Result
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Electrical	OK
Lighting	OK
Audio/Video	OK
Interior	OK
Exterior	OK
Overall	OK

Diagnostic test

Diagnostic test

Vehicle No: 2017281269
 Date: 06/08/2026
 Location: Pretoria
 Technician: [Name]
 Vehicle Type: [Type]
 Make/Model: [Make/Model]
 Year: [Year]

System	Test Result
Engine	OK
Transmission	OK
Clutch	OK
Brake	OK
Steering	OK
Suspension	OK
Wheels/Tyres	OK
Electrical	OK
Lighting	OK
Audio/Video	OK
Interior	OK
Exterior	OK
Overall	OK

Diagnostic test

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:

2017281269

DATE

06/08/2026




FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

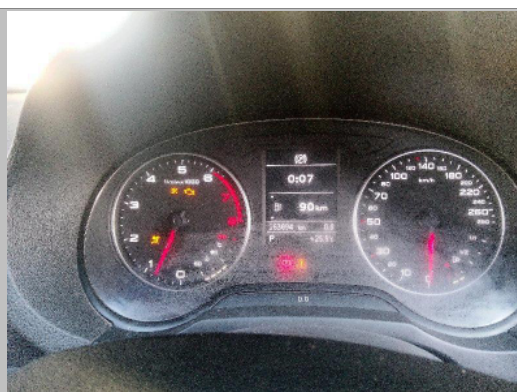

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



RF TYRE TREAD



RR TYRE TREAD



No license disc



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



CHASSIS



REAR



Warning lights illuminated



Expansion bottle



Oil cap and dipstick



No sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Front Fender Right



Door Front Right




Door Rear Right



Rear Fender Right



Hood Lining

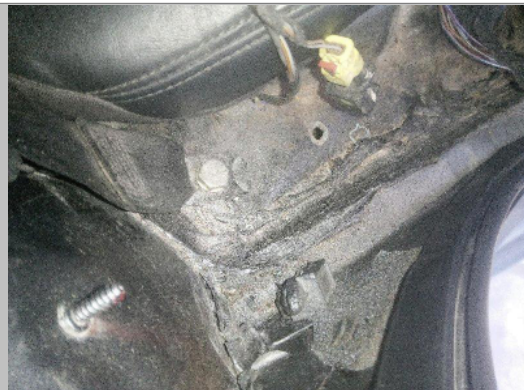

Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Sill Panel Right



Rear Upper Valance



Rear Upper Valance



Boot Panel Left



Boot Panel Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Boot Lid / Hatch door



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear Fender Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Front Fender Left



Water level



Stabilizer Mounting Front Right



Front Bumper



Front Bumper



Stabilizer Mounting Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Rear bumper




Rear bumper



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray

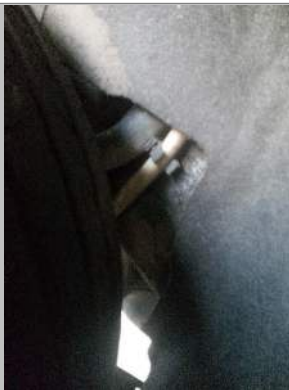

Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Rim Front Left



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Windscreen



Windscreen



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248



CONDITION REPORT



Report No:
2017281269
DATE
06/08/2026



Door Hinges Front Right



B • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V9EA201248