



CONDITION REPORT



Report No:

2017290735

DATE

27/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/08/2026		M57 Pretoria Road - 1619
Inspection Date	27/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	KW53YVGP
Model	218I GRAN COUPE STEPTRONIC [2020-2025]	Register Number	
VIN	WBA12AK0107L54454	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/12/2026
Color	BLUE	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT METALLIC
Km Reading	170,514 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:
2017290735
DATE
27/08/2026

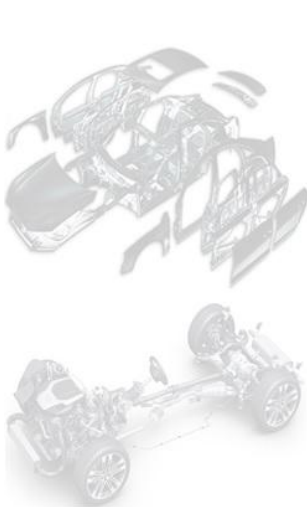

Damage	Repair Way
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Windscreen Chipped	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	3.67	-	
Rear	2.71	2.89	-	
Emergency / Parking	2.42	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	Continental	Contisport	V	2125	0 mm
Front Right	225/40R18	92W	Continental	Contisport	V	2025	0 mm
Rear Left	225/40R18	92W	Continental	Contisport	V	4824	2 mm
Rear Right	225/40R18	88Y	Continental	Contisport	V	1924	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:
2017290735
DATE
27/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DME	101F01	AIR MASS SYSTEM, PLAUSIBILITY: CALCULATED AIR MASSESS IN THE AIR INTAKE SYSTEM NOT PLAUSIBLE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 36 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:
2017290735
DATE
27/08/2026

Vehicle Information				Test Results			
Make	Model	Year	Color	Test Date	Test Time	Test Location	Test Result
MAHA							
Test Details				Test Results			
Test Name	Test Description	Test Result	Test Status	Test Name	Test Description	Test Result	Test Status
Brake Test	Brake Pedal Force	100 N	Pass	Brake Test	Brake Pedal Force	100 N	Pass
Brake Test	Brake Pedal Force	100 N	Pass	Brake Test	Brake Pedal Force	100 N	Pass
Brake Test	Brake Pedal Force	100 N	Pass	Brake Test	Brake Pedal Force	100 N	Pass
Brake Test	Brake Pedal Force	100 N	Pass	Brake Test	Brake Pedal Force	100 N	Pass

Brake test.

Vehicle Information				Test Results			
Make	Model	Year	Color	Test Date	Test Time	Test Location	Test Result
MAHA							
Test Details				Test Results			
Test Name	Test Description	Test Result	Test Status	Test Name	Test Description	Test Result	Test Status
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass

Diagnostic.

Vehicle Information				Test Results			
Make	Model	Year	Color	Test Date	Test Time	Test Location	Test Result
MAHA							
Test Details				Test Results			
Test Name	Test Description	Test Result	Test Status	Test Name	Test Description	Test Result	Test Status
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass

Diagnostic.

Vehicle Information				Test Results			
Make	Model	Year	Color	Test Date	Test Time	Test Location	Test Result
MAHA							
Test Details				Test Results			
Test Name	Test Description	Test Result	Test Status	Test Name	Test Description	Test Result	Test Status
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass
Diagnostic	Engine Fault Codes	None	Pass	Diagnostic	Engine Fault Codes	None	Pass

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:

2017290735

DATE

27/08/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:

2017290735

DATE

27/08/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:
2017290735
DATE
27/08/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:
2017290735
DATE
27/08/2026



Water level



Front Bumper



Front Bumper



Bonnet



Windscreen



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454



CONDITION REPORT



Report No:
2017290735
DATE
27/08/2026



Tyre Front Left



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA12AK0107L54454