



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	FS27RZGP
Model	318I STEPTRONIC [2015-2019]	Register Number	
VIN	WBA8E36030NU33390	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	C - COMMON
Km Reading	236,645 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:

2017296559

DATE

09/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Dim and Bright Indicator Light Malfunction	Repair
Fog Light Front Left Malfunction	Repair
Fog Light Front Right Missing	Replace
Seat Front Right Torn / Cut	Repair
Side Mirror Left Damaged	Repair
Side Mirror Right Damaged	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Belly plates Damaged	Replace
Gearbox Oil Leak	Repair
Engine Noise Excessive	Repair
Engine Smoke Excessive	Repair
Suspension noisy	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.52	2.49	-	
Rear	2.58	3.18	-	
Emergency / Parking	2.02	2.53	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:

2017296559

DATE

09/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	Wanli	Sport macra	V	2121	3 mm
Front Right	225/45R18	95Y	Bridgestone	Potenza	V	2418	2 mm
Rear Left	245/45R18	100W	Michelin	Primacy 4	V	3018	2 mm
Rear Right	245/40R18	97Y	Goodyear	Efficient gr	V	3719	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DSC(DYNAMIC STABILITY CONTROL)	480A12	BRAKE PAD WEAR SENSOR: REAR AXLE, REPLACE BRAKE PADS	PERMANENT

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS. SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:

2017296559

DATE

09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



AUTOMATIC GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390




CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



LR TYRE TREAD

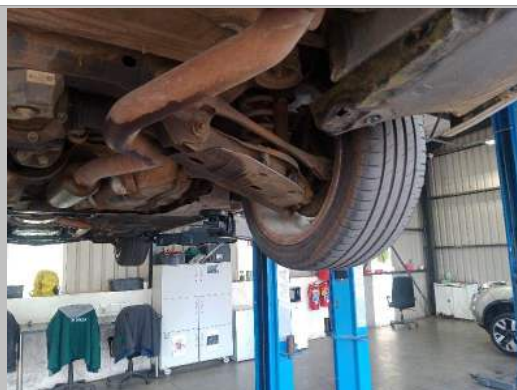

RR TYRE TREAD



ENGINE 1



ENGINE 2



CHASSIS



OIL CAP

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



COOLANT EXPANSION BOTTLE



NO SPARE WHEEL



LICENSE DISC



VIN PLATE OR STICKER

Car				Car			
Make/Mod.	Model	Engine/Reg. No.	Engine/Reg. No.	Make/Mod.	Model	Engine/Reg. No.	Engine/Reg. No.
BMW	3 Series	2000cc	2000cc	BMW	3 Series	2000cc	2000cc
Year	2000	Year	2000	Year	2000	Year	2000
Color	Black	Color	Black	Color	Black	Color	Black
Weight	1500 kg	Weight	1500 kg	Weight	1500 kg	Weight	1500 kg
Power	100 kW	Power	100 kW	Power	100 kW	Power	100 kW
Speed	180 km/h	Speed	180 km/h	Speed	180 km/h	Speed	180 km/h
Brake	Disc	Brake	Disc	Brake	Disc	Brake	Disc
Steering	Power	Steering	Power	Steering	Power	Steering	Power
Transmission	Manual	Transmission	Manual	Transmission	Manual	Transmission	Manual
Drive	Front	Drive	Front	Drive	Front	Drive	Front
Wheels	18"	Wheels	18"	Wheels	18"	Wheels	18"
Tires	P205/55R18	Tires	P205/55R18	Tires	P205/55R18	Tires	P205/55R18
Exterior	Black	Exterior	Black	Exterior	Black	Exterior	Black
Interior	Black	Interior	Black	Interior	Black	Interior	Black
Options	None	Options	None	Options	None	Options	None
Notes		Notes		Notes		Notes	

SHOCK AND BRAKE TEST REPORT

Car				Car			
Make/Mod.	Model	Engine/Reg. No.	Engine/Reg. No.	Make/Mod.	Model	Engine/Reg. No.	Engine/Reg. No.
BMW	3 Series	2000cc	2000cc	BMW	3 Series	2000cc	2000cc
Year	2000	Year	2000	Year	2000	Year	2000
Color	Black	Color	Black	Color	Black	Color	Black
Weight	1500 kg	Weight	1500 kg	Weight	1500 kg	Weight	1500 kg
Power	100 kW	Power	100 kW	Power	100 kW	Power	100 kW
Speed	180 km/h	Speed	180 km/h	Speed	180 km/h	Speed	180 km/h
Brake	Disc	Brake	Disc	Brake	Disc	Brake	Disc
Steering	Power	Steering	Power	Steering	Power	Steering	Power
Transmission	Manual	Transmission	Manual	Transmission	Manual	Transmission	Manual
Drive	Front	Drive	Front	Drive	Front	Drive	Front
Wheels	18"	Wheels	18"	Wheels	18"	Wheels	18"
Tires	P205/55R18	Tires	P205/55R18	Tires	P205/55R18	Tires	P205/55R18
Exterior	Black	Exterior	Black	Exterior	Black	Exterior	Black
Interior	Black	Interior	Black	Interior	Black	Interior	Black
Options	None	Options	None	Options	None	Options	None
Notes		Notes		Notes		Notes	

DIAGNOSTIC REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT




Report No:


2017296559

DATE


09/09/2026

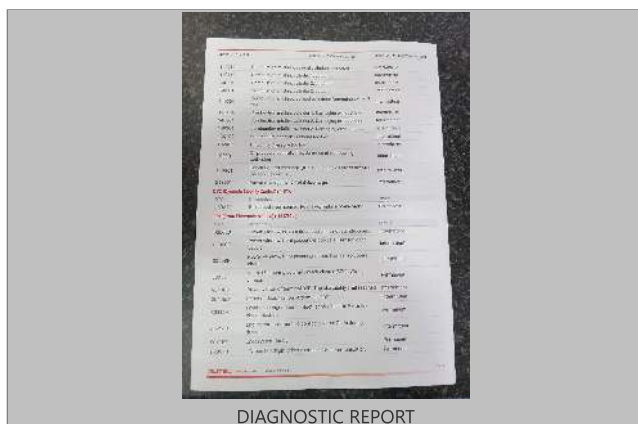

DIAGNOSTIC REPORT

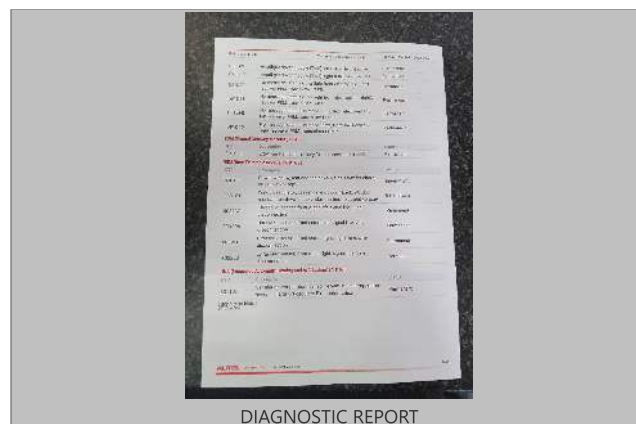

DIAGNOSTIC REPORT

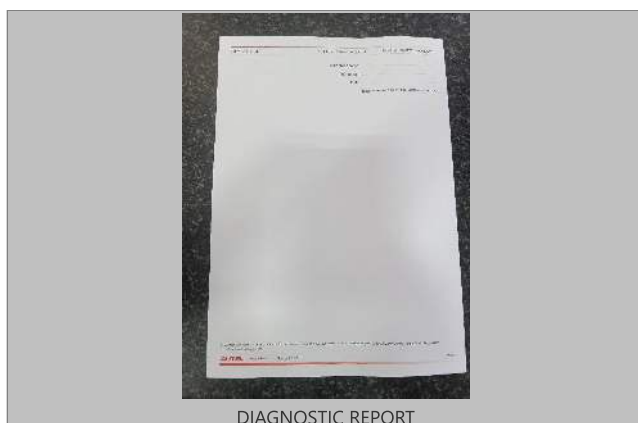


DIAGNOSTIC REPORT



Water level



Bonnet slam plate (Shock tower/ Inner tray)

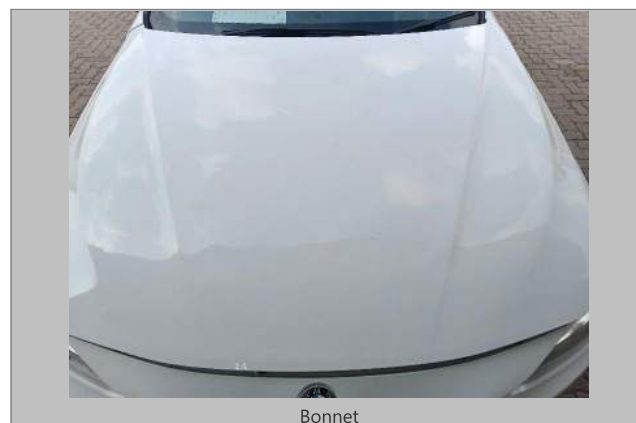

Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



Seat Front Right



Windscreen



Dim and Bright Indicator Light



Dim and Bright Indicator Light



Fog Light Front Left



Fog Light Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



Side Mirror Right



Side Mirror Left



Front Bumper



Front Bumper



Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



Door Front Right



Front Fender Right



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



Rear bumper



Rear bumper



Boot Lid / Hatch door



Belly plates



Gearbox



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390



CONDITION REPORT



Report No:
2017296559
DATE
09/09/2026



Bolt(s) / Nut(s) Front Wheel Right



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Rear Wheel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA8E36030NU33390