



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/08/2026		M57 Pretoria Road - 1619
Inspection Date	20/08/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MERCEDES-BENZ	Registration Number	KD69DYGP
Model	C180	Register Number	
VIN	WDD2050402R431828	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/11/2026
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	130,370 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

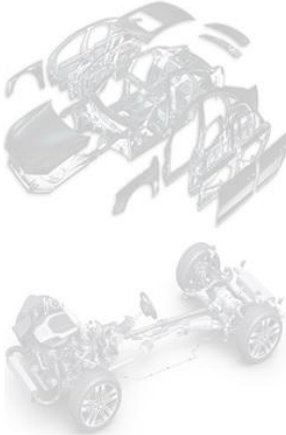
VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026

	Damage	Repair Way
	Tail Light Left Damaged	Replace
	Seat Front Left Torn / Cut	Repair
	Seat Front Right Torn / Cut	Repair
	Front Bumper Paintwork • Scratched	Repair
	Front Fender Right Paintwork • Scratched	Repair
	Door Rear Right Paintwork • Scratched	Repair
	Gearbox Oil Sweat	Repair
	Number plate and license disc does not correspond	Repair
	Engine light illuminated	Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.4	4.0	-	
Rear	2.3	2.3	-	
Emergency / Parking	0.7	0.6	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R17	94W	Bridgestone	Potenza	V	2824	4 mm
Front Right	225/50R17	94W	Bridgestone	Potenza	V	3224	4 mm
Rear Left	225/50R17	94W	Bridgestone	Turanza	V	2525	6 mm
Rear Right	225/50R17	94W	Bridgestone	Turanza	V	2525	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL UNIT	P008700	THE FUEL PRESSURE IN THE SYSTEM IS TOO LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Signs of spray work done on body panels.

Undercarriage: Undercarriage is fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026

SHOCK AND BRAKE REPORT			
Vehicle	Car	Engine	Car
Make	Mercedes-Benz	Model	GLC 300
Year	2017	Year	2017
Registration	2017/08/20	Registration	2017/08/20
Inspection	2026	Inspection	2026
SHOCK AND BRAKE REPORT			
Wheel	Left	Right	Result
Front Left	1.0	1.0	OK
Front Right	1.0	1.0	OK
Rear Left	1.0	1.0	OK
Rear Right	1.0	1.0	OK
Brake	1.0	1.0	OK
Steering	1.0	1.0	OK
Chassis	1.0	1.0	OK
Engine	1.0	1.0	OK
Transmission	1.0	1.0	OK
Exhaust	1.0	1.0	OK
Lighting	1.0	1.0	OK
Wipers	1.0	1.0	OK
Windows	1.0	1.0	OK
Seats	1.0	1.0	OK
Interior	1.0	1.0	OK
Exterior	1.0	1.0	OK
Overall	1.0	1.0	OK

Shock and brake report

DIAGNOSTICS REPORT			
Vehicle	Car	Engine	Car
Make	Mercedes-Benz	Model	GLC 300
Year	2017	Year	2017
Registration	2017/08/20	Registration	2017/08/20
Inspection	2026	Inspection	2026
DIAGNOSTICS REPORT			
Wheel	Left	Right	Result
Front Left	1.0	1.0	OK
Front Right	1.0	1.0	OK
Rear Left	1.0	1.0	OK
Rear Right	1.0	1.0	OK
Brake	1.0	1.0	OK
Steering	1.0	1.0	OK
Chassis	1.0	1.0	OK
Engine	1.0	1.0	OK
Transmission	1.0	1.0	OK
Exhaust	1.0	1.0	OK
Lighting	1.0	1.0	OK
Wipers	1.0	1.0	OK
Windows	1.0	1.0	OK
Seats	1.0	1.0	OK
Interior	1.0	1.0	OK
Exterior	1.0	1.0	OK
Overall	1.0	1.0	OK

Diagnostics report

DIAGNOSTICS REPORT			
Vehicle	Car	Engine	Car
Make	Mercedes-Benz	Model	GLC 300
Year	2017	Year	2017
Registration	2017/08/20	Registration	2017/08/20
Inspection	2026	Inspection	2026
DIAGNOSTICS REPORT			
Wheel	Left	Right	Result
Front Left	1.0	1.0	OK
Front Right	1.0	1.0	OK
Rear Left	1.0	1.0	OK
Rear Right	1.0	1.0	OK
Brake	1.0	1.0	OK
Steering	1.0	1.0	OK
Chassis	1.0	1.0	OK
Engine	1.0	1.0	OK
Transmission	1.0	1.0	OK
Exhaust	1.0	1.0	OK
Lighting	1.0	1.0	OK
Wipers	1.0	1.0	OK
Windows	1.0	1.0	OK
Seats	1.0	1.0	OK
Interior	1.0	1.0	OK
Exterior	1.0	1.0	OK
Overall	1.0	1.0	OK

Diagnostics report

DIAGNOSTICS REPORT			
Vehicle	Car	Engine	Car
Make	Mercedes-Benz	Model	GLC 300
Year	2017	Year	2017
Registration	2017/08/20	Registration	2017/08/20
Inspection	2026	Inspection	2026
DIAGNOSTICS REPORT			
Wheel	Left	Right	Result
Front Left	1.0	1.0	OK
Front Right	1.0	1.0	OK
Rear Left	1.0	1.0	OK
Rear Right	1.0	1.0	OK
Brake	1.0	1.0	OK
Steering	1.0	1.0	OK
Chassis	1.0	1.0	OK
Engine	1.0	1.0	OK
Transmission	1.0	1.0	OK
Exhaust	1.0	1.0	OK
Lighting	1.0	1.0	OK
Wipers	1.0	1.0	OK
Windows	1.0	1.0	OK
Seats	1.0	1.0	OK
Interior	1.0	1.0	OK
Exterior	1.0	1.0	OK
Overall	1.0	1.0	OK

Diagnostics report

DIAGNOSTICS REPORT			
Vehicle	Car	Engine	Car
Make	Mercedes-Benz	Model	GLC 300
Year	2017	Year	2017
Registration	2017/08/20	Registration	2017/08/20
Inspection	2026	Inspection	2026
DIAGNOSTICS REPORT			
Wheel	Left	Right	Result
Front Left	1.0	1.0	OK
Front Right	1.0	1.0	OK
Rear Left	1.0	1.0	OK
Rear Right	1.0	1.0	OK
Brake	1.0	1.0	OK
Steering	1.0	1.0	OK
Chassis	1.0	1.0	OK
Engine	1.0	1.0	OK
Transmission	1.0	1.0	OK
Exhaust	1.0	1.0	OK
Lighting	1.0	1.0	OK
Wipers	1.0	1.0	OK
Windows	1.0	1.0	OK
Seats	1.0	1.0	OK
Interior	1.0	1.0	OK
Exterior	1.0	1.0	OK
Overall	1.0	1.0	OK

Diagnostics report



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026



RF TYRE TREAD



No sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026



CHASSIS



REAR



Engine warning lights illumina



oil cap and dipstick



Expansion bottle



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026



Seat Front Left



Front Fender Right



Door Rear Right



Tail Light Left



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828



CONDITION REPORT



Report No:
2017287138
DATE
20/08/2026



Front Bumper



Front Bumper



Gearbox



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2050402R431828