



CONDITION REPORT



Report No:
2017284244
DATE
14/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/08/2026		M57 Pretoria Road - 1619
Inspection Date	14/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	MERCEDES-BENZ	Registration Number	FV25VJGP
Model	C220D AMG	Register Number	
VIN	WDD2053042F383640	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/03/2026
Color	GREY	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	149,004 KM	Fuel	DIESEL
Cab / Body Type	SEDAN / COUPE	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:

2017284244

DATE

14/08/2026



Damage

Repair Way

Bonnet stay and shocks Defective	Replace
Engine Management Lights Set	Repair
Sun Roof Defective	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Sunroof struggles to close. when sunroof is open	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.06	4.3	-	
Rear	2.49	4.03	-	
Emergency / Parking	1.23	1.67	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R18	95W	ilink	Radial	V	4125	2 mm
Front Right	225/45R18	95Y	Continental	Contisport	V	4822	0 mm
Rear Left	245/40R18	97Y	Continental	Contisport	V	0322	0 mm
Rear Right	245/40R18	97Y	Continental	Contisport	V	0322	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640

**CONDITION REPORT**

Report No:
2017284244
DATE
14/08/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS. SIGNS OF REPAIR WORK DONE TO BODY PANELS. POOR ALIGNMENT TO SOME BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:

2017284244

DATE

14/08/2026



LICENSE DISC



VIN PLATE OR STICKER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:
2017284244
DATE
14/08/2026



REAR LEFT CORNER



90 DEGREE RIGHT



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:

2017284244

DATE _____

14/08/2026



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

[illegible]

Brake test.



Diagnostic.



Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WDD2053042F383640




CONDITION REPORT




Report No:
2017284244
DATE
14/08/2026

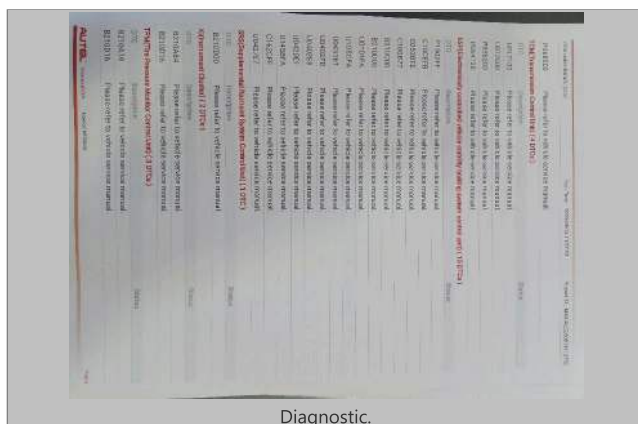


Diagnostic.

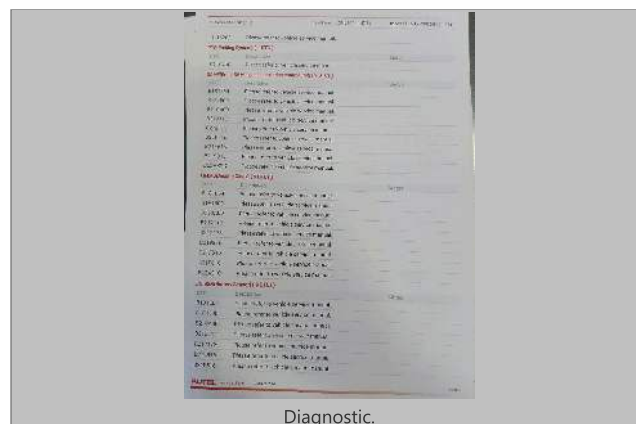


Diagnostic.

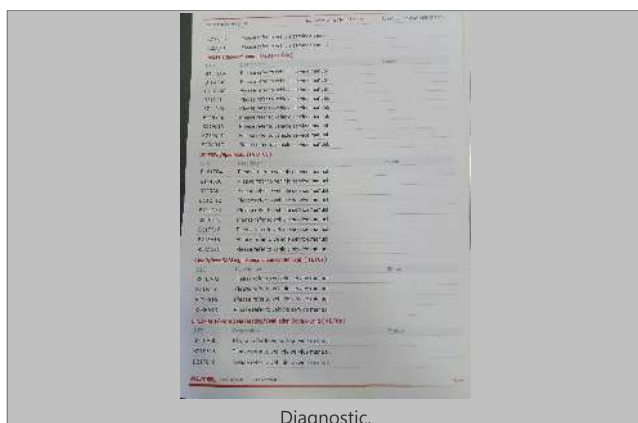


Diagnostic.

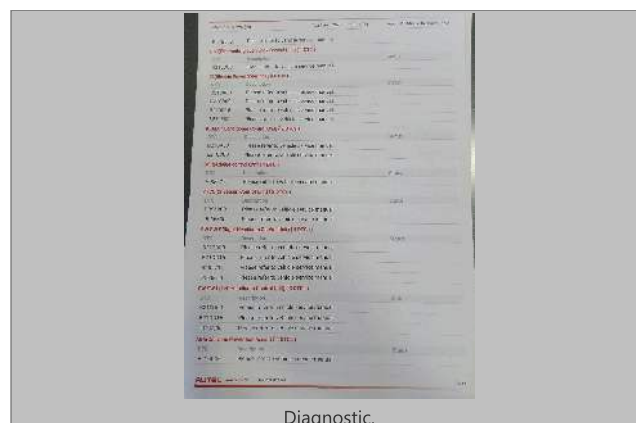

Diagnostic.

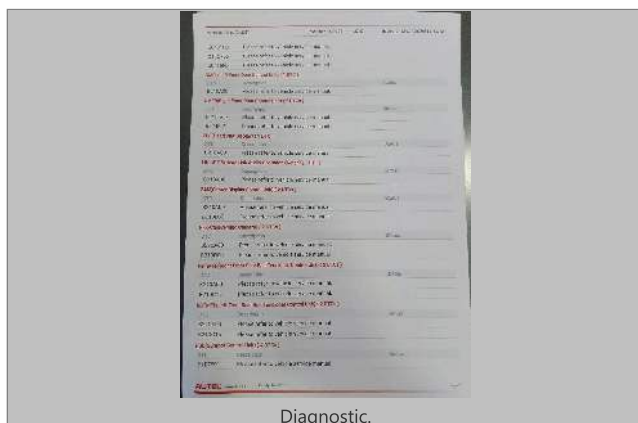

Diagnostic.

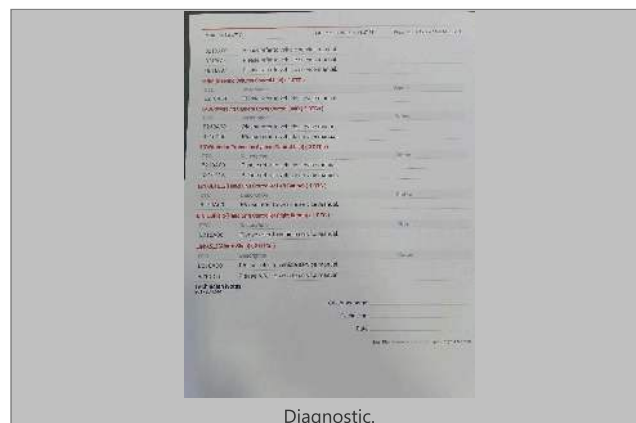

Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WDD2053042F383640



CONDITION REPORT



Report No:
2017284244
DATE
14/08/2026

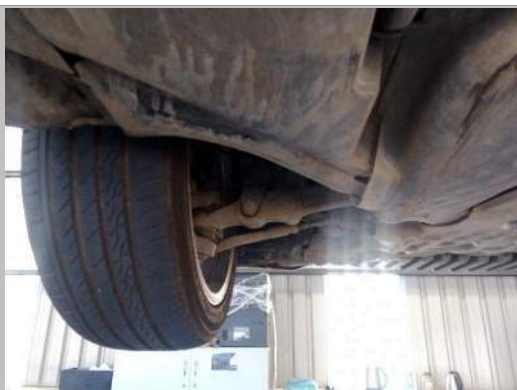


LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

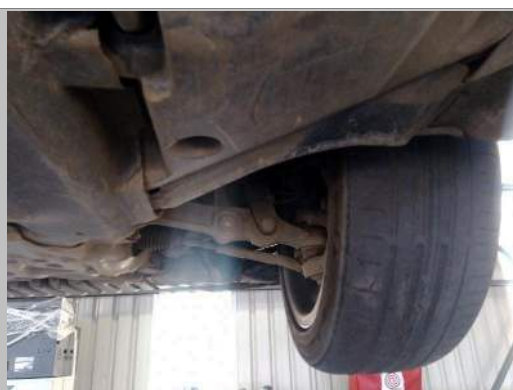

RF TYRE TREAD



ENGINE 1



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:
2017284244
DATE
14/08/2026



Bonnet stay and shocks



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:
2017284244
DATE
14/08/2026



Rear bumper



Rear bumper



Rear Fender Left



Front Fender Right



Rear Fender Right



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640



CONDITION REPORT



Report No:
2017284244
DATE
14/08/2026




Door Front Right



Engine Management Lights



Sun Roof

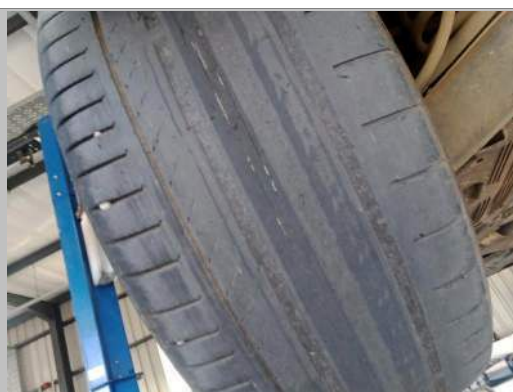

Tyre Rear Left



Tyre Rear Right



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD2053042F383640