



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/08/2026		M57 Pretoria Road - 1619
Inspection Date	05/08/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	FH85CYGP
Model	KUGA 1.5 ECOBOOST AMBIENTE AT [2016-2017]	Register Number	
		Date Of First Licensing	
VIN	WF0AXXWPMAGA23870	Last COR	
Engine Number		License Expiry Date	31/05/2025
Doors	5	Power / Displacement	
Color	BLUE	Paint Finish	M - METALLIC
Year Model	2016	Fuel	PETROL
Km Reading	199,261 KM	Transmission	AUTOMATIC
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:

2017280652

DATE

05/08/2026

Damage

Repair Way

Air cleaner Missing	Replace
Front Bumper Paintwork • Blisters	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Gearbox Oil Leak	Repair
Engine light on	Repair
Brakes	No brake test done vehicle is 4wd

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R17	103W	Royal black	Royal perfor	V	0925	4 mm
Front Right	235/55R17	103W	Royal black	Royal perfor	V	4824	4 mm
Rear Left	235/55R17	103W	Rapid	P609	V	2920	0 mm
Rear Right	235/55R17	103W	Rapid	P609	V	2920	0 mm
Spare	T155/70D17	110M	Maxxis	Temporary	V	4915	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	U3000:00-0F	CONTROL MODULE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0AXXWPMAGA23870




CONDITION REPORT




Report No:
2017280652
DATE
05/08/2026

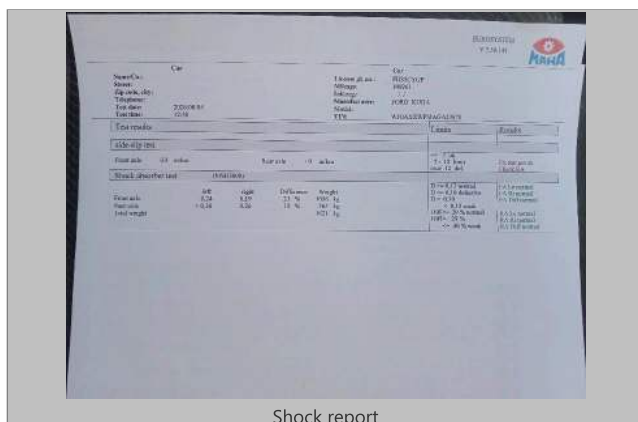


Shock report

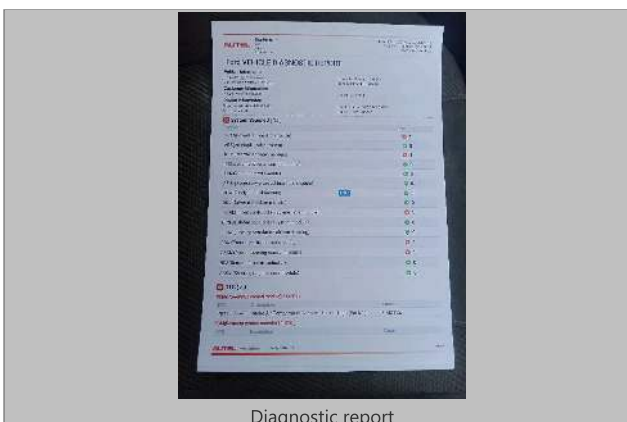


Diagnostic report

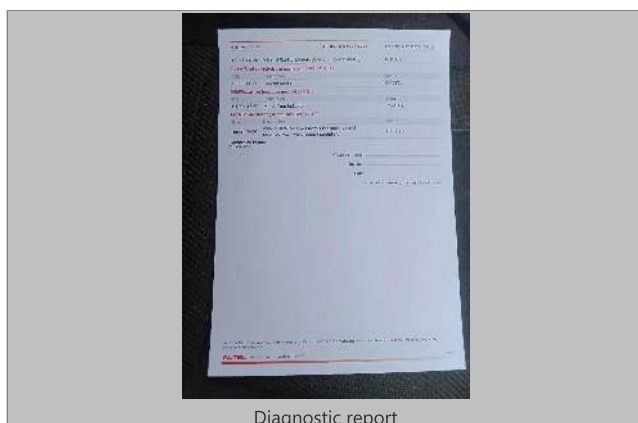

Diagnostic report

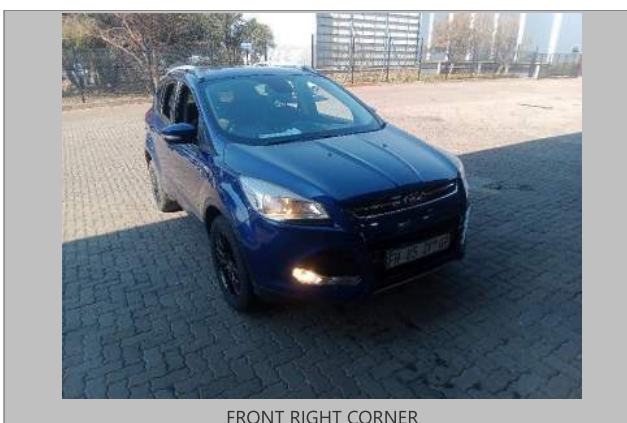

FRONT RIGHT CORNER

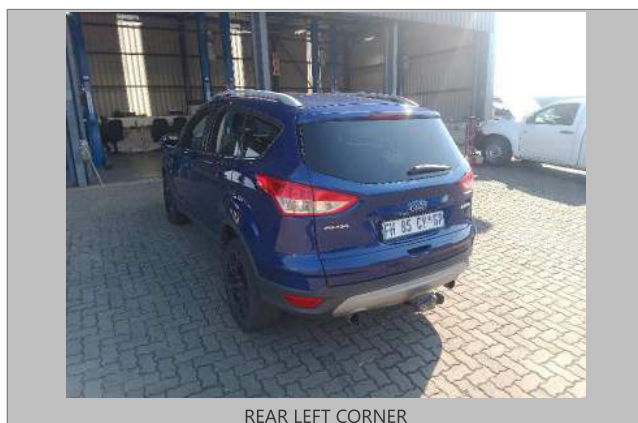

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:

2017280652

DATE

05/08/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

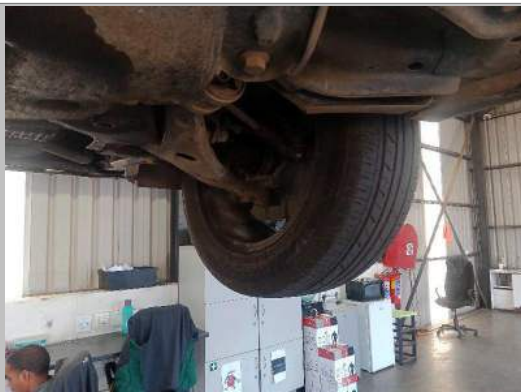

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026



Expection bottle



Water level



Bonnet



Air cleaner



Boot Lid / Hatch door



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870



CONDITION REPORT



Report No:
2017280652
DATE
05/08/2026



Tyre Rear Right



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0AXXWPMAGA23870