



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 10/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 10/09/2026        |                     | Kempton Park -           |

## Vehicle Data

|                 |                                      |                         |              |
|-----------------|--------------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                    | Registered Owner        | MFC          |
| Manufacturer    | FORD                                 | Registration Number     | LNy825MP     |
| Model           | FIESTA 1.4 AMBIENTE 5-DR [2015-2018] | Register Number         |              |
| VIN             | WF0DXXGAKDGT75229                    | Date Of First Licensing |              |
| Engine Number   |                                      | Last COR                |              |
| Doors           | 5                                    | License Expiry Date     |              |
| Color           | SILVER                               | Power / Displacement    |              |
| Year Model      | 2017                                 | Paint Finish            | M - METALLIC |
| Km Reading      | 142,510 KM                           | Fuel                    | PETROL       |
| Cab / Body Type | HATCHBACK                            | Transmission            | MANUAL       |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:

2017297009


DATE

10/09/2026

## Damage

## Repair Way

|                                             |                                                    |
|---------------------------------------------|----------------------------------------------------|
| Front Bumper Paintwork • Scratched          | Repair                                             |
| Bonnet Paintwork • Scratched                | Repair                                             |
| Front Fender Left Paintwork • Scratched     | Repair                                             |
| Rear Fender Right Residual Traces of Repair | Repair                                             |
| Door Front Left Paintwork • Scratched       | Repair                                             |
| Door Front Right Paintwork • Scratched      | Repair                                             |
| Door Rear Left Paintwork • Scratched        | Repair                                             |
| Door Rear Right Paintwork • Scratched       | Repair                                             |
| Rear bumper Paintwork • Scratched           | Repair                                             |
| Tie Rod End left Damaged                    | Replace                                            |
| Body exterior                               | Vehicle got minor scratches, stone chips and dents |
| Three hup caps missing                      | Replace                                            |
| Body exterior                               | Signs of spray work done on some body panels       |
| Rear tires deferred name brand              | Repair                                             |

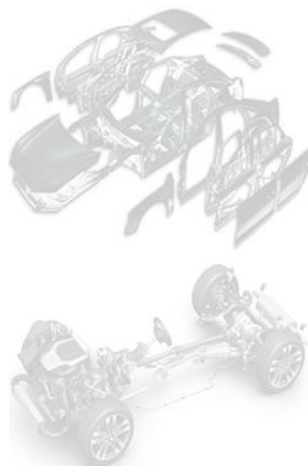

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 2.8                | 3.0                | -                |                                  |
| Rear                | 1.9                | 1.6                | -                |                                  |
| Emergency / Parking | 0.9                | 1                  | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model        | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------------|-------|-----------------|------------------|
| Front Left  | 195/50R15 | 82H              | Velocity    | Rota R       | V     | 4723            | 3 mm             |
| Front Right | 195/50R15 | 82H              | Velocity    | Rota R       | V     | 4723            | 3 mm             |
| Rear Left   | 195/50R15 | 82H              | Royal black | Royal perfor | V     | 4621            | 3 mm             |
| Rear Right  | 195/50R15 | 82V              | Tomket      | Sport        | V     | 1426            | 3 mm             |
| Spare       | 165/70R14 | 81T              | Dunlop      | Sp sport     | V     | 3024            | 4 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code        | Description                       | Status |
|----|--------|-------------|-----------------------------------|--------|
| 1  | CMDTCS | B1108:77-48 | DRIVER DOOR CENTRAL LOCKING MOTOR |        |

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT




Report No:

2017297009

DATE


10/09/2026

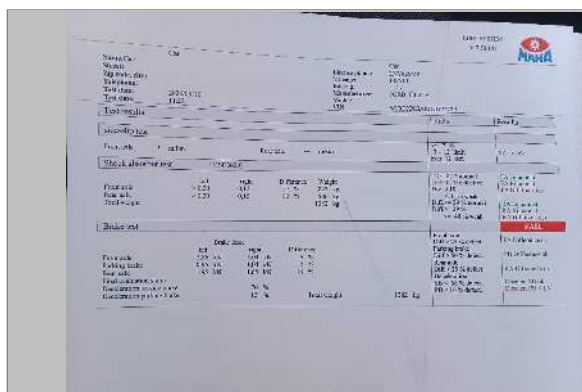

Shock and brake report



Diagnostic report

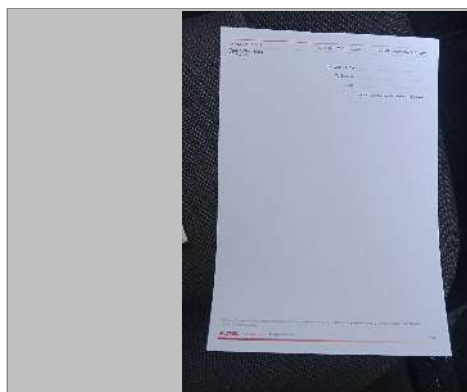

Diagnostic report



Spare wheel



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:

2017297009

DATE

10/09/2026



Manual



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

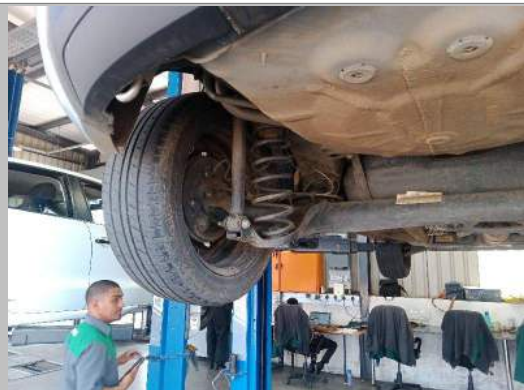

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026

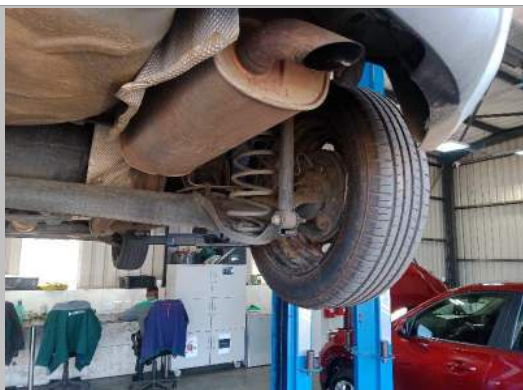

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0DXGAKDGT75229



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026



CHASSIS



Bonnet



Water level



Rear Fender Right



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0DXXGAKDGT75229



## CONDITION REPORT



Report No:  
2017297009  
DATE  
10/09/2026



Tie Rod End left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0DXXGAKDGT75229