



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	FY84BGGP
Model	FIESTA 1.4 AMBIENTE 5-DR [2015-2018]	Register Number	
VIN	WF0DXXGAKDHP34001	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2026
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	TWO COAT UNI
Km Reading	194,068 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026

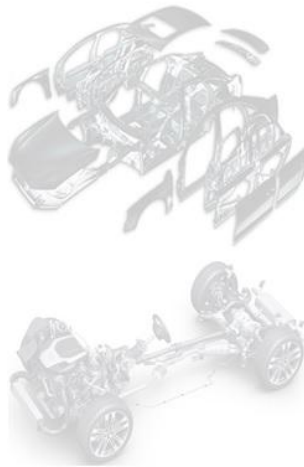

Damage	Repair Way
Engine Oil Leak	Repair
Under bonnet insulation cover Damaged	Replace
Seat Front Right Damaged	Replace
Dash Padding Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Gearbox Oil Leak	Repair
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.72	2.86	-	
Rear	1.64	1.57	-	
Emergency / Parking	1.28	1.52	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/45R16	84W	Durun	Radial	V	0121	2 mm
Front Right	195/45R16	84V	royal black	Radial	V	0424	1 mm
Rear Left	195/45R19	84V	Autogrip	Radial	V	2224	2 mm
Rear Right	195/50R16	88V	Kumho	Radial	V	0323	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:

2017296028

DATE

08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM	P1794:00-28	BATTERY VOLTAGE CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 9 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Repair work done to vehicle below standard.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0DXXGAKDHP34001




CONDITION REPORT




Report No:
2017296028
DATE
08/09/2026

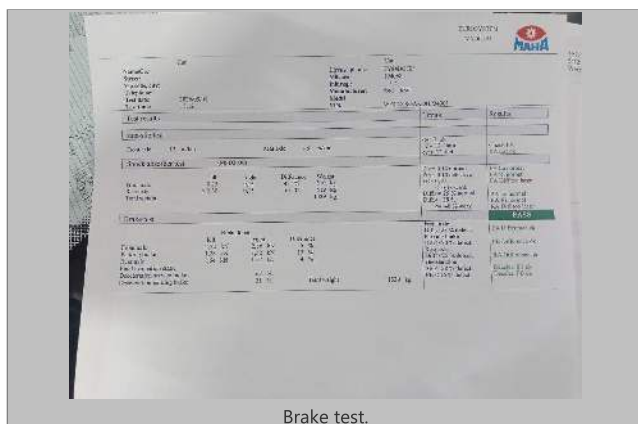

Brake test.

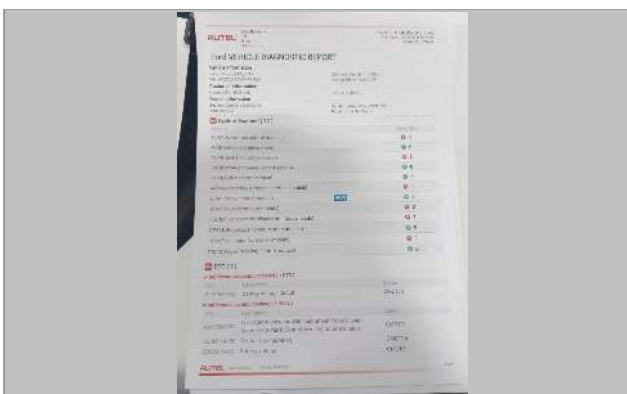

Diagnostic.

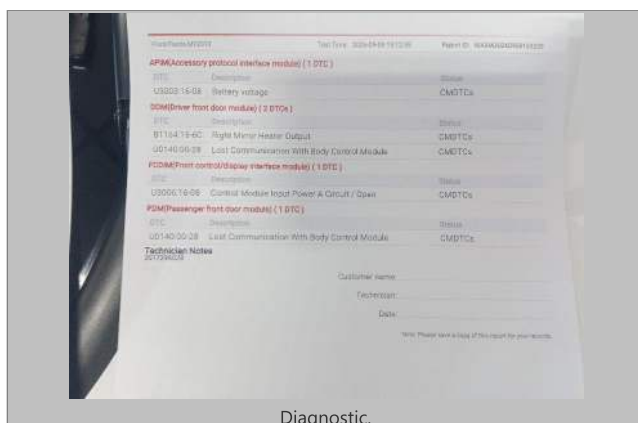

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:

2017296028

DATE

08/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001




CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026



90 DEGREE LEFT

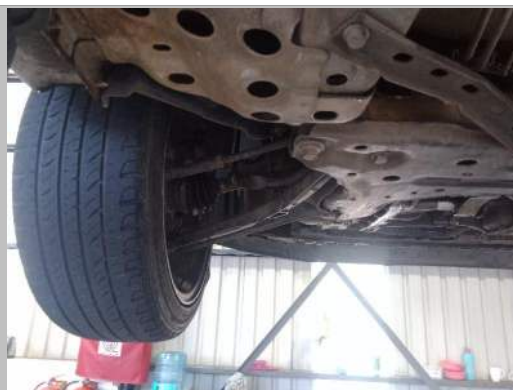

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026



Under bonnet insulation cover



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026



Front Fender Right



Windscreen



Seat Front Right



Dash Padding



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001



CONDITION REPORT



Report No:
2017296028
DATE
08/09/2026



Tyre Rear Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0DXXGAKDHP34001