



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	HV95XVGP
Model	FIESTA 1.0 TREND 5-DR AT [2018-2019]	Register Number	
VIN	WF0JXXGAHJB67139	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2027
Color	GREEN	Power / Displacement	
Year Model	2019	Paint Finish	PEARL EFFECT
Km Reading	145,964 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:

2017297518

DATE

11/09/2026

Damage

Repair Way

Indicator Light Front Left Damaged	Replace
Fog Light Rear Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Damaged	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Belly plates Damaged	Repair
Engine Noise Excessive	Repair
Jack Missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.01	-	
Rear	1.94	1.92	-	
Emergency / Parking	1.24	1.38	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55Z R16	87W	Centara	Vanti	V	1926	4 mm
Front Right	195/55Z R16	87W	Centara	Vanti	V	1926	5 mm
Rear Left	195/55Z R16	87W	Centara	Vanti	V	1426	5 mm
Rear Right	195/55Z R16	87W	Centara	Vanti	V	1926	5 mm
Spare	175/65 R14	86T	Continental	ContiEco	V	2818	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PDM(PASSENGER FRONT DOOR MODULE)	B1D06:15-28	LEFT TURN INDICATOR	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Minor dents and scratches on body panels.
Undercarriage: Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026

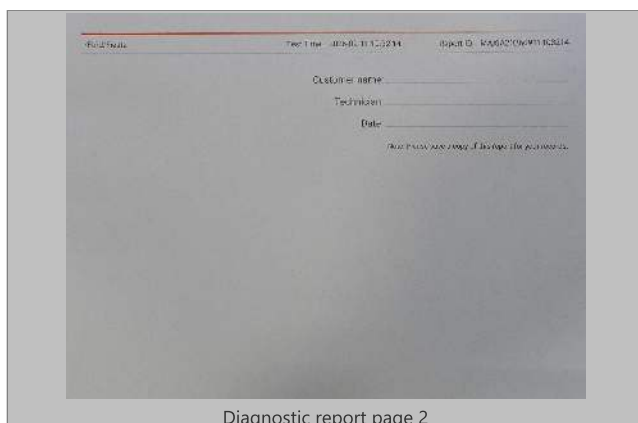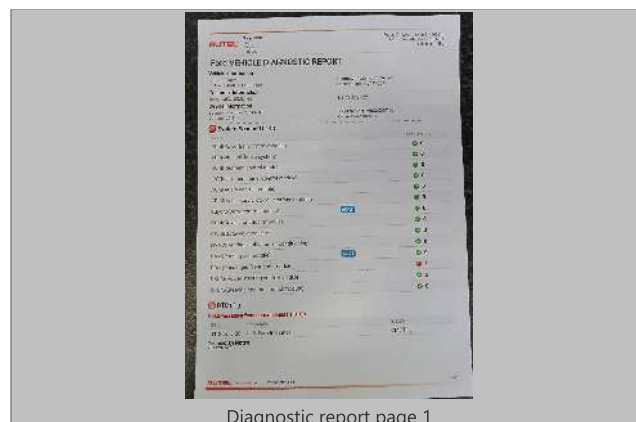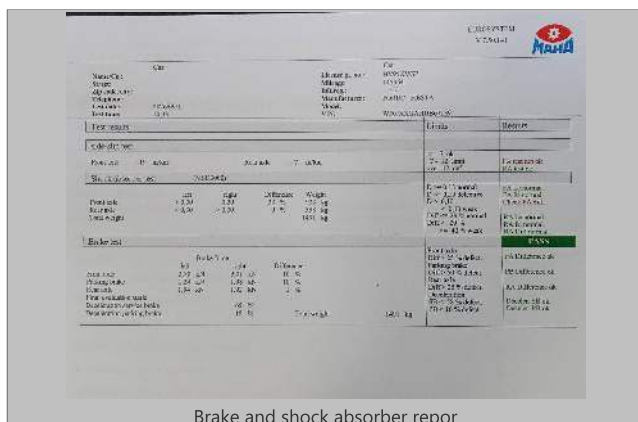

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:

2017297518

DATE

11/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026



Seat Front Right



Seat Rear



Rear Fender Right



Rear Fender Right



Door Rear Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026



Door Front Right



Door Front Right



Front Fender Right



Front Fender Right



Windscreen



Indicator Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT




Report No:
2017297518
DATE
11/09/2026



Door Front Left




Door Rear Left

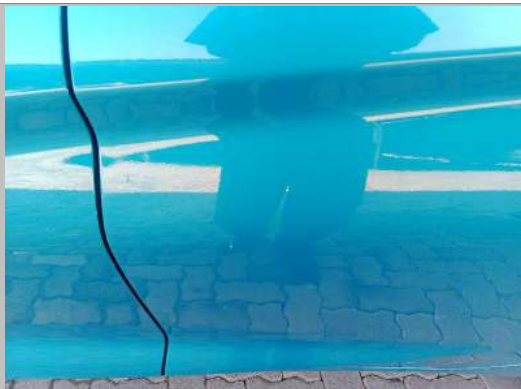

Door Rear Left



Seat Front Left

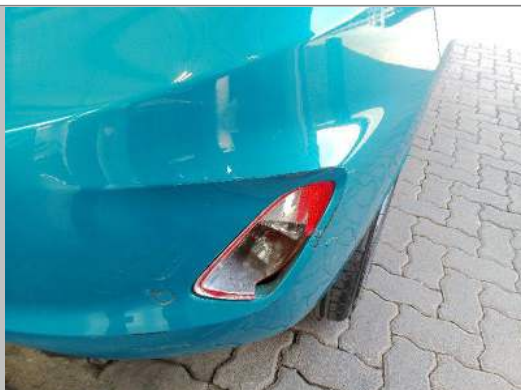

Fog Light Rear Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139



CONDITION REPORT



Report No:
2017297518
DATE
11/09/2026



Rear bumper



Bonnet



Water level



Front Bumper



Front Bumper




Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139

**CONDITION REPORT**

Report No:
2017297518
DATE
11/09/2026

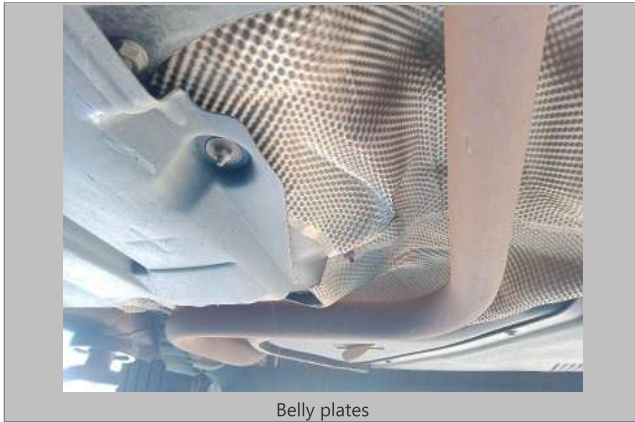

Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJB67139