



CONDITION REPORT



Report No:

2017284374

DATE

14/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/08/2026		M57 Pretoria Road - 1619
Inspection Date	14/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	JR64WTGP
Model	TIGUAN 2.0 TDI 110KW COMFORTLINE 4MOTION DSL DSG [2019-2021]	Register Number	
VIN	WVGZZZ5NZLW902466	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	160,910 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVGZZZ5NZLW902466



CONDITION REPORT



Report No:
2017284374
DATE
14/08/2026

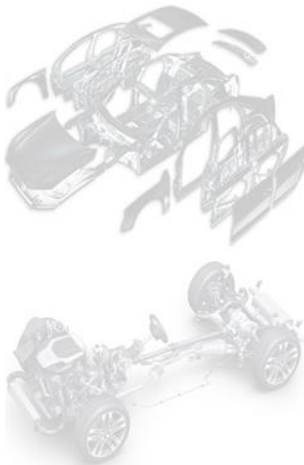

Damage	Repair Way
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
L/R tire deferred name brand and size	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/45R19	100V	Pirelli	Scorpion	V	3619	3 mm
Front Right	255/45R19	100V	Pirelli	Scorpion	V	4619	3 mm
Rear Left	215/65R17	99V	Michelin	Primacy 3	V	2420	3 mm
Rear Right	255/45R19	100V	Pirelli	Scorpion	V	4619	3 mm
Spare	255/45R19	100V	Pirelli	Scorpion	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZLW902466



CONDITION REPORT



Report No:
2017284374
DATE
14/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE SPORADIC	U140000	FUNCTION RESTRICTION DUE TO LOW VOLTAGE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZLW902466



CONDITION REPORT



Report No:
2017284374
DATE
14/08/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZLW902466



CONDITION REPORT



Report No:

2017284374

DATE

14/08/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)



Automatic



LR TYRE TREAD

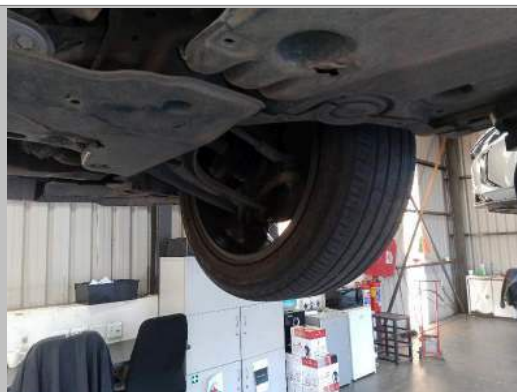

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZLW902466



CONDITION REPORT



Report No:


2017284374

DATE

14/08/2026



LF TYRE TREAD

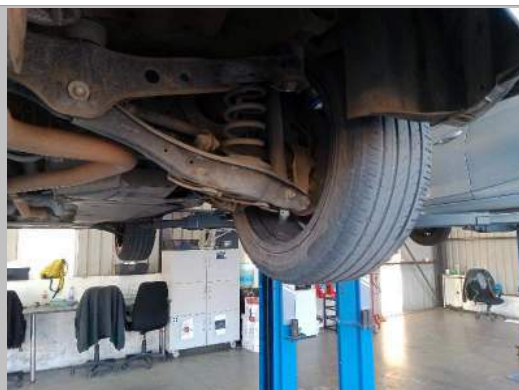

RR TYRE TREAD



Spare wheel fitted



Oil cap and dipstick



Expection bottle



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZLW902466



CONDITION REPORT



Report No:
2017284374
DATE
14/08/2026



CHASSIS




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC

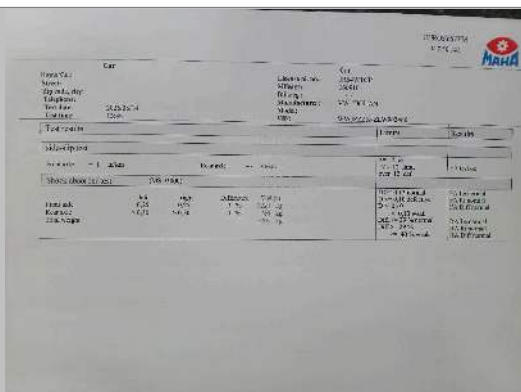

SHOCK REPORT



DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZLW902466



CONDITION REPORT




Report No:


2017284374

DATE


14/08/2026

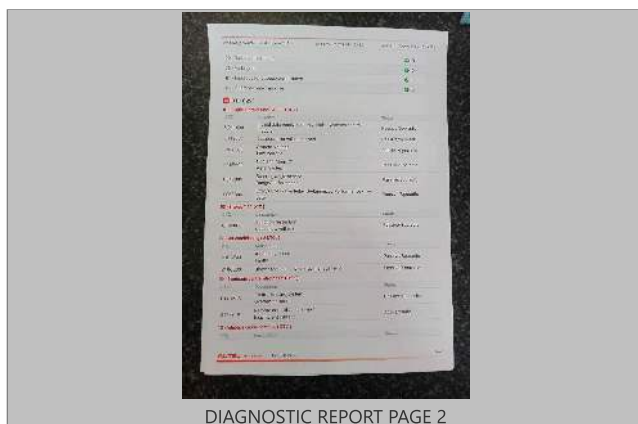

DIAGNOSTIC REPORT PAGE 2

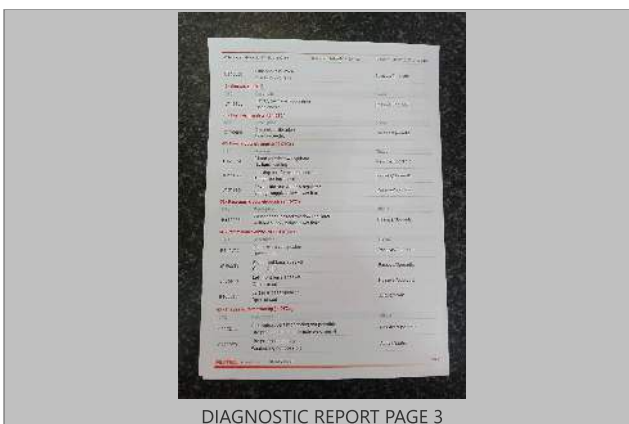


DIAGNOSTIC REPORT PAGE 3

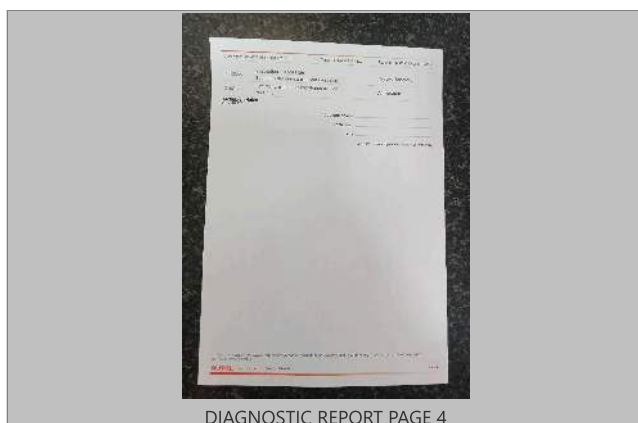


DIAGNOSTIC REPORT PAGE 4



Water level

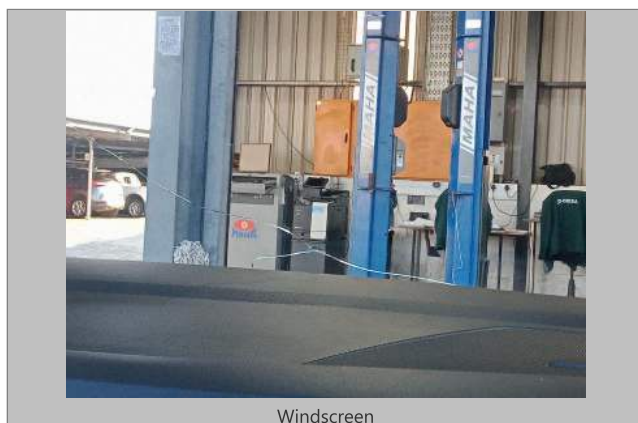

Windscreen

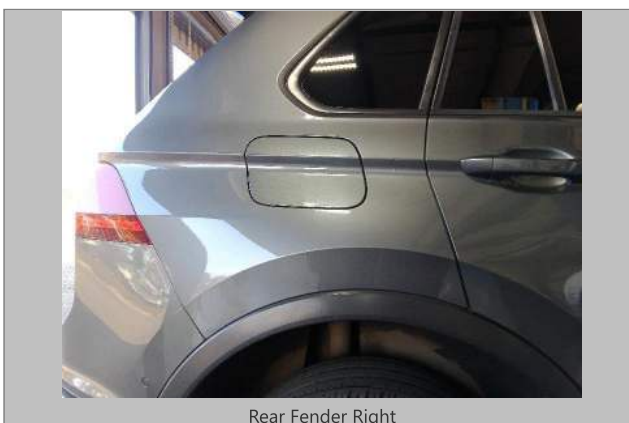

Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGGZZ5NZLW902466



CONDITION REPORT



Report No:
2017284374
DATE
14/08/2026



Door Rear Right



Door Front Right



Side Mirror Right



Front Bumper



Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZLW902466



CONDITION REPORT



Report No:
2017284374
DATE
14/08/2026



Door Front Left



Door Rear Left



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZLW902466