




CONDITION REPORT



Report No:
2017299013
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

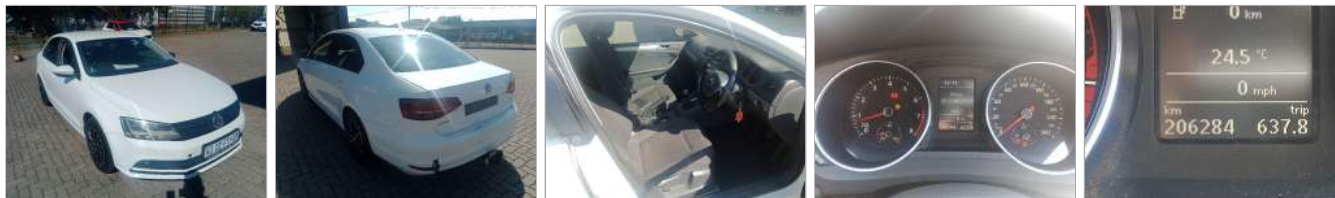

Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	HJ22FTGP
Model	JETTA 6 GP 1.2 TSI TRENDLINE 77KW [2016-2019]	Register Number	
		Date Of First Licensing	
VIN	WWWZZZ16ZJM013012	Last COR	
Engine Number		License Expiry Date	30/11/2026
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	PETROL
Km Reading	206,284 KM	Transmission	MANUAL
Cab / Body Type	SEDAN		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ16ZJM013012



CONDITION REPORT



Report No:

2017299013

DATE

15/09/2026

Damage

Repair Way

Center Console / Cubbyhole + Lid Damaged	Repair
Tail Light Right Damaged	Repair
Seat Front Right Damaged	Repair
Side Mirror Left Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Replace
Windscreen Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.57	3.57	-	
Rear	3.63	2.29	-	
Emergency / Parking	1.14	1.11	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	94W	Trazano	Radial	V	0125	2 mm
Front Right	205/55R16	94W	Trazano	Radial	V	0125	2 mm
Rear Left	205/55R16	91V	Pirelli	Radial	V	1523	3 mm
Rear Right	205/55R16	91V	Pirelli	Radial	V	1523	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ16ZJM013012

**CONDITION REPORT**

Report No:

2017299013

DATE

15/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ16ZJM013012



CONDITION REPORT




Report No:


2017299013

DATE


15/09/2026

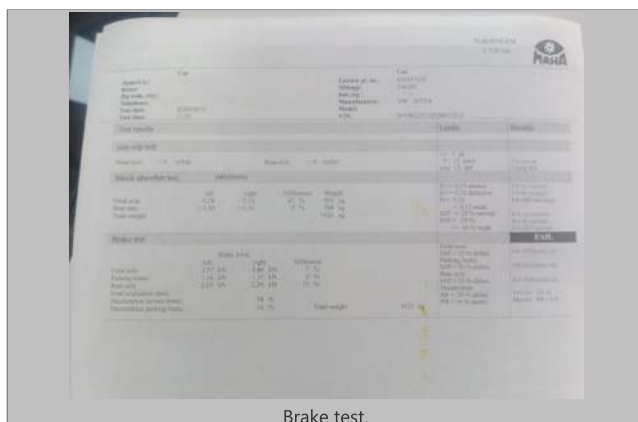

Brake test.

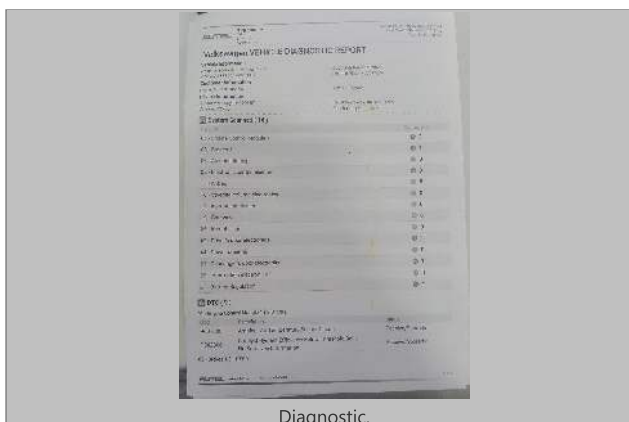

Diagnostic.

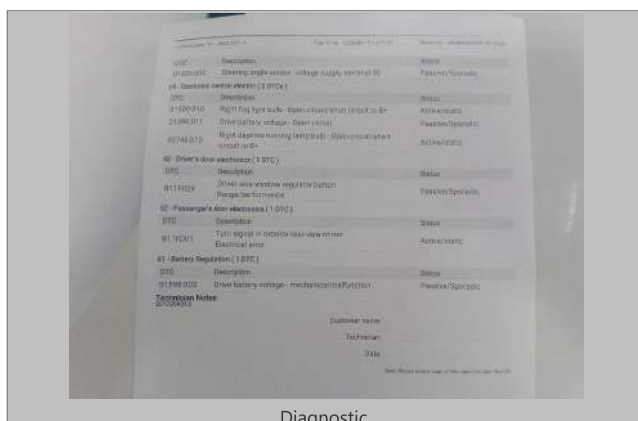

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZ16ZJM013012



CONDITION REPORT



Report No:
2017299013
DATE
15/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZ16ZJM013012



CONDITION REPORT



Report No:

2017299013

DATE

15/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ16ZJM013012



CONDITION REPORT



Report No:
2017299013
DATE
15/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVWZZZ16ZJM013012



CONDITION REPORT



Report No:
2017299013
DATE
15/09/2026



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZ16ZJM013012



CONDITION REPORT



Report No:
2017299013
DATE
15/09/2026



Door Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZ16ZJM013012



CONDITION REPORT



Report No:
2017299013
DATE
15/09/2026



Front Fender Right



Roof



Windscreen



Seat Front Right



Center Console / Cubbyhole + Lid



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ16ZJM013012