



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	BN02SSGP
Model	POLO SEDAN 1.6 COMFORTLINE TIPTRONIC [2011-2015]	Register Number	
		Date Of First Licensing	
VIN	WVWZZZ60ZBT057528	Last COR	
Engine Number		License Expiry Date	31/03/2026
Doors	4	Power / Displacement	
Color	RED	Paint Finish	M - METALLIC
Year Model	2011	Fuel	PETROL
Km Reading	261,893 KM	Transmission	AUTOMATIC
Cab / Body Type	SEDAN		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ60ZBT057528



CONDITION REPORT



Report No:

2017297406

DATE

11/09/2026

Damage

Repair Way

Tail Light Left Cracked	Replace
Headlight Right Damaged	Replace
Side Mirror Left Paintwork • Flaking	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Bonnet Paintwork • Chipmarks	Repair
A • Pillar Right Paintwork • Flaking	Repair
Front Fender Left Paintwork • Flaking	Repair
Front Fender Right Cracked	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Chipmarks	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Stabilizer Mounting Front Left Damaged	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Catalytic converter Missing	Replace
Gearbox Oil Leak	Repair
Engine Performance Idling / Hunting	Repair
Warning lights illuminated	Repair
Some body panels misaligned	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	3.1	-	
Rear	1.9	1.6	-	
Emergency / Parking	1.4	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Yokohama	Bluearth	V	3122	0 mm
Front Right	185/60R15	84H	Nexen	Nprize	V	0622	0 mm
Rear Left	185/60R15	84H	Nexen	Nprize	V	0322	5 mm
Rear Right	185/60R15	84H	Yokohama	Bluearth	V	3122	3 mm
Spare	175/70R14	84T	Apollo	Acelere	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: VVWZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	16684:000	RANDOM/ MULTIPLE CYLINDER MISFIRE DETECTED	
2	ENGINE CONTROL MODULE	16686:000	CYL.2 MISFIRE DETECTED	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026

Car				MMA	
Model	Volkswagen	Year	2015	Engine	1.4 TSI
Registration	BN 02 SS 67	Color	Red	Transmission	Manual
Test Date	11/09/2026	Test Mileage	100	Test Location	DEKRA
Test Results					
Shock and Brake	Pass	Steering	Pass	Brake	Pass
Chassis	Pass	Wheels	Pass	Engine	Pass
Electrical	Pass	Interior	Pass	Exterior	Pass
Overall	Pass	Test Result	Pass	Test Status	Pass

Shock and brake report

Volkswagen VEHICLE DIAGNOSTIC REPORT	
Vehicle ID	BN 02 SS 67
Engine ID	1.4 TSI
Transmission ID	Manual
Chassis ID	Pass
Electrical ID	Pass
Interior ID	Pass
Exterior ID	Pass
Overall ID	Pass
Test Result	Pass
Test Status	Pass

Diagnostics report



Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ60ZBT057528



CONDITION REPORT



Report No:

2017297406

DATE

11/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ60ZBT057528



CONDITION REPORT




Report No:
2017297406
DATE
11/09/2026



90 DEGREE LEFT



LF TYRE TREAD

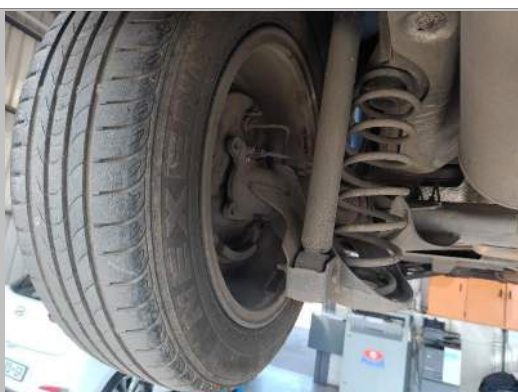

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ60ZBT057528



CONDITION REPORT



Report No:

2017297406

DATE

11/09/2026




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

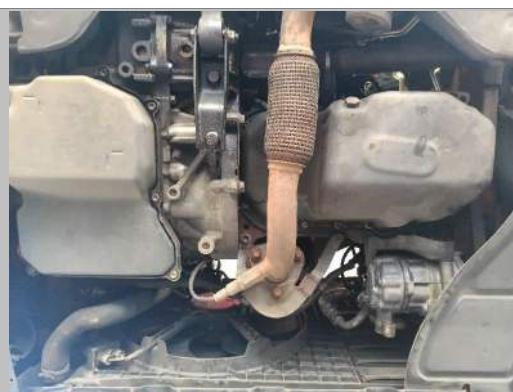

ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026



Expansion bottle




Warning lights



Oil cap and dipstick



Side Mirror Right

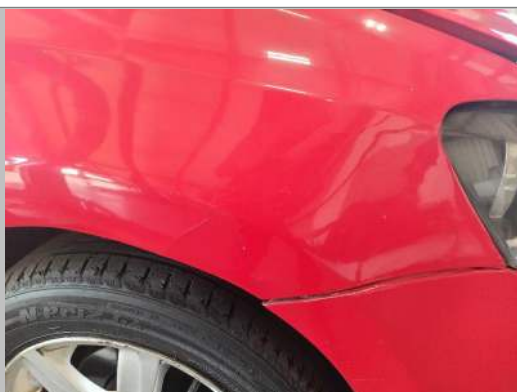

Front Fender Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026



Door Rear Right



A • Pillar Right



A • Pillar Right



Boot Lid / Hatch door



Boot Lid / Hatch door



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VVVZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026

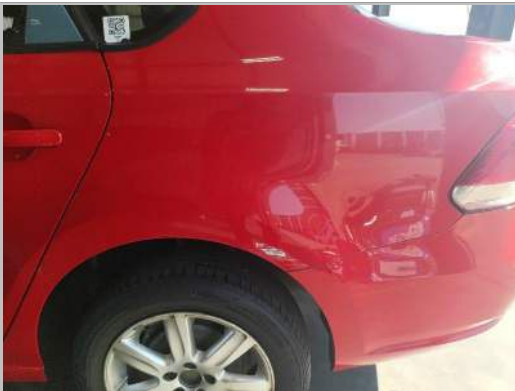


Rear Fender Left



Door Rear Left



Door Front Left

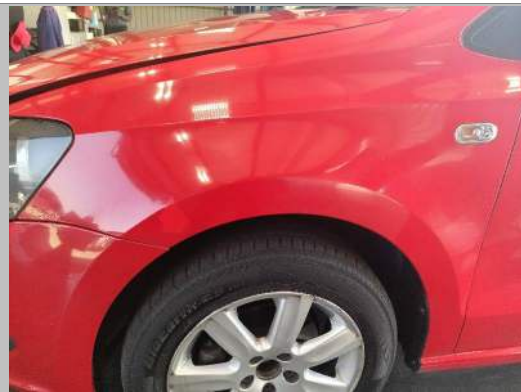

Front Fender Left



Side Mirror Left



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026



Headlight Right



Water level



Grill



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZ60ZBT057528



CONDITION REPORT



Report No:

2017297406

DATE

11/09/2026



Front Bumper



Tyre Front Left



Stabilizer Mounting Front Left



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026



Tyre Front Right



Catalytic converter



Catalytic converter



Gearbox



Gearbox



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VVVZZZ60ZBT057528



CONDITION REPORT



Report No:
2017297406
DATE
11/09/2026

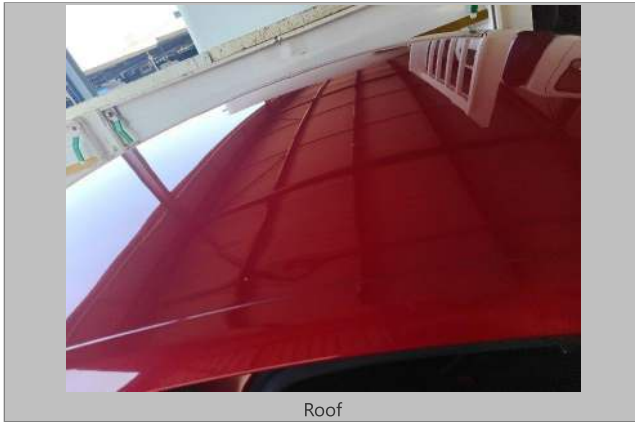

Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZBT057528