



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/01/2024		M57 Pretoria Road - 1619
Inspection Date	11/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JY93NPGP
Model	POLO	Register Number	
VIN	WVWZZZ60ZDT041304	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/06/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	171,237 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Switch Electrical Window Winder rear left Defective	Repair
Park Light Front Left Defective	Repair
Park Light Front Right Defective	Repair
Tail Light Left Broken	Replace
Tail Light Right Cracked	Replace
Dim Light Left Defective	Repair
Fog Light Front Right Defective	Repair
Seat Front Right Torn / Cut	Repair
Seat Belt Front Left Damaged	Replace
Seat Belt Front Right Damaged	Repair
Front Bumper Paintwork • Scratched	Replace
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Caliper 1. Axle right Leak	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Damaged	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Rim Rear Left Damaged	Repair
Main Beam Left Damaged	Repair
CV Joint(s) Front Right (inner/outer) Damaged	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ60ZDT041304



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Damage	Repair Way
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.7	-	
Rear	2.2	2.0	-	
Emergency / Parking	1.5	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Continental	Contact	V	4421	0 mm
Front Right	185/60R15	84T	Apollo	Acelere	V	4212	3 mm
Rear Left	185/65R15	92H	Dunlop	Sport	V	1522	0 mm
Rear Right	185/65R15	92H	Dunlop	Sport	V	1522	0 mm
Spare	185/65R15	92T	Barum	Brilliantis	V	///////	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Lights: Both front headlights are loose
Body • Exterior: Minor dents scratches and stone chips on

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

VIN: WAAMZ766070102597

Report No: 2016225797

2 / 15

DATE

11/01/2024




Shock and brake



Diagnostic test



Diagnostic test

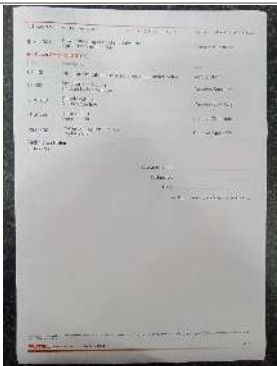

Diagnostic test



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797
VIN: WWWZZZ60ZDT041304
DATE
3/11
11/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
17/01/2024
VIN: VVWZZZ60YD0012824
4 / 15



Warning light illuminated



Warning light illuminated



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WVVZZZ60ZDT041304

5 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WVVZZZ60ZDT041304

6 / 15



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WVVZZZ60ZDT041304
7 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024



LR TYRE TREAD



RR TYRE TREAD




RF TYRE TREAD



Sparewheel



LICENSE DISC

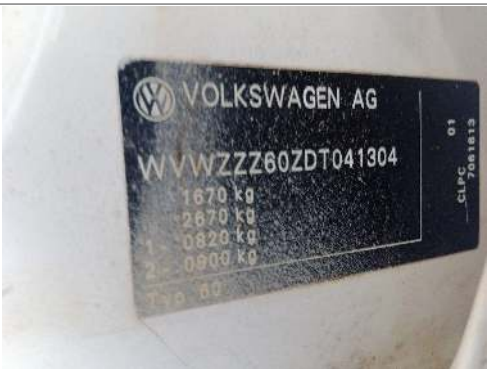

VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WVVWZZZ60ZDT041304
9 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

ENGINE 1



ENGINE 2



CHASSIS



Rear end



Manual



Windscreen



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WWWZZZ60ZDT041304
11 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Control Arm Bush(es) Front Axle Right



Tie Rod End right



CV Joint(s) Boot(s) Front Right (inner/outer)



Stabilizer Mounting Front Right



Fog Light Front Right



Front Bumper



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WWWZZZ60ZDT041304
13 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Front Bumper



Front Bumper

VIN: WVVZZZ60ZDT041304

14 / 15



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Stabilizer Mounting Front Left



Tie Rod End left



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

VIN: WWZZZ60ZDT041304
15 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Tie Rod End left



CV Joint(s) Boot(s) Front Left (inner/outer)



Tyre Rear Left



Rim Rear Left



Tail Light Left



Rear bumper



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Rear bumper



Rear bumper



Rear bumper



Tail Light Right



Tyre Rear Right



CV Joint(s) Front Right (inner/outer)



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Caliper 1. Axle right



Front Bumper



Radiator Cradle



Main Beam Left



Sill Panel Left



Rim Rear Left



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Boot Lid / Hatch door



Switch Electrical Window Winder rear left



Seat Belt Front Left



Park Light Front Left



Park Light Front Right



Dim Light Left



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

Seat Front Right



Seat Belt Front Right



CONDITION REPORT

Report No: 2016225797

DATE
11/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za