

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/11/2024		M57 Pretoria Road - 1619
Inspection Date	07/11/2024		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	NO REG
Model	GOLF 7 1.4 TSI COMFORTLINE BLUEMOTION	Register Number	
	92KW 5-DR DSG [2016-2017]	Date Of First Licensing	
VIN	WVWZZZAUZH030743	Last COR	
Engine Number		License Expiry Date	07/11/2024
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2016	Fuel	PETROL
Km Reading	116,402 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

## Vehicle Options & Accessories

### Items


## VEHICLE INSPECTION

### Damage

### Repair Way

Door Handle Front Right Damaged  
Side Mirror Left Damaged  
Front Bumper Paintwork • Scratched  
Sill Panel Left Dented  
Electronics malfunction, electric sunroof faulty  
Warning lights illuminated

Repair  
Replace  
Repair  
Repair  
Repair  
Repair.

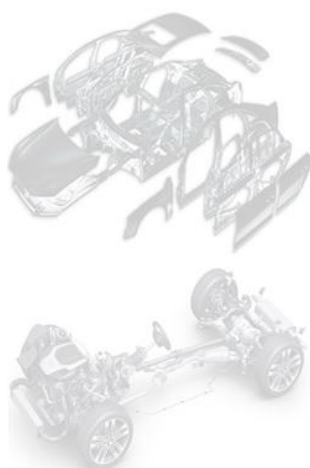

## Brakes

### Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	3.3	3.2	-	
Rear	2.1	2.1	-	
Emergency / Parking	1.6	1.9	-	

## Tyres and Rims

### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Continental	Contact	V	2316	5 mm
Front Right	205/55R16	91V	Pirelli	P7	V	4920	5 mm
Rear Left	205/55R16	91V	Pirelli	P7	V	4926	6 mm
Rear Right	205/55R16	91V	Pirelli	P7	V	4920	6 mm
Spare	205/55R16	91W	Continental	Contact	V	0000	2 mm

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P068A00	ECM/PCM POWER RELAY DE ENERGIZED PERFORMANCE TOO E	

## Inspection Conditions

No Test Drive  
Vehicle doesn't start  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS MINOR DENTS, SCRATCHES & STONE CHIPS ON VARIOUS BODY PANELS. SIGNS OF SPRAY WORK DONE ON VARIOUS BODY PANELS. ENGINE, UNDERCARRIAGE AND CONTROL ARM BUSHES FULLY COVERED.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT



## CONDITION REPORT

Report No: 2016602524  
VIN: WVVZZZAUZHW030743  
DATE  
3/8  
07/11/2024





ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



Warning lights illuminated



INTERIOR (FRONT DRIVER DOOR)



Automatic



LF TYRE TREAD





LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



Expansion bottle



Oil cap and dipstick

VIN: WVVZZZAUZH030743

7 / 8





Rear end



ENGINE 1



CHASSIS



ENGINE 2







VIN PLATE OR STICKER



LICENSE DISC MISSING



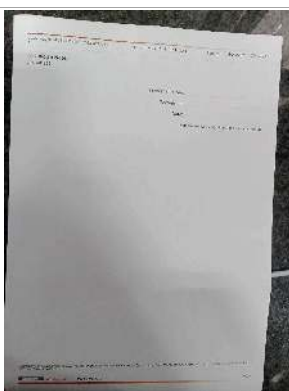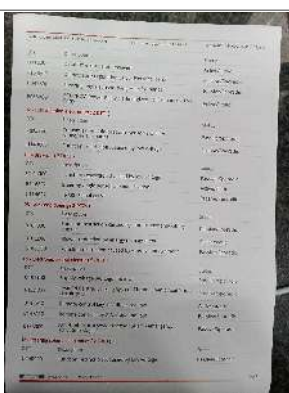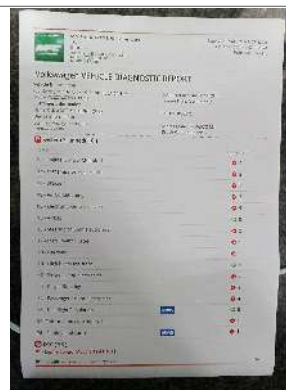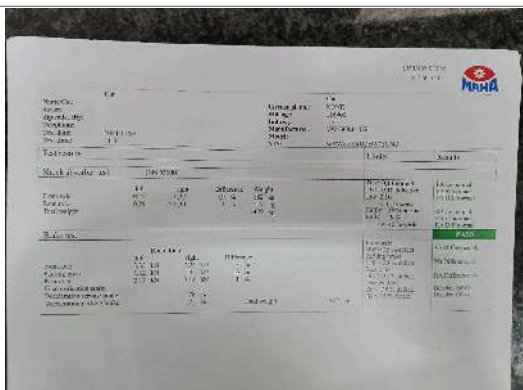





Front Bumper



Sill Panel Left



Door Handle Front Right





## CONDITION REPORT

Report No: 2016602524

DATE  
07/11/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)