



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	NO REG
Model	GOLF 7 R 2.0 TSI 206KW 4MOTION 5-DR DSG [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	WWWZZZAUZHW155050	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2017	Fuel	PETROL
Km Reading	101,874 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZAUZHW155050



CONDITION REPORT



Report No:

2017297653

DATE

11/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Oil Sweat	Repair
Water level Insufficient	Replace
Bonnet stay and shocks Damaged	Replace
Seat Front Right Torn / Cut	Repair
Bonnet Dented	Repair
Rear Fender Right / Inner Tray Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Brake disc 1. Axle left Corrosion	Replace
Brake disc 1. Axle right Corrosion	Replace
Brake disc 2. Axle left Corrosion	Replace
Brake disc 2. Axle right Corrosion	Replace
Tyre Front Left Smooth	Replace
Rim Rear Right Welded	Replace
Catalytic converter Welded	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Gear Selections Insufficient	Repair
Body exterior	Signs of spray work done on body panels
Warning lights illuminated	Repair
Body exterior	Minor dents scratches stone chips on body panels
Vehicle is a non runner	Repair
No battery	Replace
Body exterior	Residual traces of poor repair on body panels
hail damaged on body panels	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/35R19	91Y	Pirelli	Pzero	V	0221	0 mm
Front Right	235/35R19	91Y	Bridgestone	Potenza	V	5123	1 mm
Rear Left	235/35R19	91Y	Tracmak	Privilo	V	2323	4 mm
Rear Right	235/35R19	91Y	Royal black	Explorer	V	4824	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZAUZHW155050



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INSTRUMENT CLUSTER	B1301F0	TRANSMISSION CONTROL MODULE (TCM) NOT AUTHORIZED	
2	TRANSMISSION ELECTRONICS	P170100	TRANSMISSION CONTROL UNIT LOCKED	

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZAUZHW155050



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



Automatic transmission




Warning lights illuminated



Interior A pillar panel is loo



No sparewheel

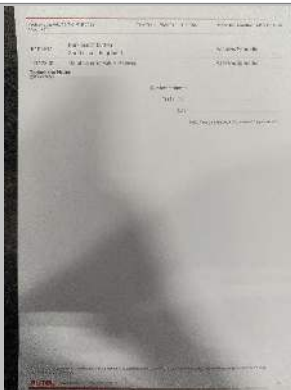

Diagnostics report



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZAUZH155050



CONDITION REPORT



Report No:

2017297653

DATE

11/09/2026




Oil cap and dipstick




No battery



Diagnostics report

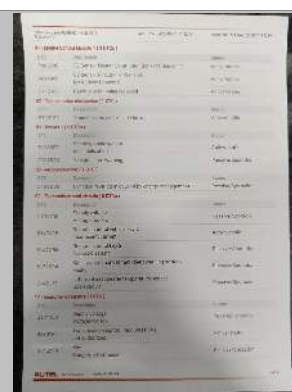

Diagnostics report

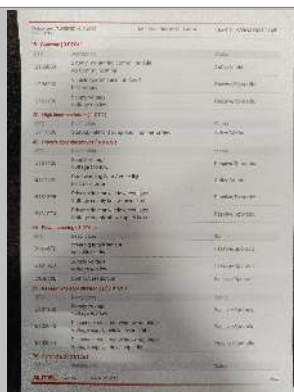

Diagnostics report



No license disc

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZAUZH155050



CONDITION REPORT



Report No:

2017297653

DATE

11/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER




INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

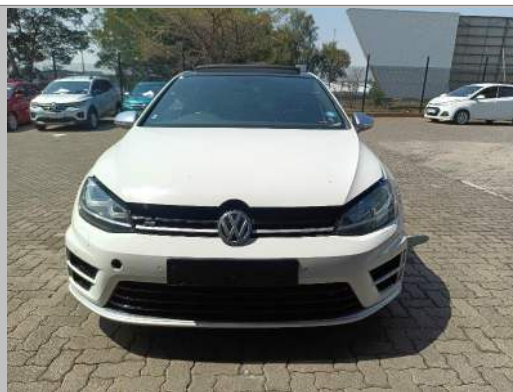

90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVWZZAUZH155050



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZHW155050




CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



RF TYRE TREAD

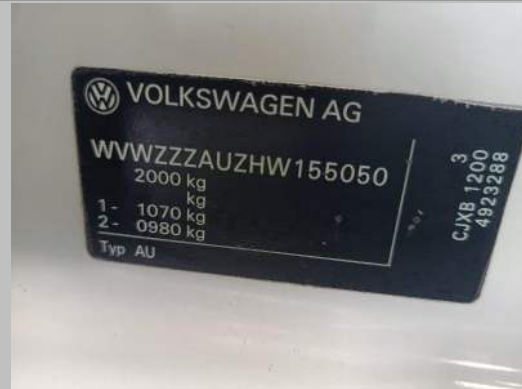

VIN PLATE OR STICKER



REAR



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZHW155050



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



Seat Front Right



Seat Front Right



Bonnet stay and shocks



Water level



Brake disc 2. Axle right



Brake disc 1. Axle right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZHW155050



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



Brake disc 1. Axle left



Tyre Front Left



Brake disc 2. Axle left



Rear bumper



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZHW155050



CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



CV Joint(s) Boot(s) Front Left (inner/outer)



Gearbox



Gearbox



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZHW155050




CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



Engine

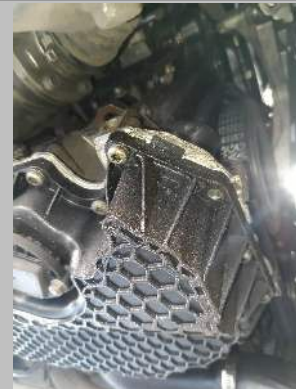

Engine



Hoses



Hoses



Hoses



Hoses

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZAUZHW155050




CONDITION REPORT



Report No:
2017297653
DATE
11/09/2026



Catalytic converter

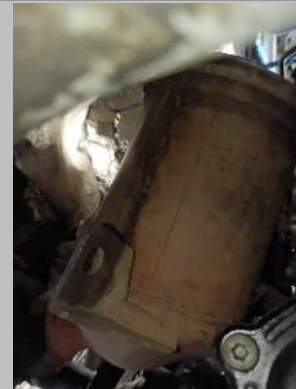

Catalytic converter



Rim Rear Right



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZHW155050



CONDITION REPORT




Report No:
2017297653
DATE
11/09/2026



Roof



Roof

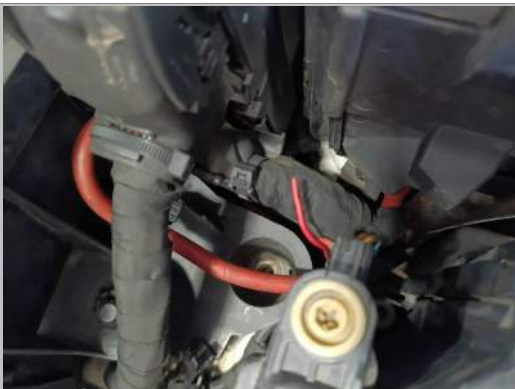

Engine Wiring



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZHW155050