



CONDITION REPORT



Report No:

2017290434

DATE

27/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/08/2026		M57 Pretoria Road - 1619
Inspection Date	27/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JK59CKGP
Model	GOLF 7 1.4 TSI COMFORTLINE BLUEMOTION 92KW 5-DR DSG [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	WWZZZAUZKP089309	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	SILVER	Paint Finish	M - METALLIC
Year Model	2020	Fuel	PETROL
Km Reading	176,398 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWZZZAUZKP089309



CONDITION REPORT



Report No:

2017290434

DATE

27/08/2026



Damage

Repair Way

Dim Light Left Malfunction	Repair
Fog Light Front Right Malfunction	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Engine management lights illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.1	4.1	-	
Rear	2.3	2.5	-	
Emergency / Parking	1.4	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Firestone	Touring	V	3124	3 mm
Front Right	205/55R16	91V	Firestone	Touring	V	3124	3 mm
Rear Left	205/55R16	91V	Firestone	Touring	V	3124	3 mm
Rear Right	205/55R16	91V	Firestone	Touring	V	3124	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE SPORADIC	U102600	TRANSMISSION CONTROL MODULE CHECK EVENT MEMORY	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVVZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026

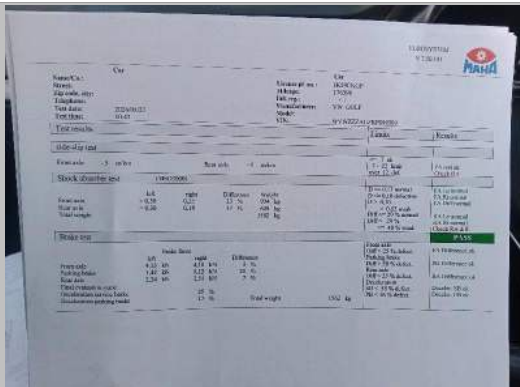


Shock and brake report



Diagnostic report



Diagnostic report

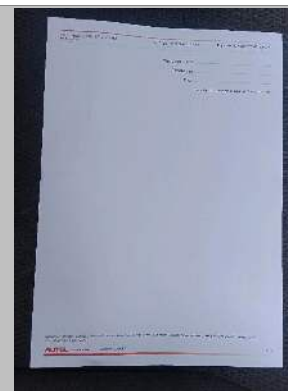

Diagnostic report



No spare wheel



Expendition bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



Oil cap and dipstick



Automatic



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



ENGINE 2



CHASSIS



Water level



Side Mirror Right



Front Bumper



Dim Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAUZKP089309




CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



Fog Light Front Right

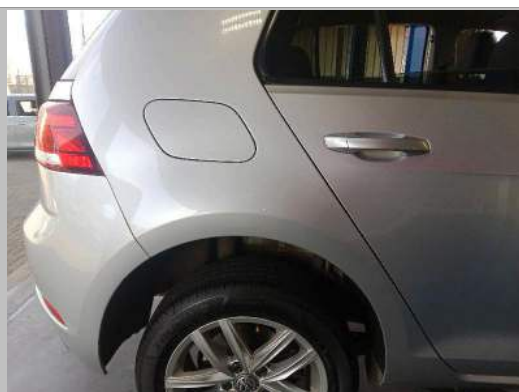

Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZKP089309



CONDITION REPORT



Report No:
2017290434
DATE
27/08/2026



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZKP089309